

**BEFORE THE HON'BLE NATIONAL GREEN TRIBUNAL  
SOUTHERN ZONE, CHENNAI**

**Appeal No. 6 of 2024 (SZ)**

**BETWEEN**

M/s.Renu Gold Covering  
Rep. by its Proprietor,  
Thrissur, Kerala

...Appellant

**AND**

The Chairman,  
Kerala State Pollution Control Board,  
Pattom P.O.,  
Thiruvananthapuram,  
Kerala - 695 004  
and Ors.

...Respondents

**INDEX**

| <b>Sl.No.</b> | <b>Particulars</b>                                                                                            | <b>Pg No.</b> |
|---------------|---------------------------------------------------------------------------------------------------------------|---------------|
| 1             | Reply statement filed by the third Respondent                                                                 | 1             |
| 2             | ANNEXURE- Report filed by the Joint Committee formed as per the order dated 20.04.2022 filed in OA No.20/2016 | 6             |

**Dated at Chennai on 10th day of May, 2024**



**REMA SMRITHI VK**  
**Standing Counsel for KSPCB - R3**

**BEFORE THE HON'BLE NATIONAL GREEN TRIBUNAL,**

**SOUTHERN ZONE AT CHENNAI**

**APPEAL NO.06 of 2024 (SZ)**

**BETWEEN**

Appeal No.06/2024 (SZ)

M/s. Renu Gold Covering,

Rep. by its Proprietor, Thrissur, Kerala

...Appellant

**AND**

The Chairman,

Kerala State Pollution Control Board,

Pattom P.O., Thiruvananthapuram, Kerala – 695 004

& Others.

...Respondents

**REPLY STATEMENT FILED BY THE THIRD RESPONDENT**

I, Suchitra V., D/o P. Govindan Nair, having office at 3<sup>rd</sup> floor, Majestic Square, Paravattani, Thrissur do hereby solemnly affirm and sincerely state as follows:

1. I state that I am the Environmental Engineer of the 1st respondent Board. I state that I am well aware of the facts and circumstances of the present case and am authorized to represent the 1st respondent.
2. The allegations contained in the memorandum of grounds of appeal are denied except those that are specifically admitted hereunder.



3. It is submitted that there were 20 electroplating units working at the time of complaint on 16.07.2012 based on which an enquiry was conducted by the Kerala State Pollution Control Board on 23.07.2012 and 27.07.2012. These units, except two, did not possess the Consent to Operate of the Board and were discharging effluents outside the units.
4. During the complaint enquiry conducted by the Board, it was observed that almost all the industrial units were operating without providing pollution control measures and obtaining Consent to Operate from the Board. Analysis of well water samples collected from the complainant's well showed that the water was acidic in nature. It is further submitted that these units were discharging their effluent outside of the units without proper treatment.
5. In the light of serious complaints, the District Collector constituted a Monitoring Committee consisting of Ward Councilor, District Medical Officer, representative of complainants, Environmental Engineer, KSPCB, representative of industrial association, representative of Thrissur Corporation as members, as per the decision of the meeting convened on 26.04.2013 at the chamber of District Collector. During the inspection of the Committee on 26.04.2013, the committee noticed that only one company by the name M/s Bright & Company had adequate pollution control measures. Upon the recommendation of the Committee, subsequent to their inspections, the District Collector vide order No. C3-60051/2012 dated 27.04.2013 directed the 19 units to close down the operation until adequate pollution control measures were provided. The units were also directed to provide a treatment plant, reuse facility and to dispose off the sludge at the common hazardous waste storage and disposal facility. After several rounds of inspection by the Committee, the units which had complied with the



instructions were allowed to restart in 2014. Meanwhile, some of the units had stopped their operation. These matters were presented before the Hon'ble NGT in OA No.20/2016(SZ) by reports filed by the Kerala State Pollution Control Board dated 3.11.2016 and in the Joint Committee Report.

6. It is submitted that the proceedings of the District Collector dated 27.04.2013 clearly states that the units except for one named 'Bright and Company' have not provided adequate pollution control measures and stopping the operation of these units are inevitable for preventing the spread of pollution in the area. Based on these evidences it can be seen that the units were working without proper control measures and violating the law.
7. It is submitted that in the order of the Hon'ble NGT dated 20.02.2022, this Hon'ble Tribunal had directed to assess the period of past violations of the units at least from the date of filing of the application in OA No.20/2016. This does not exclusively imply that the period of violation should be after the filing of OA No.20/2016.
8. The appellants have alleged that the Joint committee report has not linked the violations of discharge of effluents to the units. This is incorrect as the Joint Committee Report has stated that the though the discharge of effluent by the appellant units could not be directly linked to the noncompliance with the drinking water standards in the parameters of the wells of the nearby areas and could only be a probable cause of pollution of surrounding wells. Copy of the said report is enclosed along with this report.
9. It is submitted that the site inspection conducted and observations noted are ample evidence that the units have violated the law. It is further submitted that personal hearing was granted to the appellants



to explain their case. It is submitted that compensation under Environment (Protection) Act, 1986 is levied for the violations during the assessment period and not on the environmental damages. This was made clear to the appellants in the hearing conducted by the Chairman of the Board on 17.08.2023. The violation taken into account is either the non-obtainment of Board's consent /pollution from the unit. Copy of the minutes is enclosed herewith.

10. It is submitted that the first respondent is fully empowered to recover the compensation for past violations as per polluter pays principle. Hon'ble NGT vide order dated 12/03/2019 in O.A. No. 710/2017, directed that the State Pollution Control Boards are also authorized to recover compensation from the polluters. In pursuant to the order of Hon'ble National Green Tribunal, in the matter of O.A. 593 of 2017 CPCB has developed a "Methodology for Assessing Environmental Compensation and Action Plan to Utilize the Fund". The methodology of levying environmental compensation was formulated by the CPCB based on the polluter pays principle and this is envisaged as a major tool for the regulating bodies which are the State PCBs against the violations of industrial units. Hence the environmental compensation was assessed based on the above guidelines. Since as per the notification no. S.O. 23(E) dated 08.01.1997 of the Ministry of Environment and Forests, the Central Government had delegated the powers vested in it under Section 5 of the Environment (Protection) Act, 1986 to the Chairman of State Pollution Control Board, direction under Section 5 of the Environment (Protection) Act, 1986, was issued to the units by the Chairman of the Board to remit the Environmental Compensation.

It is therefore prayed that this Hon'ble Tribunal may take on record the reply statement filed by the 1st respondent and pass appropriate orders and thus render justice.

Dated this the 6th day of May, 2024



A handwritten signature in blue ink, appearing to read "Suchitra V.", written over a horizontal line.

THIRD RESPONDENT

**SUCHITRA V.**  
Environmental Engineer

BEFORE THE HON’BLE NATIONAL GREEN TRIBUNAL SOUTHERN  
ZONE, CHENNAI CIRCUIT BENCH

Application no.20 of 2016 (SZ)

Applicant(s) :: Sri. Sri. Santo P.L., s/o P.D. Louis  
Pellissery House, Edakkunni  
&Others

Respondents :: The State of Kerala represented by  
the Chief Secretary & Others

Volume - I

INDEX

| Sl.No. | Description                                                                  | Page<br>No. |
|--------|------------------------------------------------------------------------------|-------------|
| 1      | Report filed by the joint committee formed as per the order dated 20.04.2022 | 1-26        |

Dated this the 7<sup>th</sup> day of February, 2023

**REPORT OF COMMITTEE IN THE MATTER OF  
ORIGINAL APPLICATION NO. 20 OF 2016, SRI. SANTO P.  
L. & OTHERS Vs STATE OF KERALA AND OTHERS  
SUBMITTED BEFORE THE HON'BLE NATIONAL GREEN  
TRIBUNAL SOUTHERN ZONE, CHENNAI CIRCUIT  
BENCH, AS PER THE ORDER DATED 20.04.2022**

**1.0 Preamble**

In the matter of original application No. 20 of 2016, Sri. Santo P.L. & Others Vs State of Kerala & Others the National Green Tribunal Special Bench, has passed an order dated April 20<sup>th</sup> 2022 and directed to “constitute a joint committee of senior officer of CPCB, Member Secretary, State PCB, Director Environment, State of Kerala and District Magistrate, Thrissur to ascertain the compliance status in respect of each of the units within three months and take action to close the polluting units, as per law. If the units are found compliant, the Committee may ascertain the period of past violations, at least from the date of filing of this application till compliance and for such period compensation may be assessed and recovered on polluter pays principle based on estimated cost of remediation and also taking into account the deterrent element, referable to the financial capacity of each of the units. The committee has to file the action taken status as on 30.09.2022 by 15.10.2022 report sent to the Registrar Southern Bench by e – mail”.

Pursuant to the order, Kerala State Pollution Control Board requested the respective institutes/ departments to nominate officials for the joint committee. The following officials were nominated by the respective department as members of the committee.

- Sri. Reji Joseph, Additional District Magistrate, Thrissur.
- Dr. Deepesh V, Scientist C, Central Pollution Control Board, Regional Directorate, Bengaluru.
- Sri. Baburajan P.K, Chief Environmental Engineer, Kerala State Pollution Control Board, Regional Office, Ernakulam
- Sri. Kalaiarasan P, Environmental Engineer, Directorate of Environment and Climate Change (DoECC), Govt. of Kerala., Thiruvananthapuram

  
**REJI P. JOSEPH**  
DEPUTY COLLECTOR (GENERAL)  
THRASSUR

  
**DR. DEEPESH V.**  
SCIENTIST C  
CENTRAL POLLUTION CONTROL BOARD  
REGIONAL DIRECTORATE  
MIN. OF ENV. FORESTS & CL. GOVT. OF INDIA  
BENGALURU - 560 078. PH: 080 - 2323 3730

  
**BABURAJAN P.K.**  
Chief Environmental Engineer

  
**KALAIARASAN P.**  
Environmental Engineer  
Directorate of Environment  
and Climate Change  
Thiruvananthapuram-695 024



## 2.0 Background of OA 20/2016

A complaint from the Edakkunni Poura Samithi dated 16.07.2012, was received at the District Office, Thrissur of the Board, regarding water pollution of the wells in and around the industrial estate at Ollur. In the enquiry conducted by the State Pollution Control Board officials on 23.07.2012 and 27.07.2012, it was found that almost all the electroplating units were working without having adequate pollution control measures and not obtained Consent to Operate from the Board. There were 20 units operating in the estate at that time. Analysis of well water samples collected from the complainant's wells showed that the water was acidic in nature. In the light of serious complaints, the District Collector constituted a monitoring committee consisting of ward councilor, District Medical Officer, representative of complainants, Environmental Engineer, KSPCB, representative of industrial association, representative of Thrissur corporation as members, as per the decision of the meeting convened on 26.04.2013 at the chamber of District Collector. During the inspection of the committee on 26.04.2013, the committee noticed that only one company by the name M/s Bright & Company had adequate pollution control measures. Upon the recommendation of the committee, subsequent to their inspections, the District Collector directed vide order No. C3-60051/2012 dated 27.04.2013 to close down the operation of 19 units until adequate pollution control measures were provided. Copy of the same is attached herewith as **Annexure 1**. The units were directed to provide a treatment plant, reuse facility and to dispose of the sludge at the common hazardous waste storage and disposal facility at Ambalamedu. Further District Collector had issued certain directions to the units vide proceedings dated 30.07.2013 with regard to prevention of the water pollution. Copy of the same is attached herewith as **Annexure 2**. Later upon several inspections of the committee the units which have complied with the instructions were allowed to restart by the orders No. C3-60051/2012 dated 5.06.2014 and 4.08.2014 of the District Collector. Copies of the orders are attached herewith as **Annexure 3 and Annexure 4**. Meanwhile some of the units stopped their operation and as on 16.06.2022 only 13 of the electroplating units are working in the industrial estate.

  
**REGI P. JOSEPH**  
DEPUTY COLLECTOR (GENERAL)  
THRISUR

  
**Dr. DEEPESH V.**  
SCIENTIST 'C'  
CENTRAL POLLUTION CONTROL BOARD  
REGIONAL DIRECTORATE  
MIN. OF ENV. FORESTS & CL. GOVT. OF INDIA  
BENGALURU - 560 078. PH: 085 - 2323 3730

  
**BABURAJAN P.K.**  
Chief Environmental Engineer

  
**KADALARASAN P.**  
Environmental Engineer  
Directorate of Environment  
and Climate Change  
Thiruvananthapuram-695 024

**List of 19 industries which were directed to close down by the order No. C3-60051/2012 dated 27.04.2013 of the District Collector**

|    |                                                          |
|----|----------------------------------------------------------|
| 1  | M/s Bee Pee Gold Imitations                              |
| 2  | M/s Indu Ornaments                                       |
| 3  | M/s Mini Job Works                                       |
| 4  | M/s Renu Gold Covering                                   |
| 5  | M/s DOT Engineering                                      |
| 6  | M/s Rajeshkumar Electroplating                           |
| 7  | M/s Golden View Plating                                  |
| 8  | M/s Two Star Designs Gold Covering                       |
| 9  | M/s Pee Gee Gold Covering                                |
| 10 | M/s Honest Electrocolouring                              |
| 11 | M/s Three Star Electroplating                            |
| 12 | M/s Bright Precured System No. 1                         |
| 13 | M/s Bright Precured System No.2                          |
| 14 | M/s United Aluminium Company                             |
| 15 | M/s St. Joseph Colour Coats                              |
| 16 | M/s Pradeeksha Aluminium Polishing ElectroColouring Unit |
| 17 | M/s Dash Machineries                                     |
| 18 | M/s Anna Plastics Electroplating Works                   |
| 19 | M/s St. Joseph Engineering and Gold Works                |

**List of 13 respondent industries functioning in the industrial estate as on 16.06.2022**

|   |                             |
|---|-----------------------------|
| 1 | M/s Bee Pee Gold Imitations |
| 2 | M/s Indu Ornaments          |

  
REGI P. JOSEPH  
DISTRICT COLLECTOR (GENERAL)  
THIRUVARUR

  
Dr. DEEPESH V.  
SCIENTIST 'C'  
CENTRAL POLLUTION CONTROL BOARD  
REGIONAL DIRECTORATE  
MIN. OF ENV. FORESTS & CL. GOVT. OF INDIA  
BENGALURU - 560 078. PH: 085 - 2323 3730

  
BABURAJAN P.K.  
Chief Environmental Engineer

  
KADALARASAN P.  
Environmental Engineer  
Directorate of Environment  
and Climate Change  
Thiruvananthapuram-695 024

|    |                                                             |
|----|-------------------------------------------------------------|
| 3  | M/s Mini Job Works - name changed to Aiswarya Gold Covering |
| 4  | M/s Renu Gold Covering                                      |
| 5  | M/s DOT Engineering                                         |
| 6  | M/s Rajeshkumar Electroplating                              |
| 7  | M/s Golden View Plating                                     |
| 8  | M/s Two Star Designs Gold Covering                          |
| 9  | M/s Pee Gee Gold Covering                                   |
| 10 | M/s Honest Electrocolouring                                 |
| 11 | M/s Three Star Electroplating                               |
| 12 | M/s Bright Precured System 2                                |
| 13 | M/s Bright & Company                                        |

From the verification of files of the District Office of the Board at Thrissur, it was observed that in the analysis of well water samples conducted by the State Pollution Control Board on 22.02.2016 and 15.11.2018 the pH of the well water was in the acidic range and heavy metals were observed in some wells. These were also submitted to the Hon'ble NGT vide reports from the District Office of the Board at Thrissur, dated 03.11.2016, 8.02.2020 and 11.12.2020. Copies of the reports are submitted herewith as **Annexure 5**, **Annexure 6** and **Annexure 7** respectively. The State Board had co-opted the Ground Water Department to conduct hydrogeological study in and around the Ollur Industrial Estate and to probe the reason for groundwater contamination in the area. Copy of the report is submitted as **Annexure 8**. The report concludes as follows: *"The samples collected from the wells of the industrial estate close to the electroplating units are showing higher pH value i.e. of lesser acidic nature. Whereas the samples collected from the open wells outside the industrial area and close to the boundary of the estate are showing higher acidic nature. Hence sampling during peak summer season and also the study of heavy metal concentration in the ground water source will provide much more refined information on the ground water in order to arrive at a realistic conclusion on the pollution caused by the electroplating related industries in the estate and also to establish base flow direction from industrial area, a*

  
REGI P. JOSEPH  
DEPUTY COLLECTOR (GENERAL)  
THRASSUR

  
Dr. DEEPESH V.  
SCIENTIST 'C'  
CENTRAL POLLUTION CONTROL BOARD  
REGIONAL DIRECTORATE  
MIN. OF ENV. FORESTES & CL. GOVT. OF INDIA  
BENGALURU - 560 078. PH: 085 - 2323 3730

  
BABURAJAN P.K.  
Chief Environmental Engineer

  
KADALARASAN P.  
Environmental Engineer  
Directorate of Environment  
and Climate Change  
Thiruvananthapuram-695 024



*detailed study using tracer techniques or similar advanced methods have to be engaged through competent agencies".* Accordingly, the State Board has engaged Center for Water Resources Development and Management (CWRDM) vide order No. PCB/HO/SEE-1/TSR-TSGWC/09/2021 dated 22.12.2021, to conduct study using tracer techniques. The investigation aims at studying the quality of ground water in and around the Ollur industrial estate, groundwater flow characteristics prevailing in the area and to identify the cause of groundwater contamination in the area. The methodology of study includes adding stable isotopes tracers to the newly constructed boreholes for the study and water samples will be collected from the boreholes along with existing wells for analysis. Periodic monitoring of the wells will be done to identify the hydrological connectivity between industrial areas and surrounding wells. Stable isotopes in the water samples will be analyzed using the IRMS facility available at CWRDM. The study is envisaged to end by August 2023 and it is considered that the cause for the low pH in the open wells surrounding the industrial estate could be identified. The State Pollution Control Board has signed a MoU with CWRDM and they have initiated the study.

### **2.1 Compliance of Hon'ble NGT Order**

Pursuant to the Order of the Hon'ble NGT dated 20.04.2022, the first meeting of the committee was held on 7.06.2022 and had a preliminary discussion about the matter and charted out a plan for inspecting the units in question. The 13 units presently engaged in the electroplating activities are the respondent units in the original application. In the initial phase, it was decided to inspect the units on 16<sup>th</sup> and 17<sup>th</sup> of June 2022. Discussion on the large number of such unauthorized electroplating units working in the district and general acidic nature of the ground water of Thrissur district were also discussed in the initial meeting. In the meeting it was also decided to analyze the water sample from the well which are alleged to be contaminated. Minute of the meeting is attached as **Annexure 9**.

### **3.0 Field visit and Observations**

The field visit was conducted on 16<sup>th</sup> and 17<sup>th</sup> of June 2022 and the observations are described as follows. The thirteen respondent units are located in the industrial estate of SIDCO at Ollur. The electroplating activities carried out at these thirteen respondent units


  
REGI P. JOSEPH  
DEPUTY COLLECTOR (GENERAL)  
THRISUR

  
Dr. DEEPESH V.  
SCIENTIST C  
CENTRAL POLLUTION CONTROL BOARD  
REGIONAL DIRECTORATE  
MIN. OF ENV. FORESTS & CL. GOVT. OF INDIA  
BENGALURU - 560 078. PH: 085 - 2323 3730

  
BABURAJAN P.K.  
Chief Environmental Engineer

  
K. A. ARASAN P.  
Environmental Engineer  
Directorate of Environment  
and Climate Change  
Thiruvananthapuram-695 024

are either electrocolouring of aluminum profiles or electroplating on metallic ornaments. In the case of aluminum electro colouring, the surface of the aluminum profiles is made smooth through the buffing process and then subjected to anodizing and then to chromium/ nickel/ copper electroplating depending on the colour required. In the case of electroplating of metallic ornaments, the surface is coated with copper and then with gold colouring agents.

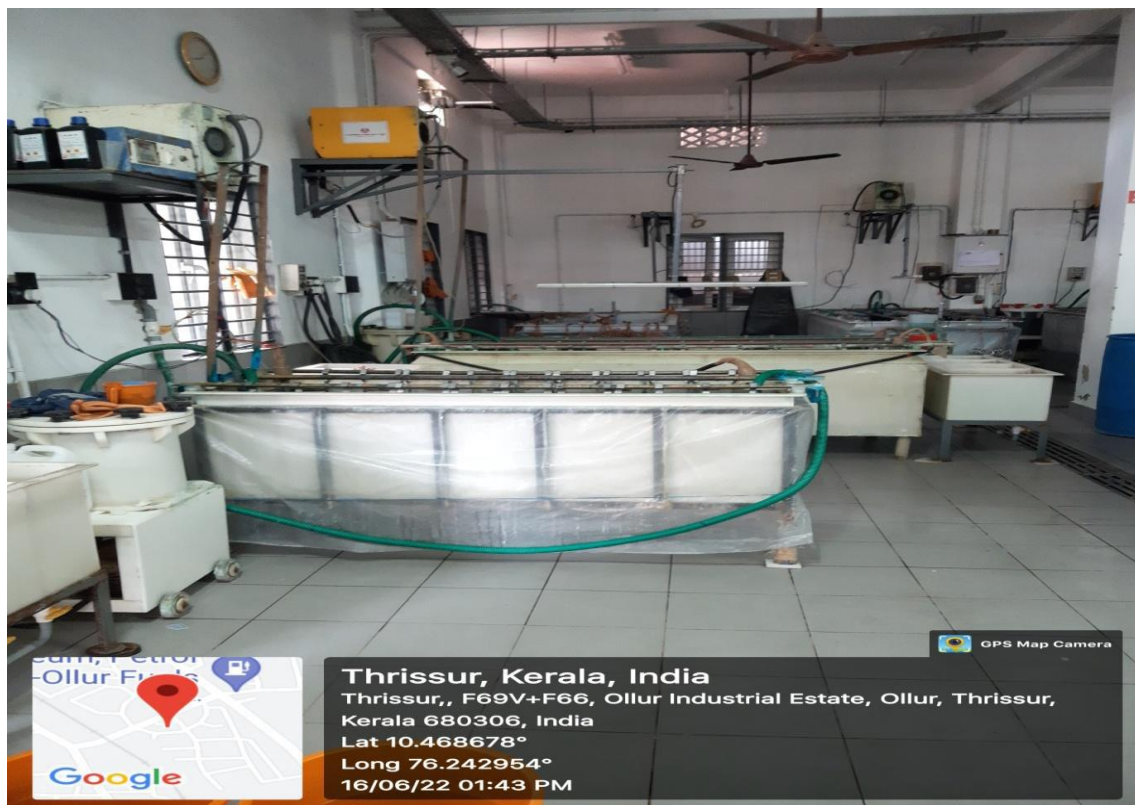

**Figure 1 - Electroplating bath at M/s Golden View Plating**

After each electroplating process, the aluminum profiles/ ornaments are dipped in the water. This water is the major source of effluent and wastewater from floor washings also form a part of the effluent. Also the occasional cleaning of electroplating baths contributes to the effluent. Hence the quantity of effluent at the end of a working day will be very less and most of the effluent treatment plants (ETP) are of batch process. Of the thirteen industries, ten are engaged in the electroplating of metallic ornaments, two in electro colouring of aluminium profiles and one is a zinc electroplating unit. Typically, these industries are small scale units functioning in two or three rooms and do not have much vacant land area. All of them have valid consent of the State Board. The ETP provided are similar in these units and consist of collection tank, settling tank, filter feed tank, pressure sand filter, activated carbon

**REGI P. JOSEPH**  
REGIONAL COLLECTOR (GENERAL)  
THRASSUR

**Dr. DEEPESH V.**  
SCIENTIST 'C'  
CENTRAL POLLUTION CONTROL BOARD  
REGIONAL DIRECTORATE  
MIN. OF ENV. FORESTS & CL. GOVT. OF INDIA  
BENGALURU - 560 078. PH: 080 - 2323 3730

**BAEURAJAN P.K.**  
Chief Environmental Engineer

**KADALARASAN.P**  
Environmental Engineer  
Directorate of Environment  
and Climate Change  
Thiruvananthapuram-695 024

oleum, ol  
p -Ollur uels

Google

**Thrissur, Kerala, India**  
 Thrissur., F69R+XXC, Ollur Industrial Estate, Ollur, Thrissur,  
 Kerala 680306, India  
 Lat 10.469913°  
 Long 76.242346°  
 17/06/22 10:10 AM

GPS Map Camera



**REGI P. JOSEPH**  
**DEPUTY COLLECTOR (GENERAL)**  
**THIRISSUR**

  
**Dr. DEEPESH V.**  
SCIENTIST 'C'  
CENTRAL POLLUTION CONTROL BOARD  
REGIONAL DIRECTORATE  
MIN. OF ENV. FORESTS & CC. GOVT. OF INDIA  
BENGALURU - 560 079. Ph: 085- 2323 3730

  
**BABURAJAN P.K.**  
Chief Environmental Engineer

  
**KALAIARASAN.P**  
Environmental Engineer  
Directorate of Environment  
and Climate Change  
Thiruvananthapuram-695 024





**Figure 3 - Drains for conveying spillages to the effluent treatment plant**

The settling tank consists of a conical shaped tank where in the sludge is drawn from the bottom and overflow goes to the filter feed tank. Below the settling tank is a sludge drying bed which consists of graded coarse and fine aggregate, and the sludge from the settling tank is allowed to dry here. The dried sludge is then transported to the common hazardous waste storage and disposal facility at Ambalamedu, Ernakulam. In all the units it is claimed that the treated water is reused.

During inspection it was observed that ETP provided in the units were in operational condition (batch mode) except in the unit named Bright Precured Systems II, which is an electro colouring unit. The wastewater from the unit was discharged into the premises of the unit. The compliance of other units with regard to reuse provisions, sludge storage and manifest submission and other statutory records are being duly submitted.

**REGI P. JOSEPH**  
 DEPUTY COLLECTOR (GENERAL)  
 THRASSUR

**Dr. DEEPESH V.**  
 SCIENTIST C  
 CENTRAL POLLUTION CONTROL BOARD  
 REGIONAL DIRECTORATE  
 MIN. OF ENV. FORESTS & CL. GOVT. OF INDIA  
 BENGALURU - 560 078. PH: 080 - 2323 3730

**BAEURAJAN P.K.**  
 Chief Environmental Engineer

**KADALARASAN.P**  
 Environmental Engineer  
 Directorate of Environment  
 and Climate Change  
 Thiruvananthapuram-695 024



**Figure 4 - Collection tank and chemical addition installations in ETP**



**Figure 5 - Hopper bottom settling tank and sludge drying bed**

**REGI P. JOSEPH**  
DEPUTY COLLECTOR (GENERAL)  
THRASSUR

**Dr. DEEPESH V.**  
SCIENTIST 'C'  
CENTRAL POLLUTION CONTROL BOARD  
REGIONAL DIRECTORATE  
MIN. OF ENV. FORESTS & CL. GOVT. OF INDIA  
BANGALURU - 560 078. PH: 080 - 2323 3730

**BAEURA J. P. K.**  
Chief Environmental Engineer

**KADALARASAN P.**  
Environmental Engineer  
Directorate of Environment  
and Climate Change  
Thiruvananthapuram-695 024



### 3.1 Results of treated effluent collected from the unit

The treated effluents were collected from the units except Honest electro colouring, Dot Engineers, Bright Precured Systems II and analyzed for the parameters as per the Consent to Operate issued to the units. The treated effluent was not available at Honest Electro Colouring and DOT Engineers, as revamping of ETP and civil structures were going on in Honest Electro Colouring and treated effluent was not available at DOT Engineers. Also in the premise of M/s Bright Precured an open well was seen adjacent to the discharge of effluent from the unit and a sample was also collected to verify its quality. The results of analysis of treated effluent of each unit and the standards prescribed by the State Pollution Control Board are furnished in Table 1.



**Figure 6 - Wastewater conveyed to the outside premises at Bright Precured Systems 2**

  
**REGI P. JOSEPH**  
DEPUTY COLLECTOR (GENERAL)  
THRASSUR

  
**DR. DEEPESH V.**  
SCIENTIST 'C'  
CENTRAL POLLUTION CONTROL BOARD  
REGIONAL DIRECTORATE  
MIN. OF ENV. FORESTS & CL. GOVT. OF INDIA  
BENGALURU - 560 078. PH: 080 - 2323 3730

  
**BABURAJAN P.K.**  
Chief Environmental Engineer

  
**KADALARASAN P.**  
Environmental Engineer  
Directorate of Environment  
and Climate Change  
Thiruvananthapuram-695 024





**Figure 7 - Defunct effluent treatment plant at Bright Precured Systems 2**

### **3.2 Assessment of well water quality**

As decided the water samples from the open wells alleged to have been contaminated were collected. There were 18 wells and this includes a well in the premises of the industrial estate also. It was observed that most of the wells are being used for domestic purposes except two open wells in the premises of Sri. R. K. Nair and Sri, Tony Thottan. During the inspection it was observed that there is a service center of earth movers functioning adjacent to the plot owned by Sri Tony Thottan. The samples of well water were analyzed for pH, heavy metals and cyanide and the results were compared with the drinking water standards IS 10500:2012. The results and the limit are furnished in Table 2.

The location coordinates of the open well and industries inspected are furnished in Table 3.

### **4.0 Compliance status of the respondent units**

The compliance status of the units with the consent conditions are furnished in Table 4.

  
**R. P. JOSEPH**  
DEPUTY COLLECTOR (GENERAL)  
THRASSUR

  
**Dr. DEEPESH V.**  
SCIENTIST 'C'  
CENTRAL POLLUTION CONTROL BOARD  
REGIONAL DIRECTORATE  
MIN. OF ENV. FORESTS & CL. GOVT. OF INDIA  
BENGALURU - 560 078. PH: 080 - 2323 3730

  
**BABURAJAN P.K.**  
Chief Environmental Engineer

  
**KADALARASAN P.**  
Environmental Engineer  
Directorate of Environment  
and Climate Change  
Thiruvananthapuram-695 024

**Table 1: Results of treated effluent collected from the industries.**

| Parameters (mg/L)* | 1# | 2# | 3    | 4    | 5    | 6    | 7    | 8    | 9     | 10   | 11   | 12   | Prescribed limits (mg/L)* |
|--------------------|----|----|------|------|------|------|------|------|-------|------|------|------|---------------------------|
| Copper             |    |    | BDL  | 0.85 | 41.1 | 0.39 | 1.07 | 0.43 | 4.42  | 2.29 | 0.41 | BDL  | 3                         |
| Cadmium            |    |    | BDL  | BDL  | BDL  | BDL  | BDL  | BDL  | BDL   | BDL  | BDL  | BDL  | 2                         |
| Total Chromium     |    |    | BDL  | BDL  | BDL  | BDL  | BDL  | BDL  | BDL   | BDL  | BDL  | 0.14 | 2                         |
| Iron               |    |    | BDL  | BDL  | 2.12 | 1.54 | 0.14 | 0.21 | 0.69  | BDL  | 0.93 | 6.83 | 3                         |
| Manganese          |    |    | BDL  | BDL  | 0.12 | BDL  | 0.99 | 0.31 | BDL   | BDL  | BDL  | BDL  | -                         |
| Nickel             |    |    | BDL  | BDL  | 5.63 | BDL  | BDL  | 1    | 0.52  | BDL  | 0.29 | 0.17 | 3                         |
| Lead               |    |    | BDL  | BDL  | 0.19 | BDL  | BDL  | BDL  | BDL   | BDL  | BDL  | BDL  | 0.1                       |
| Zinc               |    |    | BDL  | BDL  | 6.81 | BDL  | BDL  | 0.22 | 0.19  | 0.21 | 0.17 | 2.01 | 5                         |
| Cobalt             |    |    | BDL  | BDL  | BDL  | BDL  | BDL  | BDL  | BDL   | BDL  | BDL  | BDL  | -                         |
| Cyanide            |    |    | 0.1  | 0.2  | 1    | 0.1  | BDL  | 0.1  | BDL   | BDL  | 0.1  | 0.2  | 0.2                       |
| pH                 |    |    | 7.66 | 8.57 | 2.99 | 7.58 | 7.69 | 8.33 | 10.16 | 8.6  | 6.22 | 6.95 | 6.5-9.0                   |

**1: M/s. Honest Electro Colouring, 2: M/s. Dot Engineers, 3: M/s. Pee Gee Gold Covering, 4: M/s. Indu Ornaments, 5: M/s. Aiswarya Gold Covering, 6: M/s. Bee Pee Gold Imitation, 7: M/s. Rajeshkumar Electroplating, 8: M/s. Golden View Plating, 9: M/s. Two Star Designs Gold Covering, 10 M/s. Renu Gold Covering, 11: M/s. Bright & Company & 12: M/s. Three Star Electroplating**

**\* Except for pH # Treated sample not collected/ available**

  
REGI P. JOSEPH  
REPLY COLLECTOR (GENERAL)  
THIRUVARUR

  
Dr. DEEPESH V.  
SCIENTIST 'C'  
CENTRAL POLLUTION CONTROL BOARD  
REGIONAL DIRECTORATE  
MIN. OF ENV. FORESTS & CL. GOVT. OF INDIA  
BENGALURU - 560 079. PH: 680 - 2323 3739

  
BABURAJAN P.K.  
Chief Environmental Engineer

  
K. A. ARASAN P.  
Environmental Engineer  
Directorate of Environment  
and Climate Change  
Thiruvananthapuram-695 024

**Table 2: Results of well water samples collected from open wells in the vicinity of industrial estate.**

| Parameters (mg/L)*                                                                                                                                                                                                                                                                                                                                                          | 1    | 2    | 3    | 4    | 5    | 6    | 7    | 8    | 9    | 10   | 11   | 12   | 13   | 14   | 15   | 16   | 17   | 18   | Limit (mg/L)* |
|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|------|------|------|------|------|------|------|------|------|------|------|------|------|------|------|------|------|------|---------------|
| <b>Copper</b>                                                                                                                                                                                                                                                                                                                                                               | BDL  | BDL  | BDL  | BDL  | BDL  | BDL  | BDL  | BDL  | BDL  | BDL  | BDL  | BDL  | BDL  | 1.03 | BDL  | BDL  | BDL  | BDL  | 0.05          |
| <b>Cadmium</b>                                                                                                                                                                                                                                                                                                                                                              | BDL  | BDL  | BDL  | BDL  | BDL  | BDL  | BDL  | BDL  | BDL  | BDL  | BDL  | BDL  | BDL  | BDL  | BDL  | BDL  | BDL  | BDL  | 0.003         |
| <b>T. Chromium</b>                                                                                                                                                                                                                                                                                                                                                          | BDL  | BDL  | BDL  | BDL  | BDL  | BDL  | BDL  | BDL  | BDL  | BDL  | BDL  | BDL  | BDL  | BDL  | BDL  | BDL  | BDL  | BDL  | 0.05          |
| <b>Iron</b>                                                                                                                                                                                                                                                                                                                                                                 | BDL  | BDL  | BDL  | 0.88 | BDL  | BDL  | BDL  | BDL  | BDL  | BDL  | BDL  | 0.19 | BDL  | BDL  | BDL  | BDL  | BDL  | BDL  | 0.3           |
| <b>Manganese</b>                                                                                                                                                                                                                                                                                                                                                            | BDL  | 0.31 | BDL  | BDL  | BDL  | BDL  | 0.17 | BDL  | BDL  | BDL  | 0.11 | BDL  | BDL  | 0.79 | 1.31 | BDL  | BDL  | 0.11 | 0.1           |
| <b>Nickel</b>                                                                                                                                                                                                                                                                                                                                                               | BDL  | BDL  | BDL  | BDL  | BDL  | BDL  | BDL  | BDL  | BDL  | BDL  | BDL  | BDL  | BDL  | 0.52 | 0.11 | BDL  | BDL  | BDL  | 0.02          |
| <b>Lead</b>                                                                                                                                                                                                                                                                                                                                                                 | BDL  | BDL  | BDL  | BDL  | BDL  | BDL  | BDL  | BDL  | BDL  | BDL  | BDL  | BDL  | BDL  | BDL  | BDL  | BDL  | BDL  | BDL  | 0.01          |
| <b>Zinc</b>                                                                                                                                                                                                                                                                                                                                                                 | BDL  | 0.32 | BDL  | BDL  | BDL  | BDL  | BDL  | BDL  | BDL  | 0.12 | BDL  | BDL  | BDL  | 0.82 | 8.48 | 0.21 | BDL  | BDL  | 5.0           |
| <b>Cobalt</b>                                                                                                                                                                                                                                                                                                                                                               | BDL  | BDL  | BDL  | BDL  | BDL  | BDL  | BDL  | BDL  | BDL  | BDL  | BDL  | BDL  | BDL  | BDL  | BDL  | BDL  | BDL  | BDL  | -             |
| <b>Cyanide</b>                                                                                                                                                                                                                                                                                                                                                              | BDL  | BDL  | BDL  | BDL  | BDL  | BDL  | BDL  | BDL  | BDL  | BDL  | BDL  | BDL  | BDL  | BDL  | BDL  | BDL  | BDL  | BDL  | 0.05          |
| <b>pH</b>                                                                                                                                                                                                                                                                                                                                                                   | 5.06 | 4.4  | 4.91 | 4.92 | 4.92 | 4.56 | 4.60 | 4.60 | 4.78 | 4.87 | 4.67 | 5.69 | 4.84 | 3.56 | 4.14 | 4.72 | 5.03 | 4.57 | 6.5-8.5       |
| 1: Industrial estate, 2: R K Nair, 3: Sankara Narayanan, 4: Bharathi, 5: V Unnikrishnan, 6: Kanchana V, 7: Joy Perincheri, 8: Indira Balakrishnan, 9: Laksham Veedu Colony, 10 Vincent Moyalan, 11: Sunil Pottayil, 12: Dr. R Kumar, 13: Joyco Transport, 14: Tony Thottan, 15: A A Paulose, 16: George Ematty, 17: Santo P & 18: Unnikrishnan Edakkuny.<br>* Except for pH |      |      |      |      |      |      |      |      |      |      |      |      |      |      |      |      |      |      |               |

  
**REGI P. JOSEPH**  
 DEPUTY COLLECTOR (GENERAL)  
 THIRUVOOTUR

  
**Dr. DEEPESH V.**  
 SCIENTIST 'C'  
 CENTRAL POLLUTION CONTROL BOARD  
 REGIONAL DIRECTORATE  
 MIN. OF ENV. FORESTS & CL. GOVT. OF INDIA  
 BENGALURU - 560 079, 776 080 - 2323 3739

  
**BABURAJAN P.K.**  
 Chief Environmental Engineer

  
**K. A. ARASAN, P.**  
 Environmental Engineer  
 Directorate of Environment  
 and Climate Change  
 Thiruvananthapuram-695 024



**Table 3: Location of open wells and industries**

| <b>S.No.</b> | <b>LATITUDE</b> | <b>LONGITUDE</b> | <b>LOCATION NAME</b>            |
|--------------|-----------------|------------------|---------------------------------|
| 1            | 10.4686987      | 76.244058        | Open Well-Industrial Estate     |
| 2            | 10.4667453      | 76.2462387       | Open Well -R.K.Nair             |
| 3            | 10.4671469      | 76.2470061       | Open Well -Sankara Narayanan    |
| 4            | 10.4663562      | 76.2475151       | Open Well -Bharathi             |
| 5            | 10.4646371      | 76.2485384       | Open Well -V Unnikrishnan       |
| 6            | 10.4634131      | 76.2491439       | Open Well -Kanchana V           |
| 7            | 10.4657458      | 76.2464227       | Open Well -Joy P                |
| 8            | 10.4665983      | 76.2458941       | Open Well -Indira B             |
| 9            | 10.4665911      | 76.2459204       | Open Well -Laksham Veedu Colony |
| 10           | 10.4656021      | 76.2422751       | Open Well -Vincent M            |
| 11           | 10.4685474      | 76.2411315       | Open Well -P V Sunil            |
| 12           | 10.4753427      | 76.2424418       | Open Well -Dr R Kumar           |
| 13           | 10.4701331      | 76.2437391       | Open Well -Joyco                |
| 14           | 10.4699064      | 76.2444876       | Open Well -Tony T               |
| 15           | 10.4710959      | 76.2420532       | Open Well -Paulose A            |
| 16           | 10.4708512      | 76.2422881       | Open Well -George E             |
| 17           | 10.4702883      | 76.2431301       | Open Well -Santo P              |
| 18           | 10.4675729      | 76.2464934       | Open Well -Unnikrishnan E       |
| 19           | 10.4689728      | 76.2435614       | M/s. Honest Electro Colouring   |
| 20           | 10.468728       | 76.2440963       | M/s. Dot Engineers              |
| 21           | 10.4704221      | 76.243409        | M/s. Pee Gee Gold Covering      |

  
**REGI P. JOSEPH**  
 DEPUTY COLLECTOR (GENERAL)  
 THIRUVARUR

  
**Dr. DEEPESH V.**  
 DISTRICT 'C'  
 CENTRAL POLLUTION CONTROL BOARD  
 REGIONAL DIRECTORATE  
 MIN. OF ENV. FORESTS & CL. GOVT. OF INDIA  
 BENGALURU - 560 079. PH: 080 - 2323 3739

  
**BABURAJAN P.K.**  
 Chief Environmental Engineer

  
**K. BALARAMAN, P.**  
 Environmental Engineer  
 Directorate of Environment  
 and Climate Change  
 Thiruvananthapuram-695 024

|    |            |            |                                      |
|----|------------|------------|--------------------------------------|
| 22 | 10.4673222 | 76.2443021 | M/s. Indu ornaments                  |
| 23 | 10.467151  | 76.2448646 | M/s. Aiswarya Gold Covering          |
| 24 | 10.4675741 | 76.2447897 | M/s. Bee Pee Gold Imitation          |
| 25 | 10.467582  | 76.244804  | M/s. Rajesh Kumar Electroplating     |
| 26 | 10.4686224 | 76.2430767 | M/s. Golden View Plating             |
| 27 | 10.4670725 | 76.2435656 | M/s. Two Star Industry               |
| 28 | 10.4698453 | 76.2420932 | M/s. Renu Gold Covering              |
| 29 | 10.4697215 | 76.2421667 | M/s. Bright & Company                |
| 30 | 10.469384  | 76.241637  | M/s. Three Star Electroplating Works |
| 31 | 10.4695052 | 76.241236  | M/s Bright Precured Systems II       |

  
**REGI P. JOSEPH**  
 DEPUTY COLLECTOR (GENERAL)  
 THIRUVARUR

  
**Dr. DEEPESH V.**  
 SCIENTIST 'C'  
 CENTRAL POLLUTION CONTROL BOARD  
 REGIONAL DIRECTORATE  
 MIN. OF ENV. FORESTS & CL. GOVT. OF INDIA  
 BENGALURU - 560 079. Ph: 080 - 2323 3739

  
**BABURAJAN P.K.**  
 Chief Environmental Engineer

  
**K. A. ARASAN, P.**  
 Environmental Engineer  
 Directorate of Environment  
 and Climate Change  
 Thiruvananthapuram-695 024

**Table 4: Compliance status of respondent industries**

| <b>Name of the unit</b>       | <b>Activity</b>     | <b>Consent validity</b>         | <b>Compliance with treated effluent standards</b>        | <b>Compliance with other consent conditions</b>                                   | <b>Remarks</b>                                                                                                                                                       |
|-------------------------------|---------------------|---------------------------------|----------------------------------------------------------|-----------------------------------------------------------------------------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| M/s. Honest Electro Colouring | Electro Colouring   | Valid consent up to 30.06.2023  | Treated effluent not available due to ETP revamping.     | Reuse provisions provided, sludge storage adequate and monthly reports submitted. | Revamping of ETP and civil modifications observed during the visit. General housekeeping was not good with several pilferages and spillage in the work area.         |
| M/s. Dot Engineers            | Gold electroplating | Valid consent up to 30.06.2023  | Treated effluent not available.                          | Reuse provisions provided, sludge storage adequate and monthly reports submitted. | ETP claimed to be operational and general housekeeping was satisfactory.                                                                                             |
| M/s. Pee Gee Gold Covering    | Gold electroplating | Valid consent up to 31.12.2023. | Complies with prescribed limits.                         | Reuse provisions provided, sludge storage adequate and monthly reports submitted. | ETP claimed to be operational and general housekeeping was satisfactory.                                                                                             |
| M/s. Indu ornaments           | Gold electroplating | Valid consent up to 30.06.2023  | Complies with prescribed limits                          | Reuse provisions provided, sludge storage adequate and monthly reports submitted. | ETP claimed to be operational and general housekeeping was satisfactory.                                                                                             |
| M/s. Aiswarya Gold Covering   | Gold electroplating | Valid consent up to 30.06.2023  | Non- compliance with respect to copper, nickel and zinc. | Reuse provisions provided, sludge storage adequate and monthly reports submitted. | ETP claimed to be operational, spillage/ pilferage of process liquid on the floors observed, makeshift drainage facility to ETP collection tank needs to be changed. |

  
REGI P. JOSEPH  
REPUTY COLLECTOR (GENERAL)  
THIRUVARUR

  
Dr. DEEPESH V.  
SCIENTIST 'C'  
CENTRAL POLLUTION CONTROL BOARD  
REGIONAL DIRECTORATE  
MIN. OF ENV. FORESTS & CL. GOVT. OF INDIA  
BENGALURU - 560 079. PH: 680 - 2323 3739

  
BABURAJAN P.K.  
Chief Environmental Engineer

  
K. ALARASAN, P.  
Environmental Engineer  
Directorate of Environment  
and Climate Change  
Thiruvananthapuram-695 024



| <b>Name of the unit</b>             | <b>Activity</b>     | <b>Consent validity</b>        | <b>Compliance with treated effluent standards</b> | <b>Compliance with other consent conditions</b>                                   | <b>Remarks</b>                                                                                                   |
|-------------------------------------|---------------------|--------------------------------|---------------------------------------------------|-----------------------------------------------------------------------------------|------------------------------------------------------------------------------------------------------------------|
| M/s. Bee Pee Gold Imitation         | Gold electroplating | Valid consent up to 30.06.2023 | Complies with prescribed limits.                  | Reuse provisions provided, sludge storage adequate & monthly reports submitted.   | ETP was operational and general housekeeping was satisfactory                                                    |
| M/s. Rajesh Kumar Electroplating    | Gold electroplating | Valid consent up to 30.06.2023 | Complies with prescribed limits.                  | Reuse provisions provided, sludge storage adequate and monthly reports submitted. | ETP was operational and general housekeeping was satisfactory                                                    |
| M/s. Golden View Plating            | Gold electroplating | Valid consent up to 31.12.2024 | Complies with prescribed limits.                  | Reuse provisions provided, sludge storage adequate and monthly reports submitted. | ETP claimed to be operational and revamping works were observed during the visit. General housekeeping was good. |
| M/s. Two Star Designs Gold Covering | Gold electroplating | Valid consent up to 30.06.2023 | Non- compliance with respect to copper, and pH.   | Reuse provisions provided, sludge storage adequate and monthly reports submitted. | ETP claimed to be operational and general housekeeping was satisfactory                                          |
| M/s. Renu Gold Covering             | Gold electroplating | Valid consent up to 30.06.2023 | Complies with prescribed limits                   | Reuse provisions provided, sludge storage adequate and monthly reports submitted. | ETP was operational and general housekeeping was satisfactory                                                    |

  
**REGI P. JOSEPH**  
 DEPUTY COLLECTOR (GENERAL)  
 THIRUVARUR

  
**Dr. DEEPESH V.**  
 SCIENTIST 'C'  
 CENTRAL POLLUTION CONTROL BOARD  
 REGIONAL DIRECTORATE  
 MIN. OF ENV. FORESTS & CL. GOVT. OF INDIA  
 BENGALURU - 560 079. PH: 080 - 2323 3739

  
**BABURAJAN P.K.**  
 Chief Environmental Engineer

  
**K. ALAIARASAN, P.**  
 Environmental Engineer  
 Directorate of Environment  
 and Climate Change  
 Thiruvananthapuram-695 024

| <b>Name of the unit</b>              | <b>Activity</b>     | <b>Consent validity</b>        | <b>Compliance with treated effluent standards</b> | <b>Compliance with other consent conditions</b>                                   | <b>Remarks</b>                                                                                                                                                                     |
|--------------------------------------|---------------------|--------------------------------|---------------------------------------------------|-----------------------------------------------------------------------------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| M/s. Bright & Company                | Electro Colouring   | Valid consent up to 30.06.2023 | Complies with prescribed limits.                  | Reuse provisions provided, sludge storage adequate and monthly reports submitted. | ETP was operational and general housekeeping was satisfactory                                                                                                                      |
| M/s. Three Star Electroplating Works | Zinc electroplating | Valid consent up to 30.06.2023 | Non- compliance with respect to iron.             | Reuse provisions provided, sludge storage adequate and monthly reports submitted. | ETP was operational and spillage/ pilferage observed in ETP floor. No permanent acid proof floor layering for ETP Housekeeping in the ETP area was not satisfactory..              |
| Bright Precured System 2             | Electro Colouring   | Valid consent up to 31.12.2023 | Unauthorized discharge/ defunct ETP.              | Reuse of treated effluent not provided and no sludge storage facility             | ETP was not operational, effluent discharged in the premises near to an open well. Spillage of process water/ chemicals in the process area, no liner/ drainage for the flooring.. |

  
**REGI P. JOSEPH**  
 DEPUTY DIRECTOR (GENERAL)  
 THIRUVOOR

  
**Dr. DEEPESH V.**  
 SCIENTIST 'C'  
 CENTRAL POLLUTION CONTROL BOARD  
 REGIONAL DIRECTORATE  
 MIN. OF ENV. FORESTS & CL. GOVT. OF INDIA  
 BENGALURU - 560 079. PH: 080 - 2323 3739

  
**BABURAJAN P.K.**  
 Chief Environmental Engineer

  
**K. ALARASAN, P.**  
 Environmental Engineer  
 Directorate of Environment  
 and Climate Change  
 Thiruvananthapuram-695 024

## 5.0 Observations of the Joint Committee

### *A) Industry operations and compliance status*

All the respondent industries are small scale industrial units operating within the Ollur Industrial Estate, managed and promoted by Kerala Small Industries Development Corporation (SIDCO) an undertaking of Government of Kerala. All the member units in the estate are relying on their captive wastewater treatment facilities and at present there are no common wastewater treatment facilities provided in the Ollur industrial estate.

All the respondent units are undertaking batch processes based on the work orders and hence wastewater management is also carried out in batch process. Since the ETPs are operated in batch mode, there are lacunas/ flaws in the ETP operation and this is reflected in the treated effluent quality. The ETPs are operated by the unit staff as per the protocol suggested by the consultant without the basic understanding of the treatment system, which leads to below par ETP performance. Being a batch process, the raw effluents are conveyed through makeshift arrangements like flexible hoses and this may lead to spillage pilferages and diversions in the unit premises. Provisions for collecting the spillage to the effluent treatment plant are not adequate in most of the electroplating units and there are no proper chemical resistant floor lining in the process area.

The units which are found non-compliant with the conditions of consent are served with notices dated 28.09.2022. Copies of the notices issued to M/s Aishwarya Gold Covering, M/s Bright Precured System 2, M/s Three Star Electroplating, M/s Two Star Designs Gold Covering are attached herewith as **Annexure 10, 11, 12 and 13**. The units were again inspected on 29.12.2022 by the officials of the District Office of the State Pollution Control Board, Thrissur and the functioning of the units was found satisfactory.

However, at this stage of inspection it cannot be concluded that the reasons for the concentration of heavy metals such as nickel, zinc, copper in excess of the permissible limits in well water is

  
**REGI P. JOSEPH**  
Deputy Collector (General)  
Thrissur

  
**Dr. DEEPESH V.**  
District Officer  
CENTRAL POLLUTION CONTROL BOARD  
REGIONAL DIRECTORATE  
MIN. OF ENV. FORESTS & CL. GOVT. OF INDIA  
BENGALURU - 560 079. Ph: 080 - 2323 3739

  
**BABURAJAN P.K.**  
Chief Environmental Engineer


  
**K. BALARAMAN, P.**  
Environmental Engineer  
Directorate of Environment  
and Climate Change  
Thiruvananthapuram-695 024



solely due to the electroplating units, as other type of units with activities such as pickling were observed working near the premises of these wells. The presence of iron and manganese in excess of the permissible limit of drinking water standards can be due to geogenic reasons.

### ***B) Assessment of water quality of open wells in the vicinity***

The respondent industrial units in the Ollur industrial estate are at higher elevation when compared to all the open wells selected for the assessment except the well inside the industrial estate. There are low lying fields/ seasonal wetlands to the southwestern, southern and southeastern directions of the industrial estate (Figure 1). The predominant natural surface runoff and water table gradient shall be towards these directions from the estate. Majority of the wells monitored are in eastern and southeastern direction from the respondent units. Some of the wells are in western southwestern and northern sides of the estate.

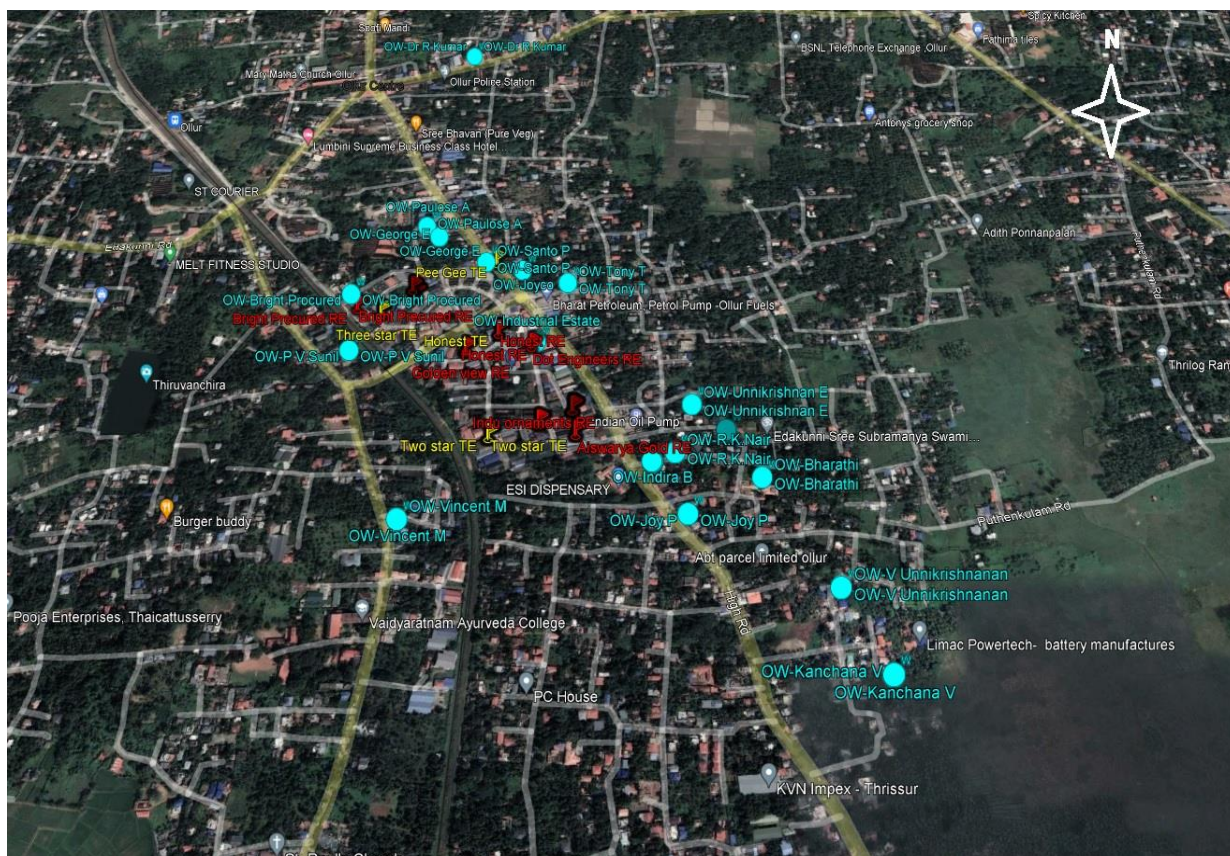

**Figure 8: Location of industries and open wells**  
(OW - Open well, TE - Treated effluent, RE- Raw effluent)

**REGI P. JOSEPH**  
Deputy Collector (General)  
Thrissur

**Dr. DEEPESH V.**  
JOINT SECRETARY  
CENTRAL POLLUTION CONTROL BOARD  
REGIONAL DIRECTORATE  
MIN. OF ENV. FORESTS & CL. GOVT. OF INDIA  
BENGALURU - 560 079. Ph: 080 - 2232 3729

**BABURAJAN PK.**  
Chief Environmental Engineer

**KALAIARASAN, P.**  
Environmental Engineer  
Directorate of Environment  
and Climate Change  
Thiruvananthapuram-695 024

As per the analysis results all the well water samples registered a pH value of 5.69 and below, which are not in compliance with the prescribed pH range of 6.5-8.5 in the IS 10500-2012 drinking water standard. Such low pH values are reported in groundwater samples in Thrissur and could be attributed to peculiar geomorphological conditions.

Usually, presence of iron, manganese and zinc in groundwater are often reported and is attributed to the peculiar geology of the State of Kerala. Several well water samples collected for this assessment indicated the presence of iron, manganese and zinc. Manganese values exceeded the limit in all six reported well samples, iron and zinc exceeded their respective limits in one open well each. Though, presence of iron, manganese and zinc in Kerala is linked to the geogenic attributes, presence of manganese, nickel and unusually higher zinc in a particular open well in the premises of A A Paulose indicates specific pollution from other sources. Similarly, the open well in the premise of Tony Thottan registered the presence of copper, nickel, manganese and zinc. During the visit it was observed that an automobile workshop exclusively for heavy earth movers was operating near to this well.

Due to the higher elevation in the industrial estate, the surface runoff and water table gradient shall be towards the low lying fields in east and south eastern directions. A railway line at a lower elevation passes along the western boundary of the estate. The majority of wells in the south eastern direction have not registered the presence of specific heavy metals except for iron and manganese. The two wells monitored in the western side, beyond the railway line also registered manganese and zinc respectively. The open well (A A Paulose) which registered nickel, manganese, unusually higher zinc and pH of 4.14 is north to the estate and very near to a brick manufacturing unit in the western side. The other open well which registered copper, manganese, nickel, zinc and the lowest pH (3.56) is located in the eastern side of the estate across the Thallore-Thrissur road. In the vicinity of this well there is a petrol station, automobile service center for heavy earth movers, other commercial establishments and residences. The unusual presence of heavy metals like nickel, copper, manganese and zinc needs further investigation. With the available monitoring data and observations, it is indicated that presence of specific heavy metals like nickel, copper, chromium used in electroplating/ electro colouring industries are not detected

  
**REGI P. JOSEPH**  
DEPUTY COLLECTOR (GENERAL)  
THRASSUR

  
**Dr. DEEPESH V.**  
SCIENTIST 'C'  
CENTRAL POLLUTION CONTROL BOARD  
REGIONAL DIRECTORATE  
MIN. OF ENV. FORESTS & CL. GOVT. OF INDIA  
BENGALURU - 560 079. PH: 080 - 2323 3739

  
**BABURAJAN P.K.**  
Chief Environmental Engineer

  
**K. A. ARASAN, P.**  
Environmental Engineer  
Directorate of Environment  
and Climate Change  
Thiruvananthapuram-695 024

in the downstream wells. The two wells in which copper and nickel were detected have several other potential sources near to them. The unusual presence of zinc in the open well needs to be probed further as there is a clay brick kiln near to the premise. Usually fine textured soil/clay will be richer in zinc and it could be possibly from the clay or zinc bearing soil used for brick manufacturing.

Though there are possibilities of spillage pilferage in many respondent industries, with this assessment it is not possible to link the presence of heavy metals in well water with the unauthorized discharge from the respondent units. Moreover, metals like iron, manganese and zinc are detected in a few wells which could be from geogenic sources. Ollur is also known for its traditional clay bricks/ tile industries due to the abundant clay soil in the low lying fields and the clay soil is usually rich in manganese and zinc.

## 6.0 Finding and suggestions of the Joint Committee

- I. The respondent industries are small scale industrial (SSI) units handling processes in batches based on piecemeal work/ job orders and the resulting wastewater management is also carried out manually in batches. When the effluent treatment is done in batch mode with manual intervention in each step, several variables (expertise of the personal, chemical dosage, variability (qualitative/ quantitative) in the influent wastewater and treatment equipment conditions) affect the overall treatment efficiency. Lack of a technically qualified ETP operator, makeshift arrangement for conveying wastewater and unscientific dosing of chemicals results in poor ETP performances. Being SSI units, they need to be mentored by the authorities of the industrial estate in which they are operating.
- II. It is always recommended to have a common ETP under the aegis of the industrial estate to cater to all the member units including the respondent SSI units. Common ETP can be operated effectively on continuous mode under the supervision of a qualified operator and the inherent flaws in the batch operations of individual ETP can be avoided. Therefore, Kerala SIDCO, the custodian of the industrial estate shall be directed to provide a common

  
**REGI P. JOSEPH**  
DEPUTY COLLECTOR (GENERAL)  
THIRUVARUR

  
**Dr. DEEPESH V.**  
SCIENTIST 'C'  
CENTRAL POLLUTION CONTROL BOARD  
REGIONAL DIRECTORATE  
MIN. OF ENV. FORESTS & CL. GOVT. OF INDIA  
BENGALURU - 560 079. PH: 080 - 2323 3739

  
**BABURAJAN P.K.**  
Chief Environmental Engineer

  
**K. A. ARASAN, P.**  
Environmental Engineer  
Directorate of Environment  
and Climate Change  
Thiruvananthapuram-695 024

ETP to manage all the effluent generated in the member units in the industrial estate and operation and maintenance cost should be realized from the member industries.

- III. All the respondent SSI units have small scale ETP to precipitate and separate out the metal contaminants in the effluent stream. The conditions of ETP indicate that there are no dedicated/ trained personnel to operate the system scientifically. The general treatment scheme consists of manual equalization/ neutralization of the collected wastewater from the process, neutralized wastewater is then pumped to a hopper shaped tank and flocculation / precipitation agents are manually dosed to precipitate metals. After certain contact time, effluent water containing precipitates is drained over a bed filled with sand/ coarse aggregates to retain the precipitates. Clear water from the bed is pumped through pressure sand & carbon filters and collected in a clear water tank for reuse. From the field observations, it is evident that neutralization/ equalization of the wastewater is not done properly and pH of the effluent is critical for effective precipitation of metals. Even the wastewater from the batch process is not conveyed to the collection tank in a foolproof manner, the dosing of precipitating/ flocculating agents in the hopper shaped tank is manually done and there are no design interventions to ensure affecting mixing of precipitating/ flocculating agents in this tank. The existing ETPs with their inherent design flaws along with the operational errors by untrained persons compounded the issue of poor treatment performance.
- IV. From the assessment carried out, nickel and copper contamination in two of the open wells cannot be linked to the respondent SSI units as there are many other small units processing metals and alloys. There are several service centers and other commercial units in the vicinity.
- V. In compliance with the orders of the NGT environmental compensation has to be calculated for the period of past violation. The period of past violation was verified from the file records of District Office of State Pollution Control Board at Thrissur. It is observed that

  
**REGI P. JOSEPH**  
DEPUTY COLLECTOR (GENERAL)  
THRASSUR

  
**Dr. DEEPESH V.**  
SCIENTIST 'C'  
CENTRAL POLLUTION CONTROL BOARD  
REGIONAL DIRECTORATE  
MIN. OF ENV. FORESTS & CL. GOVT. OF INDIA  
BENGALURU - 560 079. Ph: 080 - 2323 3739

  
**BABURAJAN P.K.**  
Chief Environmental Engineer

  
**K. A. ARASAN, P.**  
Environmental Engineer  
Directorate of Environment  
and Climate Change  
Thiruvananthapuram-695 024



discharging of effluents to outside by these industries except that from M/s Bright and Company was noted in the complaint enquiry conducted on 23.07.2012 by the State Pollution Control Board. Later due to the mounting complaints, the District Collector constituted a committee for verification of the complaint and on recommendation of the committee issued an order on 27.04.2013 to close down these units except M/s Bright and Company. These details have already been stated in this report under the heading 'Background of OA20/2016'. The order of the District Collector dated 27.04.2013 has already been produced herewith as Annexure 1. So the period of past violation is taken from 23.07.2012 to 27.04.2013. Therefore, calculation for Environmental Compensation (EC) as per the CPCB guidelines is furnished below.

|                                                                                                                                                                           |
|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| EC = $PI \times N \times R \times S \times LF$ , where PI, Pollution index of industrial sector = 65 (being a small scale industry having only water pollution potential) |
| N: Number of days of violation = 278 days (for the period from 23.07.2012 to 27.04.2013)                                                                                  |
| R: A factor in Rupees for EC = 100 (as the unit is a small scale red category unit)                                                                                       |
| S: Factor for scale of operation = 0.5 (being a small scale unit)                                                                                                         |
| LF: Location factor = 1 (for population less than 1 million)                                                                                                              |
| Hence, EC = $65 \times 278 \times 100 \times 0.5 \times 1$ = Rs.9,03,500/-                                                                                                |

- VI. However, in Bright Precured System 2, it was observed during the visit of this committee on 17.06.2022 that wastewater was discharged outside without any treatment and ETP was not in operation. Hence the unit is liable to pay compensation for violating the conditions in Consent No. PCB/DO/TSR/R2/ICO/2871/2018 issued to the unit. Copy of the consent to operate submitted as **Annexure 14**. Also the results of open well water sample from the unit shows a pH of 4.3 as well as there are exceedances with respect to Copper, Manganese and Nickel above the limits prescribed in the drinking water standards IS 10500:2012. It was also observed from the file of the State Pollution Control Board that the unit has replied

  
REGI P. JOSEPH  
DEPUTY COLLECTOR (GENERAL)  
THIRUVA

  
Dr. DEEPESH V.  
DISTRICT 'C'  
CENTRAL POLLUTION CONTROL BOARD  
REGIONAL DIRECTORATE  
MIN. OF ENV. FORESTS & CL. GOVT. OF INDIA  
BENGALURU - 560 079. Ph: 080 - 2323 3739

  
BABURAJAN P.K.  
Chief Environmental Engineer

  
K. BALARAMAN, P.  
Environmental Engineer  
Directorate of Environment  
and Climate Change  
Thiruvananthapuram-695 024

to the notice issued from the District Office, Thrissur and inspection was conducted by the State Pollution Control Board, District Office, Thrissur on 29.12.2022. During the inspection it was observed that all the 13 respondent units were functioning and the effluent treatment plants in all the units including that of M/s Bright Precured System 2 were in operational condition. Also no discharge from M/s Bright Precured System 2 to the premises or outside was observed. The house keeping in all the units were found satisfactory. Hence in addition to the Environmental Compensation (EC) amount calculated in para 5 above, Environmental Compensation (EC) for M/s Bright Precured System 2 has to be calculated as per the CPCB guidelines for the period 17.06.2022 to 29.12.2022 which is furnished below.

|                                                                                                                                                                           |
|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| EC = $PI \times N \times R \times S \times LF$ , where PI, Pollution index of industrial sector = 65 (being a small scale industry having only water pollution potential) |
| N: Number of days of violation = 195 days (for the period from 17.06.2022 to 29.12.2022)                                                                                  |
| R: A factor in Rupees for EC = 100 (as the unit is a small scale red category unit)                                                                                       |
| S: Factor for scale of operation = 0.5 (being a small scale unit)                                                                                                         |
| LF: location factor = 1 (for population less than 1 million)                                                                                                              |
| Hence, $PI = 65 \times 195 \times 100 \times 0.5 \times 1 = \text{Rs.} 633750/-$                                                                                          |

Total amount of EC to be levied on M/s Bright Precured System 2 is the sum of 9,03,500/- and 6,33,750/- which is Rs. 15,37,250/-

  
REGI P. JOSEPH  
DEPUTY COLLECTOR (GENERAL)  
THRASSUR

  
Dr. DEEPESH V.  
SCIENTIST 'C'  
CENTRAL POLLUTION CONTROL BOARD  
REGIONAL DIRECTORATE  
MIN. OF ENV. FORESTS & CL. GOVT. OF INDIA  
BENGALURU - 560 079. Ph: 080 - 2323 3739

  
BABURAJAN P.K.  
Chief Environmental Engineer

  
K. BALARAMAN, P.  
Environmental Engineer  
Directorate of Environment  
and Climate Change  
Thiruvananthapuram-695 024

VII. The amount of EC to be realized from the units are tabulated and furnished below:


| <b>S. No.</b> | <b>Name of Industries</b>                   | <b>Environmental Compensation</b> |
|---------------|---------------------------------------------|-----------------------------------|
| 1             | M/s Bee Pee Gold Imitations                 | Rs. 903500/-                      |
| 2             | M/s Indu Ornaments                          | Rs. 903500/-                      |
| 3             | M/s Mini Job Works (Aiswarya Gold Covering) | Rs. 903500/-                      |
| 4             | M/s Renu Gold Covering                      | Rs. 903500/-                      |
| 5             | M/s DOT Engineering                         | Rs. 903500/-                      |
| 6             | M/s Rajesh Kumar Electroplating             | Rs. 903500/-                      |
| 7             | M/s Golden View Plating                     | Rs. 903500/-                      |
| 8             | M/s Two Star Designs Gold Covering          | Rs. 903500/-                      |
| 9             | M/s Pee Gee Gold Covering                   | Rs. 903500/-                      |
| 10            | M/s Honest Electro colouring                | Rs. 903500/-                      |
| 11            | M/s Three Star Electroplating               | Rs. 903500/-                      |
| 12            | M/s Bright Precured System 2                | Rs. 1537250/-                     |
| 13            | M/s Bright & Company                        | Nil                               |
|               | <b>Total</b>                                | <b>Rs.11475750/-</b>              |

  
**REGI P. JOSEPH**  
 DEPUTY COLLECTOR (GENERAL)  
 THRISSUR

Sri. Reji Joseph  
 Additional District Magistrate, Thrissur.

  
**Dr. DEEPESH V.**  
 SCIENTIST 'C'  
 CENTRAL POLLUTION CONTROL BOARD  
 REGIONAL DIRECTORATE  
 MIN. OF ENV. FORESTS & CC, GOVT. OF INDIA  
 BENGALURU - 560 079. Ph: 080 - 2323 3739

Dr. Deepesh V, Scientist C  
 Central Pollution Control Board,  
 Regional Directorate, Bengaluru.

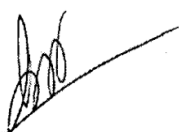  
**BABURAJAN P.K.**  
 Chief Environmental Engineer

Sri. Baburajan P.K.,  
 Chief Environmental Engineer,  
 Kerala State Pollution Control Board,  
 Regional Office, Ernakulam

  
**KALAIARASAN.P**  
 Environmental Engineer  
 Directorate of Environment  
 and Climate Change  
 Thiruvananthapuram-695 024

Sri. Kalaiarasan P  
 Environmental Engineer,  
 Directorate of Environment and Climate  
 Change (DoECC), Govt. of Kerala,  
 Thiruvananthapuram.



## Minutes of hearing conducted in connection with OA.No.20/2016.

Hearing commenced at 11.15 am on 17/08/2023 in the Chamber of Chairman with the Chairman presiding .

The list of participants is given below:-

| Sl. No. | Name                | Designation & Organisation                               |
|---------|---------------------|----------------------------------------------------------|
| 1.      | Sri.Vijay George    | Bright Precured Systems, Ollur                           |
| 2.      | Sri. Anto Rappai    | Honest Electro Colouring, Ollur                          |
| 3.      | Sri.I.J.Raphy       | Three Star Electroplating Works, Ollur                   |
| 4.      | Sri.Sunil P.V.      | Two Star Designs, Ollur                                  |
| 5.      | Sri.Joby A.P.       | Beepee Gold Imitations, Ollur                            |
| 6.      | Smt.Soumya A.S.     | Asst. Environmental Engineer, KSPCB,Thrissur             |
| 7.      | Smt.Suchithra V.    | Environmental Engineer, KSPCB,DO, Thrissur               |
| 8.      | Sri. Baburajan P.K. | Chief Environmental Engineer, Regional Office, Ernakulam |
| 9       | Smt.Ramya G.        | Environmental Engineer, Head Office                      |

Member Secretary was also present in the hearing. The Chairman welcomed the participants and requested the Environmental Engineer, District Office, Thrissur to give a brief description of the matter. She informed that a common



complaint against electroplating units in SIDCO Industrial Estate at Ollur dated 16/07/2012 was received from the Edakkunny Poursamithi and enquiry was conducted. At that time, 20 such units were working in the Industrial Estate. In the light of serious complaints, the District Collector constituted a Monitoring Committee and based on the inspection report of the Committee, the District Collector ordered on 27/04/2013 to close down the operation of 19 units until adequate pollution control measures were provided. The units were directed to provide treatment plant with reuse facility and dispose off the sludge at the common hazardous wastes storage and disposal facility at Ambalamedu. Later based upon several inspections of the committee the unit which have complied with the instructions were allowed to restart in 2014. Meanwhile some of the units stopped their operation and only 13 units are now working in the industrial estate. Later in 2016, OA.No.20/2016 was filed before the Honourable NGT by Sri.Santo P.L. and others against the pollution caused by the Industrial units and a Joint Committee was constituted by Honourable NGT. Based on the report the Honourable NGT, vide order dated 20/04/2022, directed the Joint Committee to ascertain the compliance in respect of each of the units and also to ascertain past violation to assess the compensation and to recover the same as per polluter pays principle based on estimated cost of remediation and also taking into account financial capacity of the units. The Joint Committee assessed the amount of compensation and reported to the Head Office. Notice was issued to 12 units based on the recommendation to show cause, if any, for not levying the Environmental Compensation. The units furnished reply to the notice requesting for a personal hearing.

The Chairman then requested the unit representatives to explain their contentions. The unit owners informed that all the units are small scale units which are struggling due to financial constraints after the flood in 2018 and Covid outbreak in 2020. They have requested to waive the compensation. Chairman replied that since violation had already occurred, compensation for the past violation cannot be exempted. Further the unit representatives requested to consider reworking or relaxation of the amount of compensation. They also informed that as per a High Court order, drinking water was supplied by them to the nearby residents. It was also reported that SIDCO had issued stop memo to these units in February 2016 itself and the units had stopped their operation well before the order of the District Collector.

The Environmental Engineer, District Office, Thrissur informed that a few of the units had obtained Board's consent during the said period. Member Secretary and Chief Environmental Engineer, Regional Office, Ernakulam opined that this may be considered while calculating the Environmental Compensation. After examining the contentions raised by the units the following decisions were taken by the Chairman.

1. Environmental Compensation for past violation cannot be exempted and shall be remitted as agreed by the unit owners. However based on their request the amount of compensation shall be reassessed.
2. Either non- obtainment of Board's consent/pollution from the unit may be considered as violation.
3. If the unit produces proper documental evidence for non- operation during the period from the date of shut down as per the stop memo of

SIDCO upto the date of closure direction from the District Collector, the said period may be exempted while considering the number of days of violation. (Authentic documents like electricity bill or certificate from SIDCO to the effect that the unit was non operational during the said period may be produced)

4. Drinking water supply may be considered as a part of CSR and the expenditure towards the same may be deducted from the amount of compensation on submission of proper records in proof of water supply and the amount incurred.
5. The Environmental Engineer, District Office, Thrissur shall file the report before the Honourable NGT informing the outcome of hearing. She shall also forward the same to the Chairman
6. The Environmental Engineer, District Office, Thrissur shall verify the aforementioned documents under items (3) and (4) above, rework the Environmental Compensation and shall submit the same with specific recommendations.
7. Further action including direction to remit Environmental Compensation shall be taken after examining the revised Environmental Compensation calculation.



CHAIRMAN