

**BEFORE THE NATIONAL GREEN TRIBUNAL  
PRINCIPAL BENCH, NEW DELHI  
(Original Application No.147/2021)**

**IN THE MATTER OF:**

**Mahesh chander Saxena**

**..... Applicant**

VERSUS

**The Chief Secretary, Govt. of National Capital Territory of  
Delhi and Ors.**

**....Respondent**

**INDEX**

<b><u>S. No</u></b>	<b><u>Particulars</u></b>	<b><u>Annexure</u></b>	<b><u>Page no.</u></b>
1.	Status report by DJB	--	1 to 4
2.	Copies of nomination of Members of Joint Committee	A	5, 6 & 7
3.	MoM of the Committee ( dated 01.09.2021 (1st meeting)	B & C	8
5.	Copies of inspection reports Copies of Photographs of the societies inspected	B & C	9 to 39 42 to 66
6.	MoM of the Committee 06.10.2021(2 <sup>nd</sup> Meeting)	D	67
7.	Letter to DPCC dated 17.11.2021	E	68



**DELHI JAL BOARD**

New Delhi

Dated: 23.11.2021

1

**DELHI JAL BOARD: GOVT. OF NCT DELHI**  
**OFFICE OF THE ADDITIONAL CHIEF ENGINEER (C-8)**  
**B-BUILDING, KAROL BAGH, NEW DELHI-110005**

**No.DJB/ACE (C-8)/2021/224**

**Dated: 23/11/21**

To,

The Registrar General,  
Hon'ble National Green Tribunal House,  
FaridKot House, Copppernicus Marg,  
New Delhi-110001

**Subject:- Original Application No. 147/2021 in the matter of Sh. Mahesh Chandra Saxena V/s The Chief Secretary, Govt. of National Capital Territory of Delhi and Ors. pending before this Hon'ble Tribunal.**

Respected Sir,

Kindly refer to order dated 07 July 2021 passed by this Hon'ble Tribunal in the above captioned matter relating to Rain Water Harvesting System constructed in the societies of Dwarka, New Delhi, wherein following directions have been passed;

*"4. In View of the above, a joint Committee of DJB, CPCB and DPCC may look into the matter and take remedial action in the matter in technical*

*efficacy of installed systems and changes, if any, required and the issue of contamination of ground water."*

It is submitted that in compliance of the above said directions of this Hon'ble Tribunal, a joint committee of members from DJB, CPCB and DPCC was constituted after DPCC nominated its member on 26.08.2021 to look into the matter and take remedial action. Copy of the said office order is annexed herewith and marked as **Annexure-A**.

The first meeting of the committee was held on 01.09.2021 and it was decided by the Committee Members to randomly inspect 30-35 societies of Dwarka area regarding technical efficacy, changes in the installed systems if any, contamination of ground water if any and remedial measures in the matters. Copy of minutes of meeting Dated 01.09.2021 is annexed herewith and marked as **ANNEXURE-B**.

A Joint inspection team was formed by the Committee comprising members from DJB, CPCB, DPCC, DTQC (DJB), which conducted random inspections of societies at Dwarka from 06.09.2021 to 30.09.2021. The copy of the said inspection reports along with photographs are annexed herewith and marked as **ANNEXURE-C(Colly)**.

The second meeting of the constituted committee was held on 06.10.2021 in the office of Additional Chief Engineer (DJB), wherein the joint inspection team apprised about the inspections carried out

in above said societies. Copy of minutes of meeting Dated 06.10.2021 is annexed herewith and marked as **ANNEXURE-D**.

The findings of the Joint Inspection Team were deliberated by the Committee which are as under.

- It was apprised that regarding technical efficacy of RWH Systems, the designs of the same have been adopted either from CGWB or DJB which are satisfactory in technical efficacy. The recharge well pipes were taken deep into the static ground water level by the societies due to which contamination was bound to occur. As per the required parameters of the CGWB designs, the depth of recharge well pipes should have been kept 3-5m above the static ground water levels.
- The contamination may occur in the societies due to mixing of the rain water with the waste water from different sources like waste washing area water with detergents having chemicals from balconies other than that of roof top rain water and the waste water from paved /parking areas of the societies.
- Regarding contamination of ground water, it was apprised to the committee that on testing of the 38 Nos. water samples taken from 31 societies, It has been observed that very partial contamination, out of the 27 parameters tested, samples have exceeded the permissible limit in only 2-3 parameters i.e. color, turbidity and ammonia.


- It was further apprised that to avoid contamination of the ground water, only rain water from roof top area be diverted to the rain water harvesting systems.
- The water from other sources entering to RWH System such as balconies, washing areas etc. should be disconnected with immediate effect for which necessary advice has been given to the Societies during inspection.

As there is water pollution in the above said societies, a letter has been written by DJB (being the Nodal Agency) to DPCC to direct the societies of Dwarka to take all necessary remedial actions in a time bound manner, with regard to rectification of water pollution as per Water & Air Act. A True copy of the Letter Dated 17.11.2021, is annexed herewith and marked as **ANNEXURE-E**.

Since there are around 400 societies in Dwarka area and it is possible to inspect one society per day, it is submitted that to inspect remaining 369 societies, this committee shall require around 369 working days to complete the target.

Submitted for kind perusal please.

Yours Faithfully

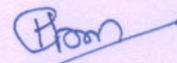

(HARISH CHANDER)

Additional Chief Engineer (C-8)

Delhi Jal Board

DELHI JAL BOARD: GOVT OF NCT DELHI  
OFFICE OF THE CHIEF ENGINEER (WB/C) EE (RWH/GWC) I  
ROOM NO. 107, VARUNALAYA PHASE-II DELHI JAL BOARD  
KAROL BAGH, NEW DELHI- 110005  
e mail: [cewbjdb@gmail.com](mailto:cewbjdb@gmail.com)

REMINDER

DIARY NO 1304  
DATE 13/08/2021

No. DJB/CE(WB/C)/2021/36

Dated: 12/8/21

Subject: Nomination of Member for Joint Committee.

Reference: Hon'ble Court Order dated 07/07/20 passed in Original Application No. 147/2021 Mahesh Chandra Saxena Versus The Chief Secretary, Govt. of NCT of Delhi & Ors.

May please refer the above-mentioned matter wherein a Joint Committee is to be Constituted with the Members from CPCB, DPCC & DJB. The DJB will be the nodal agency for coordination and compliance from DJB side. The details of nodal officer are given below:-

Name: Sh. Vimal Belani, EE (RWH)  
Designation: EE (RWH)  
Mobile No.: 9650291229  
e-mail ID: [rainwaterharvesting2013@gmail.com](mailto:rainwaterharvesting2013@gmail.com)

Therefore, you are requested to Nominate a Member from your department along with his contact details.

*Gopalji Rai*  
12/8/2021  
(GOPALJI RAI)  
CE (WB/C)


Member Secretary, DPCC  
4th, 5th Floor, ISBT,  
GT Karnal Road, Kashmere Gate,  
New Delhi-110006.

Copy to:-

1. CEO: for information please.
2. Member (WS)
3. SE (RWH/WB)
4. EE (RWH)
5. O/C

*Gopalji Rai*  
12/8/2021  
CE (WB/C)

By Speed Post

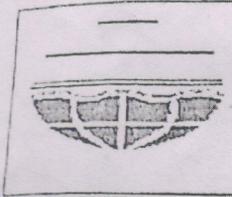

DELHI POLLUTION CONTROL COMMITTEE  
DEPARTMENT OF ENVIRONMENT, (GOVT. OF NCT OF DELHI)  
4<sup>TH</sup> & 5<sup>TH</sup> FLOOR, ISBT BUILDING, KASHMERE GATE, DELHI-6  
visit us at : <http://dpcc.delhigovt.nic.in>

F.NO.DPCC/CMC-II/DJB-NOMINATION/2021 9838-46

Dated: 26/08/2021

To,

The Chief Engineer  
Room No.-107, Varunalaya Phase-II  
Karol Bagh, New Delhi-110005


Subject: Nomination of Member for Joint Committee

Sir,

This is with reference to your letter No. DJB/CE(WB/C)/2021-33 dated 16.07.2021 regarding nomination of Member for Joint Committee in compliance of Hon'ble NGT Order dated 07.07.2020 passed in OA No. 147/2021 in the matter of Mahesh Chandra Saxena Vs The Chief Secretary, Govt. of NCT of Delhi & Ors.

In view of above it is to inform you that Sh. N.K. Joshi, Environmental Engineer, 9717593527 is nominated as member for the Joint Committee.

Yours Sincerely,

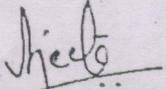  
Ajeeta Agrawal  
Incharge, CMC-II

Copy to:

- Legal Officer, DPCC
- Master File

Speed Post/E-mail

Hon'ble NGT Matter

o. A-14011/1/2021 -WQM-I/472

28/07/2021


Gopalji Rai  
Chief Engineer  
Chief Engineer (WB/C), Room No 107,  
Central Pollution Control Board, Phase II, Karol Bagh, New Delhi-110005  
[gdjb@gmail.com](mailto:gdjb@gmail.com)

Subject: Nomination of CPCB official as a member of the Joint Committee constituted by Hon'ble NGT (PB) order dated 07/07/2021 in O.A. No. 147 of 2021 in the matter of Mahesh Chandra Sharma Vs The Chief Secretary, Govt of NCT of Delhi & Ors.

This is in reference to your Letter dated 16/07/2021 on above captioned subject. Hon'ble NGT vide order dated 07/07/2021 in OA No 147 of 2021, constituted a Joint Committee comprising officials of CPCB, DPCC and DJB to ascertain the technical efficacy of installed systems and changes, if any, required and the issue of contamination of ground water. DJB will be the nodal agency for coordination and compliance.

In this connection, Smt Suniti Parashar, Scientist C, WQM-I Division has been nominated to represent CPCB in the committee in compliance to Hon'ble NGT order dated 07/07/2021 (Contact details of Scientist C: Mob 9868819711 and E-mail [suniti.cpcb@gov.in](mailto:suniti.cpcb@gov.in)).

Yours faithfully,

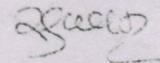

(A. Sudhakar)

Divisional Head, WQM-I

8800326699

Sh. J. C. Babu

Sc. D, WQM-I

9868278903

43102413

DELHI JAL BOARD: GOVT. OF NCT DELHI  
OFFICE OF THE EXECUTIVE ENGINEER (RWH/GWC)  
ROOM NO-208, VARUNALAYA PH-I,  
KAROLBAGH, NEW DELHI

No.DJB/EE (RWH/GWC)/2021/5146(A)

Dated:- 01/09/2021

Sub:- Minutes of the meeting regarding inspection of rain water harvesting and bore wells of all CGHS Societies in Dwarka as per NGT Court orders.

Ref:- Hon'ble NGT Court Order dated 07.07.2020 passed in Original Application No. 147/2021 Mahesh Chandra Saxena Versus The Chief Secretary, Govt. of NCT of Delhi & Ors.

The following members attended the meeting held today i.e. 01.09.2021 in the office of undersigned;

1. Sh. Harish Chander, ACE(RWH), DJB
2. Ms. Suniti Parashar, Scientist "C", WQM-I Division, CPCB
3. Sh. Vimal V. Belani, EE(RWH)-I
4. Sh. Ashutosh Kaushik, DTQC, DJB
5. Sh. N.K. Joshi, Environmental Engineer, DPCC
6. Sh. Rakesh Kumar Sharma, AE-I, DJB

Following points were deliberated in the said meeting;

- (A) In compliance to the orders of Hon'ble NGT in the above said matter a Joint Inspection Team has been constituted from DJB, DPCC, CPCB to randomly inspect 30-35 Societies of Dwarka area regarding technical efficacy, changes in the installed systems if any, contamination of ground water if any and remedial measures in the matter.
- (B) Report of the said inspections shall be submitted by Joint Inspection Team to the Committee latest by 07.10.2021 and inspections to be completed by 30.09.2021.
- (C) The Joint Inspection Team shall constitute of the following members;
  - i. Sh. Rakesh Kumar Sharma, AE(Civil),RWH Cell, DJB
  - ii. Ms. Alpana, CPCB
  - iii. Mr. Shivansh, DPCC
  - iv. Sh. S.K. Rathi, ACWA, DJB

Since the matter is related to Hon'ble NGT, It was emphasized that the random inspections shall be started at the earliest.  
Meeting ended with vote of thanks.

EE(RWH/GWC)-I

All concerned

Copy to:

1. Member (WS) : For kind information please.
2. CE(WB/Conservation) : -do-
3. ACE(RWH) : -do-
4. Ms. Shakshi Popli, DJB Legal Counsel, 614, Patiala House, New Delhi-110002:
5. AE-I (RWH)

6. O/c

EE(RWH/GWC)-I

Performa for Joint Inspection of RWH system- in Dwarka, New Delhi, in O.A. No. 147/2021 of Hon'ble NGT.

1. Name and address of unit: *Shreemiketan apartments, plot 1 sector 7 dwarka*
2. Area detail :
  - i. Roof top area: *2600 m<sup>2</sup>*
  - ii. Paved/road/green area (optional):
  - iii. Total Plot area: *14293 m<sup>2</sup>*
3. Date of inspection: *06-9-2021* (The status given below is as on inspection date)

S.No	Govt./Pvt Society	RWH system exist or not	Status of RWH system, if exist				Remarks
			Nos. of pit	Size of pit	No. & size of recharge well	Whether Functional Yes/No	
1.	CAHS	yes.	5 nos	3.5x1.75 x 3.5 (5 nos)	5 nos.	Partly functional and need Replisement of/medis	① Numbering of RWH pits to be done by RWH. ② surface area + Roof top surface going into RWH. ③ Replisement of rech. wells Regd ④ filter medis to be replaced

*Sh. Rathie S.K*  
 Member DTDC  
 9911277675

*(Vimal Belani/EE)*  
*(Rakesh Sharma/AE)*  
 9650291229 / 9650894440

*(Shivranish Verma)*  
 7906425341  
 Inspection team Member 2, DPCC

*(Alpina Narula)*  
 997102255  
 Inspection team Member 3, CPCB  
*(on the Way)*  
 9540844936

*M. MAHESH SAXENA*  
 APPELLANT  
 in NGT

*(Signature)*  
 Signature of President/General Secretary/Estate Manager  
*Sh. Jagjit Singh Chaudhary*  
 9999501179

Performa for Joint Inspection of RWH system- in Dwarka, New Delhi, in O.A. No. 147/2021 of Hon'ble NGT.

1. Name and address of unit: THE YOUNG AMERIA CGHS LTD, PLOT No.2, SECTOR-7, DWARKA, ND - 110075
2. Area detail :
  - i. Roof top area: 1500 sqm
  - ii. Paved/road/green area (optional):
  - iii. Total Plot area: 4500 sqm
3. Date of inspection: 06.09.2021 (The status given below is as on inspection date)

(2)

S.No	Govt./Pvt Society	RWHS system exist or not	Status of RWHS system, if exist				Remarks	
			Nos. of pit	Size of pit	No. & size of recharge well	Whether Functional Yes/No		Adequate Yes/No
1.	CGHS LTD	YES	02	capacity as per CGHS report = 30 m <sup>3</sup>	02	NON functional	YES	① Filter media needs to be replaced ② Surface water to be segregated from RWHS system. ③ Redevelopment of recharge wells needs to be done. ④ Disinfection and chlorination needs to be done. ⑤ The representatives of CGHS "Sh. AK Garg" has complained that the agency working for cleaning/maintenance of RWHS has not done the work satisfactorily.

06/09/2021  
MEMBER DTQC  
Sh. Ekta SK

*[Signature]*  
Inspection team  
Member 1, DJB

*[Signature]*  
Inspection team  
Member 2, DPCC

*[Signature]*  
Inspection team  
Member 3, CPCB  
Sh. MAHESH SAXENA  
APPELLANT  
w NGT

*[Signature]*  
Signature of President/General Secretary /Estate Manager  
06/09/2021  
AK GARG

Performa for Joint Inspection of RWH system- in Dwarka, New Delhi, in O.A. No. 147/2021 of Hon'ble NGT.

1. Name and address of unit: **RASHI APARTMENT, PLOT No. 3, SECTOR-7, DWARKA, ND-110075**
2. Area detail:
  - i. Roof top area: **3150 sqm**
  - ii. Paved/road/green area (optional):
  - iii. Total Plot area: **10500 sqm**
3. Date of inspection: **09.09.2021** (The status given below is as on inspection date)

3

S No	Govt./Pvt. Society	RWH system exist or not	Nos. of pit	Size of pit	Status of RWH system, if exist			Remarks
					No. & size of recharge well	Whether Functional Yes/No	Adequate Yes/No	
1	CAHS	YES	02	6.0 X 2.10 X 2.50mtr	—	01 Pit functional & 01 Pit non-functional (w/c stagnate)	YES	① pit no 1: two more covers for opening required. ② Filter media to be replaced ③ Only roof top runoff in pits to be allowed. Runoff from paved area to be taken out in m.p. drains

*[Signature]*  
MEMBER  
BTQC  
278

*[Signature]*  
Inspection team  
Member 1, DJB

*[Signature]*  
Inspection team  
Member 2, DPCC

*[Signature]*  
Inspection team  
Member 3, CPFB  
**MANESH SHARMA**  
(appellant)

*[Signature]*  
Signature of President/General Secretary  
**SUDHA SINHA**  
(Federation)  
9810442903

Performa for Joint Inspection of RWH system- in Dwarka, New Delhi, in O.A. No. 147/2021 of Hon'ble NGT.

(4)

1. Name and address of unit: *The true friends co-op group H. society Ltd*
2. Area detail:
  - i. Roof top area: *1859m<sup>2</sup>*
  - ii. Paved/road/green area (optional):
  - iii. Total Plot area: *8499m<sup>2</sup>*
3. Date of inspection: *9/9/21* (The status given below is as on inspection date)

✓ (4)

S.No	Govt./Pvt Society	RWH system exist or not	Status of RWH system, if exist				Remarks	
			Nos. of pit	Size of pit	No. & size of recharge well	Whether Functional Yes/No		Adequate Yes/No
1.	<i>Society</i>	<i>yes</i>	<i>two nos</i>	<i>2 x 3.5 x 2.0 x 3.2m</i>	<i>2 nos</i>	<i>Both non functional</i>	<i>yes</i>	① Recharge wells need silt removal ② Filter media needs to be replaced ③ depth of Recharge wells 7.5' to 11' ④ paved area runoff needs to be segregated to npl drains.

*[Signature]*  
MEMBER  
DTQC  
DJB

*[Signature]*  
Inspection team  
Member 1, DPCC

*[Signature]*  
Inspection team  
Member 2, DPCC

*[Signature]*  
Inspection team  
Member 3, CPCE

*[Signature]*  
MAHESH  
SAXENA  
(Appellant)

*[Signature]*  
Signature of President/General Secretary/Executive Manager  
PRADIP SINGH  
Dt. 09/09/2021.  
M-9873079075.

*[Signature]*  
left the inspection  
SUDHA  
SINGHA  
Federation  
President

Performa for Joint Inspection of RWH system- in Dwarka, New Delhi, in O.A. No. 147/2021 of Hon'ble NGT.

1. Name and address of unit : VEG SANCHAR APARTMENT, PLOT NO - 19B, SECTOR-6, DWARKA, ND-11  
 AASTHA APARTMENT (5)

2. Area detail :  
 i. Roof top area :  
 ii. Paved/road/green area (optional):  
 iii. Total Plot area:

3. Date of inspection: 09.09.2021 (THU)

(The status given below is as on inspection date)

S.No	Govt./Pvt Society	RWH system exist or not	Status of RWH system, if exist				Remarks
			Nos. of pit	Size of pit	No. & size of recharge well	Whether Functional Yes/No	
1.	CGHS	YES	01			NON Functional	① paved surface runoff to be segregated and directed to mpt drain. ② Filter media to be replaced. ③ only top runoff to be taken into RWH pits

*[Signature]*  
 MEMBER  
 DTQC  
 DJB.

*[Signature]*  
 Inspection team  
 Member 1, DJB

*[Signature]*  
 Inspection team  
 Member 2, DPCC

*[Signature]*  
 Inspection team  
 Member 3, CPCB

*[Signature]*  
 MAHESH SAXENA  
 (appelle)

*[Signature]* Left for inspection  
 Signature of President/General SUDHA SINHA  
 Secretary/Estate Manager (Federation) JAGMOHAN  
 Member Puri kont 9811587733

Performa for Joint Inspection of RWH system- in Dwarka, New Delhi, in O.A. No. 147/2021 of Hon'ble NGT.

1. Name and address of unit **PRAGYA CGHS, PLOT NO. 18, SECTOR-2, DWARKA, ND-75**
2. Area detail:  
 i. Roof top area:  
 ii. Paved/road/green area (optional):  
 iii. Total Plot area:
3. Date of inspection: **9/9/21** (The status given below is as on inspection date)

S.No	Govt./Pvt Society	RWHSYSTEM exist or not	Status of RWH system, if exist				Remarks
			Nos. of pit	Size of pit	No. & size of recharge well	Whether Functional Yes/No	
1	CGHS	YES	02	could not be measured	02 (165'-0" deep)	NON Functional	<p>① Both RWH Pits to be covered with provision of opening.</p> <p>② Peepal tree &amp; other vegetation to be removed from the RWH Pits</p> <p>③ Only rooftop water to be harvested.</p> <p>④ Paved area water to be connected with open drains.</p> <p>⑤ Filter media of RWH to be replaced &amp; Boxes to be redeveloped.</p>

The president Mr Rajeev Gupta has been advised to e-mail all required documents at EE (RWH)-I email: [rainwaterharvesting2013@gmail.com](mailto:rainwaterharvesting2013@gmail.com) since no member of society is present at site.

*[Signature]*  
 09/09/21  
 MEMBER DTQC DJB.

*[Signature]*  
 Inspection team Member 1, DJB

*[Signature]*  
 Inspection team Member 2, DPCC

*[Signature]*  
 9/9/2021  
 Inspection team Member 3, CPCB

*[Signature]*  
 MAHESH SAXENA  
 (appellant)

e-mail: [PRAGYACGHS LTD@gmail.com](mailto:PRAGYACGHS LTD@gmail.com)  
 09/09/21 0130511478  
 Signature of President/General Secretary/In-charge Manager  
 DHEERAJ CAW TAKEN

Performa for Joint Inspection of RWH system- in Dwarka, New Delhi, in O.A. No. 147/2021 of Hon'ble NGT.

1. Name and address of unit **CELESTIAL HEIGHTS, PLOT NO. 1A, SECTOR-2, DWARKA, ND-75 (THE AARTI CGHS LTD)** (7)
2. Area detail:  
 i. Roof top area **908.80 sqm**  
 ii. Paved/road/green area (optional):  
 iii. Total Plot area **4999.73 sqm**
3. Date of inspection: **09-09-2021** (The status given below is as on inspection date)

S.No	Govt./Pvt Society	RWH system exist or not	Status of RWH system, if exist				Remarks
			Nos. of pit	Size of pit	No. & size of recharge well	Whether Functional Yes/No	
1.	CGHS	YES	02	Not available As per CGHS record 1x3.0x3.0x5.0 mt 1x3.0x3.0x5.0 mt	Not visible	01 Pit functional & 01 Pit Non functional as well stagnated	YES 01 Over RM hit stagnated with Appropriate works 02 Paved area run off to be segregated from RWH pit. 03 curb Roof Top run off to be channelled. 04 Recharge well not visible. 05 Filter media to be replaced in non functional RWH pit.

The case taken has been advised to e-mail all Request documents @ [naitimalikaveer@2013@gmail.com](mailto:naitimalikaveer@2013@gmail.com) as no member of committee are available at site.

*Subh*  
09/09/21  
MEMBER  
DTQC  
D.B.

*Belam*  
Inspection team  
Member 1. HB

*Ricard*  
Inspection team  
Member 2. DPCC

*Arundh*  
09/09/2021  
Inspection team  
Member 3. CPB

*Manoj*  
Signature of President/General  
Secretary/Estate Manager  
(appellant)  
CLT 9350 883247

*Sudhir*  
Signature of President/General  
Secretary/Estate Manager  
SUDHIR SINGH  
Federation  
Residents

Performa for Joint Inspection of RWH system- in Dwarka, New Delhi, in O.A. No. 147/2021 of Hon'ble NGT.

1. Name and address of unit SAHARA APARTMENTS, PLOT NO. 11, SECTOR- 6, DWARKA, ND-75.

2. Area detail:  
 i. Roof top area: 1950 sqm  
 ii. Paved/road/green area (optional):  
 iii. Total Plot area: 8500 sqm

(8)

3. Date of inspection: 14.09.2021

(The status given below is as on inspection date)

S.No	Govt./Pvt Society	RWH system exist or not	Nos. of pit	Size of pit	Status of RWH system, if exist		Adequate Yes/No	Remarks
					No. & size of recharge well	Whether Functional Yes/No		
1	CGHS	YES	02	39 m <sup>3</sup>	02 Both 50'-0" deep each	One Pit functional & One Pit Non-functional	YES	① Paved surface seen off to be segregated and diverted to npl drain ② Recharge well to be redeveloped. ③ Filter media to be replaced. ④ Both recharge wells to be capped. ⑤ Covers of recharge pits to be provided with handles.

*Signature*  
 MEMBER  
 DTAC  
 JJ.B.

*Signature*  
 Inspection team  
 Member 1, DIB

*Signature*  
 Inspection team  
 Member 2, DPCC

*Signature*  
 Inspection team  
 Member 3, CPCB  
 (SUNJITI PARASHAR) (appellant)  
 9768813111

(V: President)  
 Harjot Kaur  
 14/9/21  
 9868629579  
 Signature of President/General Secretary / Est. Mgr  
 SAHARA  
 SINHA  
 (President)

Performa for Joint Inspection of RWH system- in Dwarka, New Delhi, in O.A. No. 147/2021 of Hon'ble NGT.

1. Name and address of unit NEW ASHIANA APARTMENT, PLOT NO.10, SECTOR-6, DWARKA, ND-75
2. Area detail :
  - i. Roof top area : 1190 sqm
  - ii. Paved/road/green area (optional)
  - iii. Total Plot area. 8499.97 sqm
3. Date of inspection: 14-09-2021

(9) ✓

(The status given below is as on inspection date)

S.No	Govt./Pvt Society	RWH system exist or not	Status of RWH system, if exist				Remarks
			Nos. of pit	Size of pit	No. & size of recharge well	Whether Functional Yes/No	
1.	CGHS	YES	02	23.25 cum	02 Both 40'-00" depth Non-functional	Both RWH Pits are	YES ① Paved surface runoff to be segregated and diverted to mpl drain. ② Recharge wells to be redeveloped. ③ Filter media to be replaced. ④ Both recharge wells to be capped. ⑤ Covers of recharge pits to be provided with handle

*[Signature]*  
MEMBER  
DTQC  
27B.

*[Signature]*  
Inspection team  
Member 1, DIB

*[Signature]*  
Inspection team  
Member 2, DICC

*[Signature]*  
Inspection team  
Member 3, CFCB  
**MAHESH SAXENA**  
(appellant)

*[Signature]*  
Signature of President/General Secretary/Estate Manager  
Ajay Kumar Rana  
9810075536  
14/09/2021  
President  
Secretary  
Estate Manager

Performa for Joint Inspection of RWH system- in Dwarka, New Delhi, in O.A. No. 147/2021 of Hon'ble NGT.

1. Name and address of unit MANAGEMENT APARTMENTS, PLOT NO. 17, SECTOR-5, DWARKA, ND-75
2. Area detail
  - i. Roof top area: 2495 sqm
  - ii. Paved/road/green area (optional):
  - iii. Total Plot area: 7485 sqm
3. Date of inspection: 14.09.2021

(10)

(The status given below is as on inspection date)

S.No	Govt./Pvt Society	RWH system exist or not	Nos. of pit	Size of pit	Status of RWH system, if exist		Adequate Yes/No	Remarks
					No. & size of recharge well	Whether Functional Yes/No		
1.	CGHS	YES	07	49.90 m <sup>3</sup>	—	All RWH Pits are Non-functional	YES	① Paved surface near-off to be segregated and directed to mpt drain. ② Filter media to be replaced. ③ Upgrade the RWH Pit which are buried.

*[Signature]*  
 14/9/21  
 MEMBER  
 DTQC  
 DTB

*[Signature]*  
 14/9/21  
 Inspection team  
 Member 1, DIB

*[Signature]*  
 Inspection team  
 Member 2, DPCC

*[Signature]*  
 Inspection team  
 Member 3, CPCB  
 (abdelant)

*[Signature]*  
 Signature of President/General Secretary/Estate Manager  
 (966723990)  
 SUDHA SINGH  
 (Estate Manager)  
 [Signature]

Performa for Joint Inspection of RWH system- in Dwarka, New Delhi, in O.A. No. 147/2021 of Hon'ble NGT.

1. Name and address of unit: **JAIMAA APARTMENTS, PLOT NO. 16, SECTOR-5, DWARKA, ND-75**
2. Area detail :
  - i. Roof top area : **2500 sqm**
  - ii. Paved/road/green area (optional):
  - iii. Total Plot area: **7500.76 sqm**
3. Date of inspection: **14.09.2021**

11 ✓

(The status given below is as on inspection date)

S.No	Govt./Pvt Society	RWH system exist or not	Status of RWH system, if exist				Remarks	
			Nos. of pit	Size of pit	No. & size of recharge well	Whether Functional Yes/No		Adequate Yes/No
1.	CGHS	YES	02	4.0 x 3.0 x 2.15 m <sup>3</sup> each = 51.680 m <sup>3</sup>	—	Non-functional	YES	Advised to continue ① Paved surface turn-off to be segregated and diverted to mpl. drain. ② Filter media to be replaced.

*[Signature]*  
14/9/21  
Member  
DCC  
DOB

*[Signature]*  
Inspection team  
Member 1, DJB

*[Signature]*  
Inspection team  
Member 2, DPCC

*[Signature]*  
Inspection team  
Member 3, CPCB  
**MAHESH SAXENA**  
(Appellant)

*[Signature]*  
Signature of President/General Secretary/Estate Manager  
**RASHEEL KHATTA**  
14.9.21  
(9868927644)

Performa for Joint Inspection of RWH system- in Dwarka, New Delhi, in O.A. No. 147/2021 of Hon'ble NGT.

1. Name and address of unit : DHAULADHAR APARTMENTS, PLOT NO. 15, SECTOR-5, DWARKA, ND-75

2. Area detail :  
 i. Roof top area :  
 ii. Paved/road/green area (optional):  
 iii. Total Plot area:

12

3. Date of inspection: 14.09.2021 (The status given below is as on inspection date)

S.No	Govt./Pvt Society	RWH system exist or not	Status of RWH system, if exist				Remarks
			Nos. of pit	Size of pit	No. & size of recharge well	Whether Functional Yes/No	
1.	CQHS	YES	02	1 x 5.0 x 1.80 x 2.10 mt 1 x 6.0 x 2.25 x 2.20 mt	2 NOS. as per design	Both Non-functional	YES ① Submersible base well meter to be removed. ② Paved surface run-off to be segregated and directed to rpl drain. ③ Filter media to be replaced. ④ Redevelopment of Recharge well.

14/9/21  
 Member DTQC DDB

Belomi  
 Inspection team Member 1, DJB

Sharma  
 Inspection team Member 2, DPCC

Sunita Parashar  
 Inspection team Member 3, CPGB  
 MAHESH SAXENA (Applicant)

Singh  
 Signature of Resident/General Secretary / Estate Manager  
 (SURJEET SINGH)  
 9811259455

Performa for Joint Inspection of RWH system- in Dwarka, New Delhi, in O.A. No. 147/2021 of Hon'ble NGT.

1. Name and address of unit: PARK ROYAL APARTMENT, PLOT No. 10A, SECTOR -9, DWARKA, ND
2. Area detail :
  - i. Roof top area: 538.524 sqm app.
  - ii. Paved/road/green area (optional):
  - iii. Total Plot area: 3999.456 sqm app.
3. Date of inspection: 16.09.2021

13

" Heavy Rain today since morning"  
(The status given below is as on inspection date)

S.No	Govt/Pvt Society	RWHS system exist or not	Status of RWHS system, if exist					Remarks
			Nos. of pit	Size of pit	No. & size of recharge well	Whether Functional Yes/No	Adequate Yes/No	
1.	CGHS	YES	02	3.0 x 2.0 x 3.0 mtr each Total 36 m <sup>3</sup>	02 Bore-8" dia	YES	YES	① Both Pits filled with rain water. ② Recharge wells to be redeveloped. ③ Openings to be made above recharge wells for easy access. ④ Paved area around it to be regraded and directed to mfd drain. ⑤ Filter media to be replaced.

Govt  
Khatuak  
Member  
DTQC  
JWB  
7357973791

*[Signature]*  
16/09/21  
Inspection team  
Member 1, DJB

*[Signature]*  
Inspection team  
Member 2, DPCC

*[Signature]*  
Inspection team  
Member 3, CPCB  
MATHESH  
SARIN  
(Appellant)

*[Signature]* 16/09/21  
Signature of President/General  
Secretary /Estate Manager  
Sib Appal  
98681 26892  
Secretary.

Performa for Joint Inspection of RWH system- in Dwarka, New Delhi, in O.A. No. 147/2021 of Hon'ble NGT.

1. Name and address of unit: MUNIRKA APARTMENTS, PLOT No. 11, SECTOR-9, DWARKA, ND-77

2. Area detail :
- i. Roof top area : 2500 sqm
  - ii. Paved/road/green area (optional):
  - iii. Total Plot area: 7500 sqm

"Heavy Rain since morning" (14)

3. Date of inspection: 16.09.2021

(The status given below is as on inspection date)

S.No	Govt./Pvt Society	RWH system exist or not	Status of RWH system, if exist				Remarks	
			Nos. of pit	Size of pit	No. & size of recharge well	Whether Functional Yes/No		Adequate Yes/No
1.	CGHS	YES	04	Total Capacity = 50 m <sup>3</sup>	04	YES	YES	① Paved area run-off to be segregated and directed to mpl drain. ② Filter media to be replaced. ③ Recharge borewells to be redeveloped. ④ Routine maintenance to be continued. ⑤ Opening of recharge borewells is required.

Prateek  
(PRATEEK)  
member  
DTQC  
058  
7357973791

Inspection team  
Member 1, DJB

Inspection team  
Member 2, DPCC

Inspection team  
Member 3, CPCB  
MATHESH SAXENA  
(Appellant)

Signature of President/General Secretary /Estate Manager  
Mahendra Singh  
M-9599078753  
16/09/21

Performa for Joint Inspection of RWH system in Dwarka, New Delhi, in O.A. No. 147/2021 of Hon'ble NGT.

1. Name and address of unit **SUKH SAGAR APARTMENT, PLOT NO. 12, SECTOR-9, DWARKA, ND-75** 15
2. Area detail :
  - i. Roof top area : 2730 sqm
  - ii. Paved/road/green area (optional):
  - iii. Total Plot area: 8200 sqm
3. Date of inspection: 16.09.2021

(The status given below is as on inspection date)

S.No	Govt./Pvt Society	RWH system exist or not	Status of RWH system, if exist				Adequate Yes/No	Remarks
			Nos. of pit	Size of pit	No. & size of recharge well	Whether Functional Yes/No		
1.	CGHS	YES	02	Total Capacity = 54.60m <sup>3</sup>	02 No.	NO	YES	① Paved area run-off to be segregated and diverted to Mpl drain. ② Filter media to be replaced. ③ Recharge base wells to be redeveloped. ④ Clear access/opening of recharge wells to be provided. ⑤ Regular maintenance of RWH system to be done.

*Pooja Prakash*  
Member  
DPCC  
05B

*Belam*  
21/09/21  
Inspection team  
Member 1, DJB

*Ajwaj*  
Inspection team  
Member 2, DPCC

*Santhi Parastar*  
Inspection team  
Member 3, CPCB  
*Mohini Saxena*  
(Appellant)

*Sharma*  
Signature of *Sharma*  
Secretary / Estate Manager  
Plot No. 12  
Sector-9 Dwarka  
New Delhi-75  
9810046062  
9310020100  
9015990990

Performa for Joint Inspection of RWH system- in Dwarka, New Delhi, in O.A. No. 147/2021 of Hon'ble NGT.

1. Name and address of unit: KRISHNA APARTMENT, PLOT NO. 13, SECTOR-9, DWARKA, ND-75.

2. Area detail:

- i. Roof top area: 2560 sqm
- ii. Paved/road/green area (optional):
- iii. Total Plot area: 7500 sqm

16

3. Date of inspection: 16.09.2021

(The status given below is as on inspection date)

S.No	Govt./Pvt Society	RWH system exist or not	Status of RWH system, if exist				Remarks	
			Nos. of pit	Size of pit	No. & size of recharge well	Whether Functional Yes/No		Adequate Yes/No
1.	CGHS	YES	02	total capacity = 51.20 m <sup>3</sup>	—	No	YES	① Paved area seems to be segregated and diverted to m/s drain. ② Filter media to be replaced. ③ Regular maintenance of RWH system required.

*Prateek*  
Member  
DTQC  
DJB

*Delam*  
Inspection Team  
Member 1, DJB

*Shivanshu*  
Inspection team  
Member 2, DPCC

*Sunita Parashar*  
Inspection team  
Member 3, CPCB  
MAYESH  
SAXENA  
(Appellant)

*BD Joshi*  
Signature of President/General  
Secretary / Estate Manager  
16/9/21

(BD Joshi)  
President  
9999 113893

Performa for Joint Inspection of RWH system- in Dwarka, New Delhi, in O.A. No. 147/2021 of Hon'ble NGT.

1. Name and address of unit: **RAJNI GANDHA CGHS PVT. LTD, PLOT NO. 4, SECTOR-10, DWARKA, ND-75**  
 e-mail: rajni.gandha.cghs.2017@gmail.com

2. Area detail:  
 i. Roof top area: 1730 sqm  
 ii. Paved/road/green area (optional):  
 iii. Total Plot area: 5500 sqm

(17)

3. Date of inspection: 21.09.2021 (The status given below is as on inspection date)

S.No	Govt./Pvt Society	RWHS system exist or not	Status of RWHS system, if exist					Remarks
			Nos. of pit	Size of pit	No. & size of recharge well	Whether Functional Yes/No	Adequate Yes/No	
1.	CGHS	YES	02	4.0 x 1.50 x 3.50 mtr each Total capacity = 82 m <sup>3</sup> (found checked)	2 No - 3" dia each 50' deep (found checked)	YES	YES	① Paved area run-off to be segregated and directed to MFI drain ② Regular replacement of filter media. ③ Regular redeployment of recharge bore well. ④ Make arrangement of safe access/operating to RWHS.

*Pankaj*  
 Member DTQC DDB

*[Signature]*  
 Inspection team Member 1, DIB

*[Signature]*  
 Inspection team Member 2, DPCC

*[Signature]*  
 Inspection team Member 3, CPCB  
 MAHESH SAXENA (Appellant)

*[Signature]*  
 Signature of President/General Secretary  
 N-98500728

Performa for Joint Inspection of RWH system- in Dwarka, New Delhi, in O.A. No. 147/2021 of Hon'ble NGT.

1. Name and address of unit: **AMBA CGHS PVT LTD, PLOT NO. 5, SECTOR-10, DWARKA, ND-75**
2. Area detail :
  - i. Roof top area: **1833.33 sqm**
  - ii. Paved/road/green area (optional):
  - iii. Total Plot area: **5500 sqm**
3. Date of inspection: **21.09.2021**

(18)

(The status given below is as on inspection date)

S.No	Govt./Pvt Society	RWH system exist or not	Status of RWH system, if exist				Remarks	
			Nos. of pit	Size of pit	No. & size of recharge well	Whether Functional Yes/No		Adequate Yes/No
1.	CGHS	YES	02	Total capacity = 3666 m <sup>3</sup>	02 - 3" dia 12.5' deep each	YES	YES	① Paved area has to be segregated and directed to mpt. drain. ② Recharge bore wells to be capped. ③ Redeployment of recharge well to be done on regular basis. ④ Replacement of filter media to be done regularly.

*Praveen*  
member  
DTQC  
DWB

*21/9/21*  
Inspection team  
Member 1, DIB

*Divya*  
Inspection team  
Member 2, DPCC

*Sunith Parashar*  
Inspection team  
Member 3, CPCB

*Mohini Saxena*  
Signature  
MBA CGHS  
President/General  
Manager  
21.09.21

Performa for Joint Inspection of RWH system- in Dwarka, New Delhi, in O.A. No. 147/2021 of Hon'ble NGT.

1. Name and address of unit: HMM EMPLOYEES CGHS LTD, PLOT NO. 6, SECTOR-10, DWARKA, ND-75
2. Area detail:
  - i. Roof top area: 1833.33 sqm
  - ii. Paved/road/green area (optional):
  - iii. Total Plot area: 5500 sqm
3. Date of inspection: 21.09.2021

19

(The status given below is as on inspection date)

S.No	Govt./Pvt Society	RWH system exist or not	Status of RWH system, if exist				Remarks	
			Nos. of pit	Size of pit	No. & size of recharge well	Whether Functional Yes/No		Adequate Yes/No
1.	CGHS	YES	01	Total Capacity = 36.66 cu m	02 No - 4" dia cast iron 30mt depth.	YES	YES	① Paved area near open to be segregated and diverted to Mpl. drain. ② Recharge bores to be capped. ③ Recharge bore well opening/easy access to take sample to be provided. ④ Recharge bore to be redeveloped & filter media in pit to be replaced on regular basis.

*Pant*  
Member  
DPCC  
DJB

*[Signature]*  
Inspection team  
Member 1, DJB

*[Signature]*  
Inspection team  
Member 2, DPCC

*[Signature]*  
Inspection team  
Member 3, CPCB

*[Signature]*  
Signature of President/General Secretary  
Estate Manager  
21/09/2021  
736950

Performa for Joint Inspection of RWH system- in Dwarka, New Delhi, in O.A. No. 147/2021 of Hon'ble NGT.

1. Name and address of unit: CHANDANWARI APARTMENTS LGHS LTD, PLOT No. 8, PECTOR-10  
DWARKA, ND-75
2. Area detail :
  - i. Roof top area: 3229.50 sqm
  - ii. Paved/road/green area (optional):
  - iii. Total Plot area: 18001 sqm
3. Date of inspection: 21.09.2021

20

(The status given below is as on inspection date)

S.No	Govt./Pvt Society	RWH system exist or not	Status of RWH system, if exist				Remarks
			Nos. of pit	Size of pit	No. & size of recharge well	Whether Functional Yes/No	
1.	CC HS	YES	03	Total capacity = 65 m <sup>3</sup>	—	Recharge well 02-Pit Non-functional 2 01-Pit-Round functional	YES ① Paved area has to be segregated and oriented to right drain. ② Filter media to be replaced. ③ Proper cover on opening to be provided.

*Praveen*  
Member  
DPCB  
WB

*Amal*  
Inspection team  
Member 1, DJB

*Arjun*  
Inspection team  
Member 2, DPCC

*Santhi Parvathi*  
Inspection team  
Member 3, CPCB  
RASHMI SHARMA  
(Applicant)

*13/09/2021*  
Signature of President/General Secretary/Executive Manager  
M 83682900  
New Delhi  
Regd. No. GH

Performa for Joint Inspection of RWH system- in Dwarka, New Delhi, in O.A. No. 147/2021 of Hon'ble NGT.

1. Name and address of unit: **GANDHI AASHRAM CGHS LTD, PLOT No. 9, SECTOR-10, DWARKA, - ND-75**  
(PANCHSEEL)

2. Area detail:  
i. Roof top area: **1874 sqm**  
ii. Paved/road/green area (optional):  
iii. Total Plot area: **5500 sqm**

(21)

3. Date of inspection: **21.09.2021**

(The status given below is as on inspection date)

S.No	Govt./Pvt Society	RWH system exist or not	Status of RWH system, if exist				Remarks	
			Nos. of pit	Size of pit	No. & size of recharge well	Whether Functional Yes/No		Adequate Yes/No
1.	CGHS	YES	02	Total Capacity = 37.84 m <sup>3</sup>	01 - 6" dia 75' deep	YES	YES	① Paved area run-off to be segregated and diverted to mpl drains. ② Filter media to be replaced regularly as per norms. ③ Recharge bore well to be redeveloped at regular basis as per norms



*Pant*  
member  
DTCC  
DJB

*21/09/21*  
Inspection team  
Member 1, DJB

*Shivans*  
Inspection team  
Member 2, DPCC

*Santhi Parashar*  
Inspection team  
Member 3, CPCB  
*Mahesh Saxena (Appellant)*

*Amran* 21/09/2021  
Signature of President/General  
Secretary/Estate Manager  
9718852477  
H/Cdr NK Meediratta

Performa for Joint Inspection of RWH system- in Dwarka, New Delhi, in O.A. No. 147/2021 of Hon'ble NGT.

1. Name and address of unit: SHIV SHAKTI CGHS LTD., PLOT NO. 10, SECTOR-10, DWARKA, ND-75  
 email: 22
2. Area detail :
  - i. Roof top area : 1500 sqm
  - ii. Paved/road/green area (optional):
  - iii. Total Plot area: 5000 sqm
3. Date of inspection: 21.09.2021

(The status given below is as on inspection date)

S.No	Govt./Pvt Society	RWH system exist or not	Status of RWH system, if exist				Remarks	
			Nos. of pit	Size of pit	No. & size of recharge well	Whether Functional Yes/No		Adequate Yes/No
1.	CGHS	YES	02	Total capacity = 30 m <sup>3</sup> 2 X 3.50 X 1.75 X 1.50 = 30.37 m <sup>3</sup>	02 - 6" dia each ① 15'-0" deep ② 50'-0" deep	YES	YES	① Paved area run-off to be segregated and directed to mpt drain. ② Filter media of P/H to be replaced as per norms. ③ Recharge bore well to be redeveloped regularly as per norms. ④ Recharge bore well to be capped.

*Paunt*  
member  
DTQC  
DWB

*[Signature]*  
Inspection team  
Member 1, DJB

*[Signature]*  
Inspection team  
Member 2, DPCC

*[Signature]*  
Inspection team  
Member 3, CPCB  
*MATHEW SAKENA*  
(Appellant)

*[Signature]*  
Signature of President/General  
Secretary /Estate Manager  
Jayant Kumar  
96544259778

Performa for Joint Inspection of RWH system- in Dwarka, New Delhi, in O.A: No. 147/2021 of Hon'ble NGT.

1. Name and address of unit : CHITRAKOOT DHAM, PLOT NO. 2, SECTOR-19, DWARKA, ND-75

2. Area detail :

i. Roof top area : 2000 sqm

ii. Paved/road/green area (optional):

iii. Total Plot area: 6000 sqm

DJB design No : 1020/06.07.17.

23

3. Date of inspection: 24, 09, 2021

(The status given below is as on inspection date)

S.No	Govt./Pvt Society	RWH system exist or not	Status of RWH system, if exist					Remarks
			Nos. of pit	Size of pit	No. & size of recharge well	Whether Functional Yes/No	Adequate Yes/No	
1.	CGHS	YES	01	4.5 mt dia & 3.0mt deep RWH capacity = 43.33m <sup>3</sup>	01 - 150 mm dia	NON FUNCTIONAL	YES	<ul style="list-style-type: none"> <li>① Paved area to be segregated and diverted to mpt. drain.</li> <li>② Recharge box well to be redeveloped.</li> <li>③ Filter media of RWH pit to be replaced.</li> <li>④ RWH pit filled with cement &amp; smelly foul standing water needs to be removed/change.</li> <li>⑤ Recharge well to be capped.</li> </ul>

*(Signature)*

Inspection team  
Member 1, DTQC,

*(Signature)*

Inspection team  
Member 2, DJB

*(Signature)*

Inspection team  
Member 3, DPCC

RAVI KUMAR  
8010254553

*(Signature)*

Inspection team  
Member 4, CPCB

*(Signature)*

Inspection team  
Member 5,  
(Mahesh Chandra Saxena)

*(Signature)*

Signature of President/General  
Secretary /Estate Manager

MAHESH SAXENA  
7818467888

Performa for Joint Inspection of RWH system- in Dwarka, New Delhi, in O.A. No. 147/2021 of Hon'ble NGT.

1. Name and address of unit : THE DELHI STATE N.E.F. CGHS LTD.  
 PLOT No.1, SECTOR-19, DWARKA, ND-75

2. Area detail :  
 i. Roof top area: 2483 sqm  
 ii. Paved/road/green area (optional):  
 iii. Total Plot area: 7525 sqm

DJB clmgn 669/26.08.2016


24


3. Date of inspection: 24.09.2021


(The status given below is as on inspection date)


S.No	Govt./Pvt Society	RWH system exist or not	Status of RWH system, if exist				Remarks	
			Nos. of pit	Size of pit	No. & size of recharge well	Whether Functional Yes/No		Adequate Yes/No
1.	CAHS	YES	01	5.0 mt dia & 5.0 mt depth	01 - 6" dia 90'-0" deep	NON FUNCTIONAL	YES	(i) Paved area to be neglected and diverted to M/s drainage. (ii) Recharge well/bore to be capped. (iii) Filter media to be replaced in RWH Pit (iv) Recharge bore well to be redeveloped.


  
 Inspection team  
 Member 1, DTQC

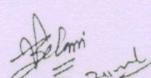  
 Inspection team  
 Member 2, DJB

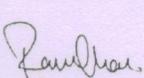  
 Inspection team  
 Member 3, DPCC  
 RAJ KUMAR  
 8010254553

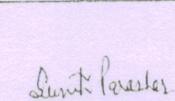  
 Inspection team  
 Member 4, CPCB

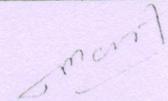  
 Inspection team  
 Member 4,  
 (Mahesh Chandra Saxena)

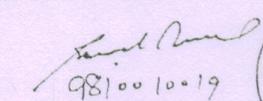  
 Signature of President/General  
 Secretary /Estate Manager  
 Somesh Palwal

9810010019  


Performa for Joint Inspection of RWH system- in Dwarka, New Delhi, in O.A. No. 147/2021 of Hon'ble NGT.

1. Name and address of unit: MOHINDER APARTMENTS, PLOT No. 17, SECTOR-12, DWARKA, ND-75  
(THE DHAN PUTHOWAR CGHS LTD)
2. Area detail :
  - i. Roof top area: 1075.12 sqm
  - ii. Paved/road/green area (optional):
  - iii. Total Plot area: 5000 sqm
3. Date of inspection: 24.09.2021

tdp@cgmail.com  
TDP@CGHS@gmail.com

(25)  
✓

(The status given below is as on inspection date)

S.No	Govt./Pvt Society	RWH system exist or not	Status of RWH system, if exist				Remarks
			Nos. of pit	Size of pit	No. & size of recharge well	Whether Functional Yes/No	
1.	CGHS	YES	01 04	3.50 X 1.70 X 1.50		NON FUNCTIONAL	<ul style="list-style-type: none"> <li>(a) Stained area runoffs to be segregated and diverted to Impl. drain.</li> <li>(b) Recharge base well to be redeveloped.</li> <li>(c) RWH Pitts - Filter media to be replaced.</li> <li>(d) Recharge base wells to be capped.</li> </ul>

*Ravi*  
Member  
DTQC  
DWB

*Abhinav*  
Inspection team  
Member 1, DJB

*Ravi Kumar*  
Inspection team  
Member 2, DPCC  
RAVI KUMAR  
8010254553

*Sunita Parashar*  
Inspection team  
Member 3, CPCB  
*Mahesh Saxena*  
(Appellant)

*Imran*  
Signature of President/General  
Secretary /Estate Manager

Performa for Joint Inspection of RWH system- in Dwarka, New Delhi, in O.A. No. 147/2021 of Hon'ble NGT.

1. Name and address of unit THE KUNJ VIHAR CGHS LTD, PLOT NO 19, SECTOR-12, DWARKA, ND-75
2. Area detail:
  - i. Roof top area: 4658 sqm
  - ii. Paved/road/green area (optional):
  - iii. Total Plot area: 12975 sqm
3. Date of inspection: 24.09.2021 (The status given below is as on inspection date)

26

S.No	Govt./Pvt Society	RWH system exist or not	Status of RWH system, if exist					Remarks
			Nos. of pit	Size of pit	No. & size of recharge well	Whether Functional Yes/No	Adequate Yes/No	
1.	CGHS	YES	2 Site 52	3mm dia x 3 feet depth 3.0 x 4.0 x 2.5m x 240 P.H.	06 - 150 mm dia 75 feet deep each	NON FUNCTIONAL		<ul style="list-style-type: none"> <li>1. Ground water level to be rechecked and it linked to plot drains.</li> <li>2. If the existing recharge pits are replaced with recharge pits.</li> <li>3. If the pits are filled with structural build quality debris water.</li> <li>4. Recharge pits will have to be redeveloped.</li> </ul>

*Paul*  
member  
DPC  
DJB

*[Signature]*  
Inspection team  
Member 1, DJB

*Paul*  
Inspection team  
Member 2, DPCC

*[Signature]*  
Inspection team  
Member 3, CPCB  
*MANISH JAIN*  
(Appellant)

9521011106  
*[Signature]*  
Signature of President/General  
Secretary/Estate Manager  
DJB

Performa for Joint Inspection of RWH system- in Dwarka, New Delhi, in O.A. No. 147/2021 of Hon'ble NGT.

1. Name and address of unit: SANT SUNDER DASS JI CGHS, PLOT No. 21, SECTOR-12, DWARKA, ND-75
2. Area detail :
  - i. Roof top area: 2000 Sqm
  - ii. Paved/road/green area (optional): (27)
  - iii. Total Plot area: 6000 Sqm
3. Date of inspection: 24.09.2021 (The status given below is as on inspection date)

S.No	Govt./Pvt Society	RWH system exist or not	Status of RWH system, if exist					Remarks
			Nos. of pit	Size of pit	No. & size of recharge well	Whether Functional Yes/No	Adequate Yes/No	
1.	CGHS	YES	02	5.00 x 2.0 x 2.5 mt Total Capacity = 50 m <sup>3</sup>	—	YES	YES	1) Paved area runoff to be segregated and directed to impl. drains. 2) Waste outflow of boiler need to be disconnected from RWH system immediately. 3) Filter media in 2 nos pits to be replaced periodically. 4) Drains to be separated/only roof top Rain water runoff to be recharged.  Sant Sunder Dass Ji C.G.H.S. Ltd Plot No. 21, Sector-12, Dwarka New Delhi-110078

*Pawar*  
Member  
D-CC  
073

*Sharma*  
Inspection team  
Member 1, DJB

*Kaulhan*  
Inspection team  
Member 2, DPCC

*Swish Parashar*  
Inspection team  
Member 3, CPCB  
*MADAN MOHAN*  
(Applicant)

*MADAN MOHAN*  
Signature of President/General  
Secretary /Estate Manager  
MADAN MOHAN  
Caretaker

Performa for Joint Inspection of RWH system- in Dwarka, New Delhi, in O.A. No. 147/2021 of Hon'ble NGT.

1. Name and address of unit : BELUR HEIGHTS , PLOT NO. 1 , SECTOR - 18A , DWARKA , ND - 75

2. Area detail :

i. Roof top area :

ii. Paved/road/green area (optional):

iii. Total Plot area:

28

3. Date of inspection: 28.09.2021

(The status given below is as on inspection date)

S.No	Govt./Pvt Society	RWH system exist or not	Status of RWH system, if exist				Remarks
			Nos. of pit	Size of pit	No. & size of recharge well	Whether Functional Yes/No	
1.	CGHS	YES	01		01 - 6" dia 90" deep	NON FUNCTIONAL	<p>① Paved area run-off to be segregated and diverted to apt. drain.</p> <p>② RWH pit filled with stagnated dirty water.</p> <p>③ Filter media of RWH pit to be replaced.</p> <p>④ Recharge bore well to be redeveloped.</p>

*Signature*  
DTQC  
DJ8

*Signature*  
28.09.21  
Inspection team  
Member 1, DJB

*Signature*  
Inspection team  
Member 2, DPCC  
RAVI KUMAR  
8010254553

*Signature*  
Inspection team  
Member 3, CPGB

*Signature*  
MAHESH  
SAXENA  
(Applicant)

Signature of President/General  
Secretary /Estate Manager

Performa for Joint Inspection of RWH system- in Dwarka, New Delhi, in O.A. No. 147/2021 of Hon'ble NGT.

1. Name and address of unit: HAM DAM CGHS LTD, PLOT NO. 7, SECTOR-18A, DWARKA, ND-75
2. Area detail :
  - i. Roof top area: 1916 sqm
  - ii. Paved/road/green area (optional):
  - iii. Total Plot area: 7600 sqm
3. Date of inspection: 28.09.2021

[ Design of Raw water Harvesting from Ministry of Water Resources ] ✓ (29)

(The status given below is as on inspection date)

S.No	Govt./Pvt Society	RWH system exist or not	Status of RWH system, if exist					Remarks
			Nos. of pit	Size of pit	No. & size of recharge well	Whether Functional Yes/No	Adequate Yes/No	
1.	CGHS	YES	04	3.50 X 1.50 X 2.70 each	—	YES	YES	① Paved area run-off to be segregated and directed to impl. drain. ② Media of RWH Pits to be replaced as per mensural-regular interval. ③ Provide easy access to opening/cover of RWH Pit. ④ Only Roof Top Rain water run-off to be directed into RWH pits.

Poulet  
DTQC  
DJB

[Signature]  
28/09/21  
Inspection team  
Member 1, DJB


[Signature]  
Inspection team  
Member 2, DPCC

[Signature]  
Inspection team  
Member 3, CPCB

[Signature]  
MAMESH  
SAXENA  
(Applicant)

[Signature]  
Signature of President/General Secretary/Estate Manager

GANESH KUMAR  
Manager

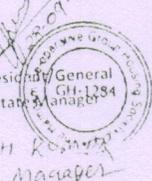

Performa for Joint Inspection of RWH system- in Dwarka, New Delhi, in O.A. No. 147/2021 of Hon'ble NGT.

1. Name and address of unit: DHARAM CGHS LTD, PLOT No. 18, SECTOR-18A, DWARKA, ND-75  
 e-mail: dharamcghs@gmail.com
2. Area detail:  
 i. Roof top area: 1167.67 sqm  
 ii. Paved/road/green area (optional):  
 iii. Total Plot area: 3500.37 sqm
3. Date of inspection: 28.09.2021 (The status given below is as on inspection date)

✓ (30)

S.No	Govt./Pvt Society	RWTH system exist or not	Status of RWTH system, if exist				Remarks	
			Nos. of pit	Size of pit	No. & size of recharge well	Whether Functional Yes/No		Adequate Yes/No
1.	CGHS	YES	01	could not measured due to stagnated water in RWH Pit.	01 - 4" dia	NON FUNCTIONAL	Not available	① Paved area run-off to be segregated and diverted to mpt. drain. ② RWH Pit filled with stagnated dirty foul water. ③ Recharge well to be redeveloped. ④ Filter media of RWH Pit to be replaced. ⑤ Size of Pit could not measured due to stagnated water.

All related documents shall be mailed by society at rainwater@vsnl.com

*Paute*  
DTQC  
DJ8

*[Signature]*  
Inspection team  
Member 1, DJB

*[Signature]*  
Inspection team  
Member 2, DPCC

*[Signature]*  
Inspection team  
Member 3, CPCB

*[Signature]*  
MAHESH SAXENA  
(Applicant)

*[Signature]*  
Signature of President/General Secretary / Estate Manager  
Arum Kumar  
8130650844



Performa for Joint Inspection of RWH system- in Dwarka, New Delhi, in O.A. No. 147/2021 of Hon'ble NGT.

1. Name and address of unit : KRISHNA RESIDENCY VIJAY CGHS LTD, PLOT No. 17, SECTOR-18A, DWARKA, ND-78
2. Area detail :
  - i. Roof top area : 1500 sqm
  - ii. Paved/road/green area (optional):
  - iii. Total Plot area: 4500 sqm
3. Date of inspection: 28.09.2021

34

(The status given below is as on inspection date)

S.No	Govt./Pvt Society	RWH system exist or not	Status of RWH system, if exist				Remarks	
			Nos. of pit	Size of pit	No. & size of recharge well	Whether Functional Yes/No		Adequate Yes/No
1.	CGHS	YES	01	6.0 X 2.0 X 2.50 m <sup>3</sup>	—	YES	YES	① Paved area run-off to be segregated and diverted to mpt drain. ② Filter media of RWH Pt to be replaced at regular interval as per norms.

*Paunt*  
DTQC  
DJB

*[Signature]*  
28/09/21  
Inspection team  
Member 1, DJB

*[Signature]*  
Inspection team  
Member 2, DPCC


*[Signature]*  
Inspection team  
Member 3, CPCEB

*[Signature]*  
MAYESH SAXENA  
(Appellant)


*[Signature]*  
28/9/21  
Signature of President/General  
Secretary / Estate Manager  
DIP RAO  
8700914252




4/10/20

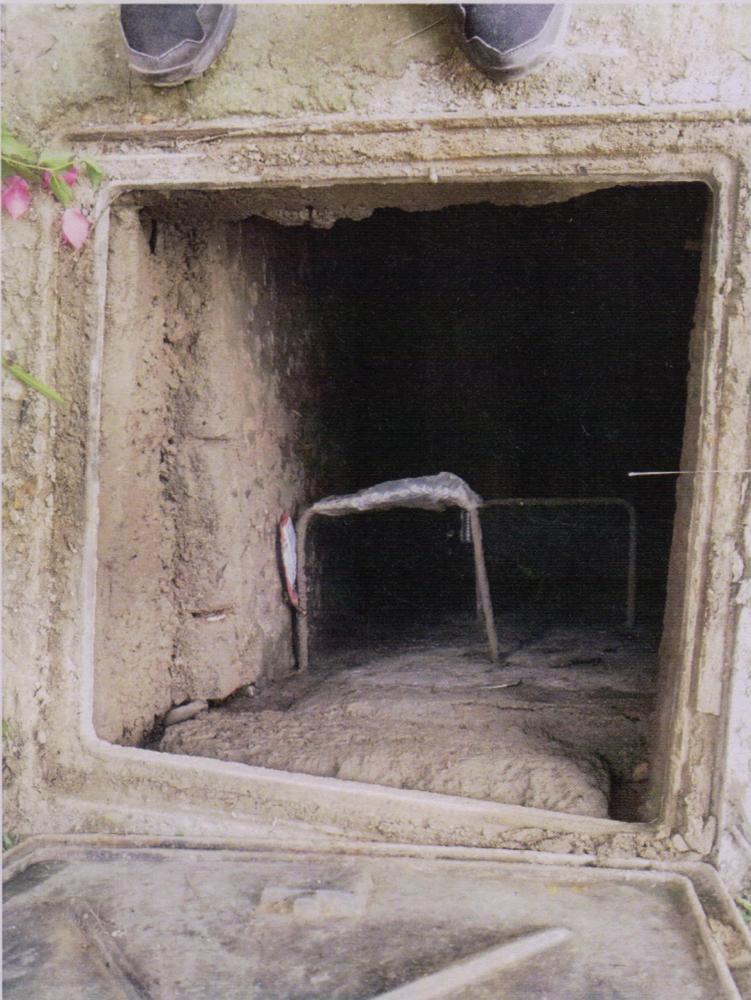


40/c

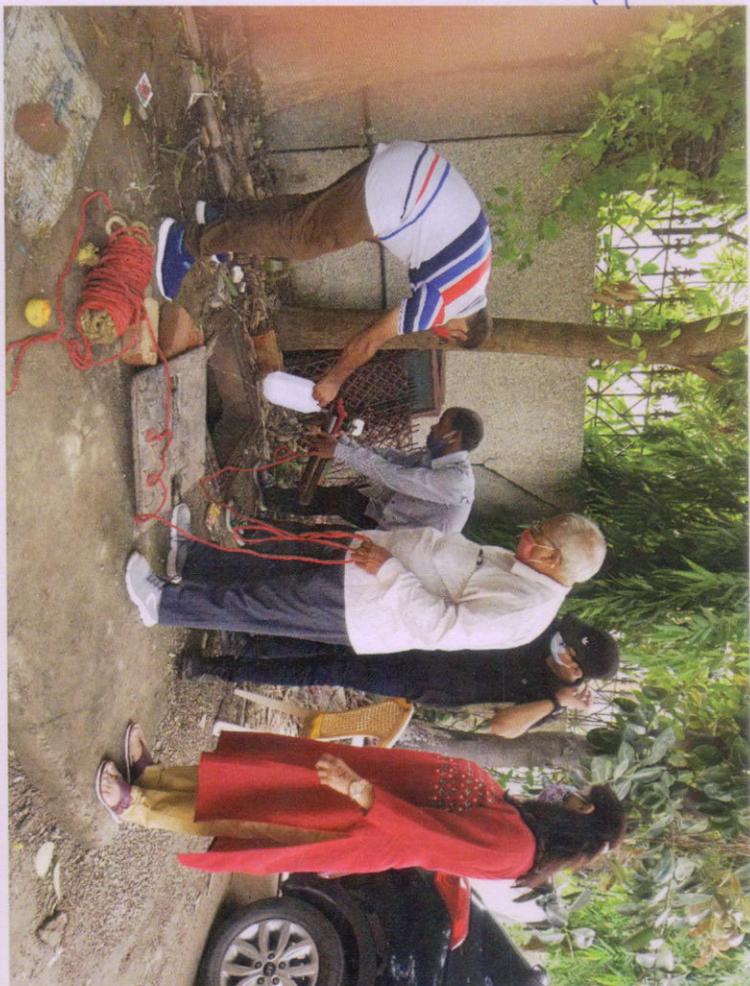





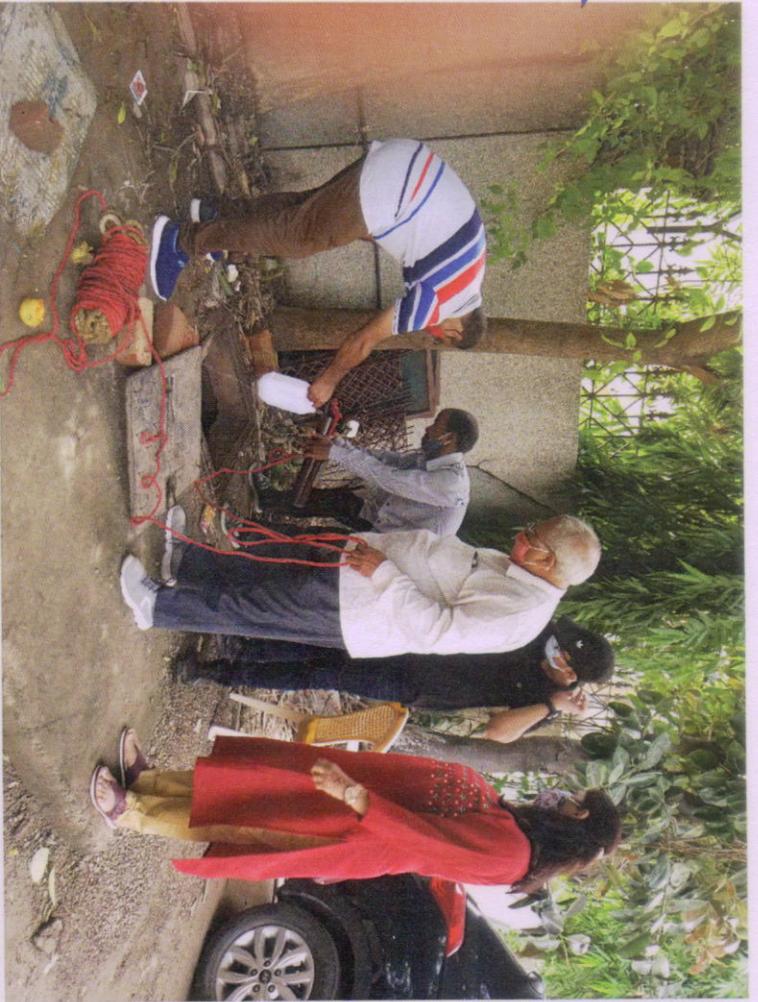




32A 44.

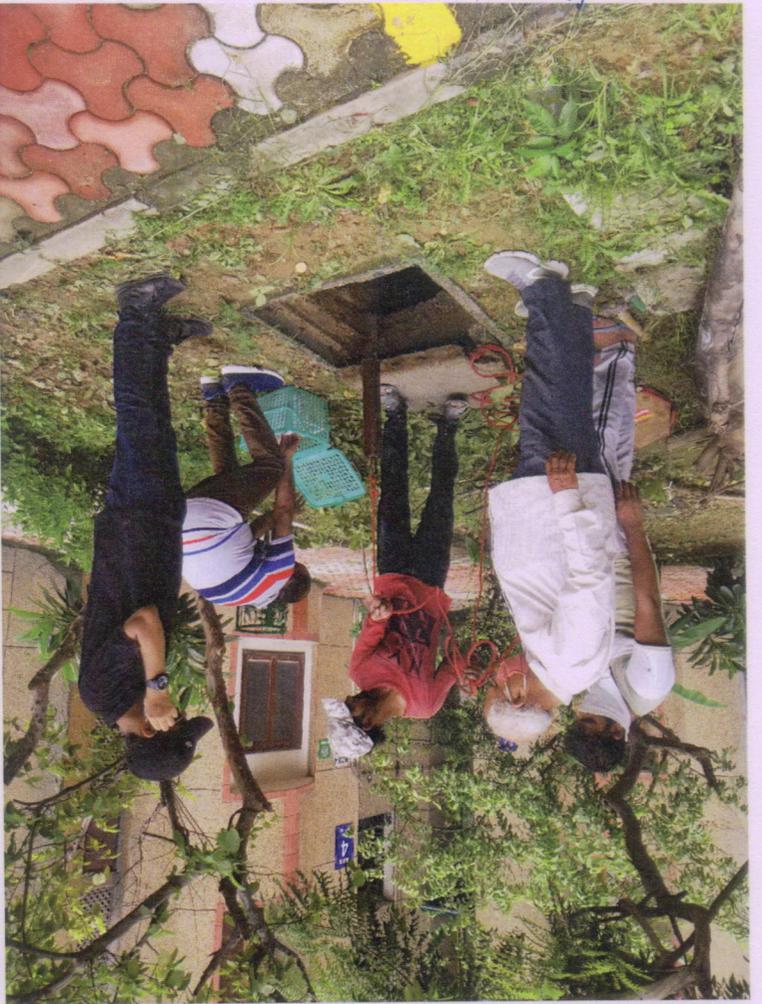


26/45

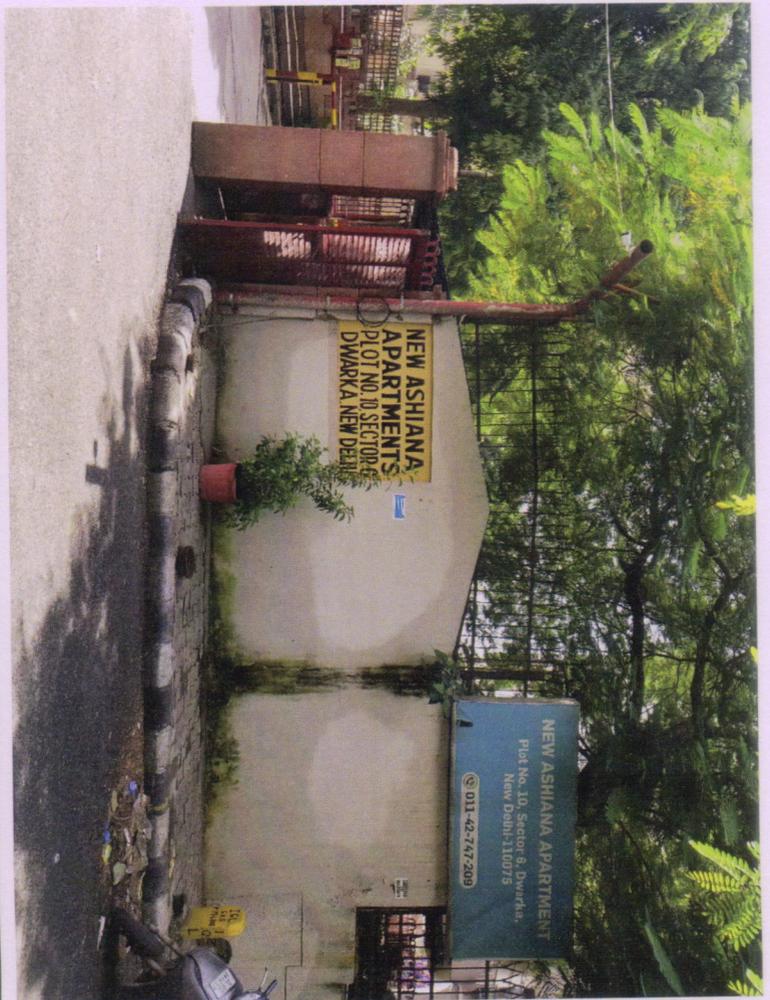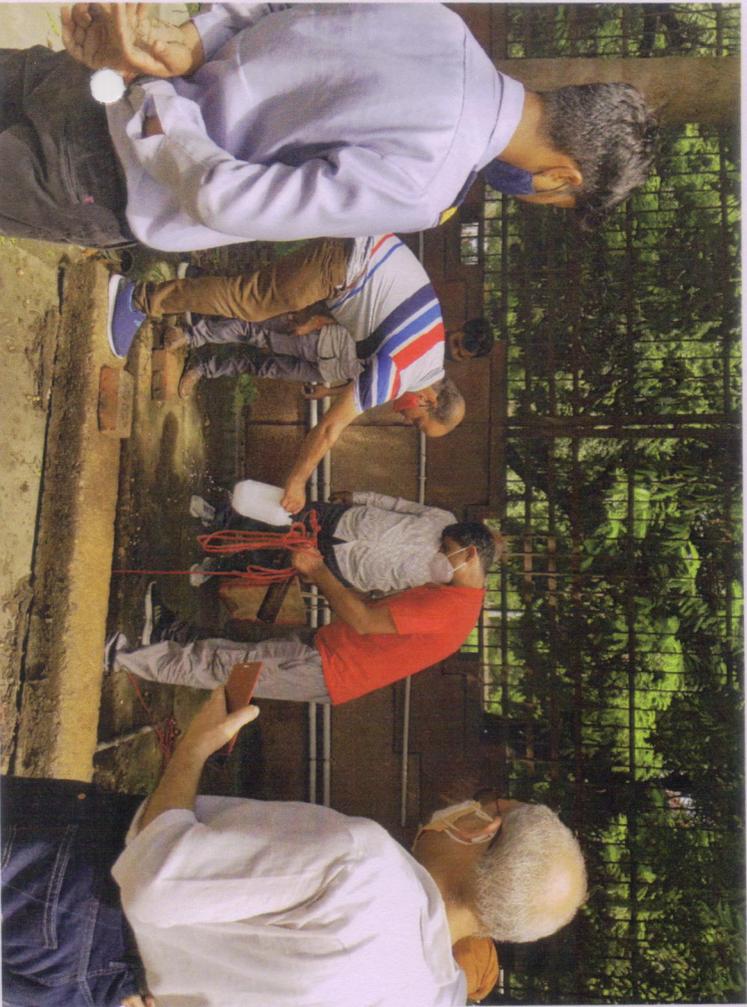

46

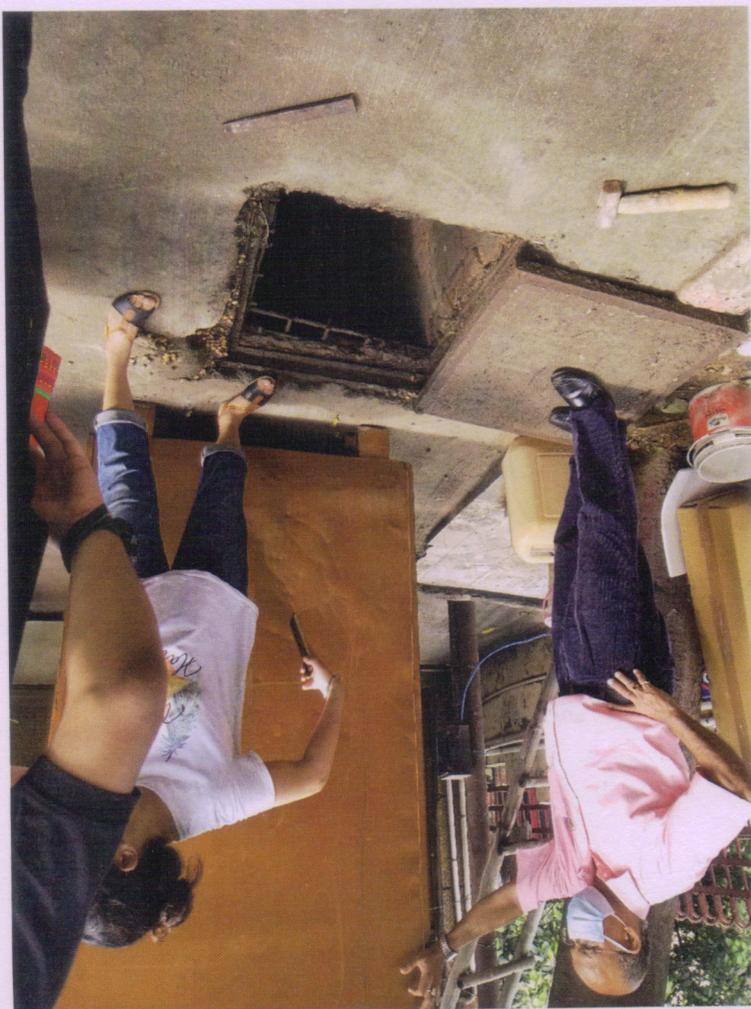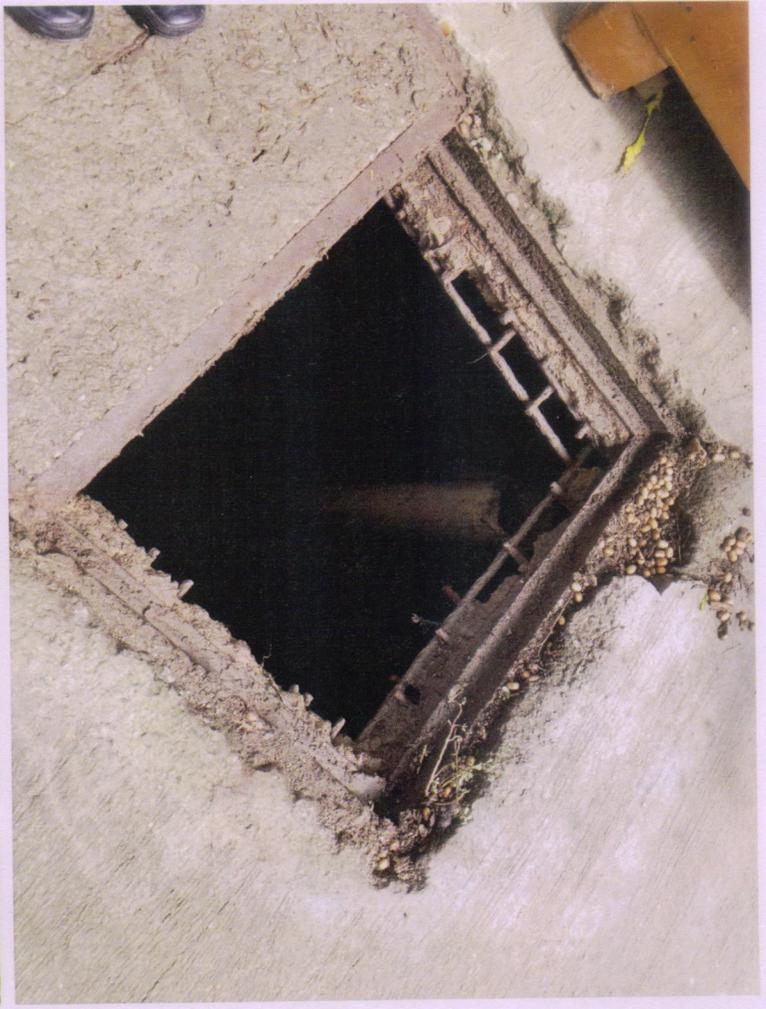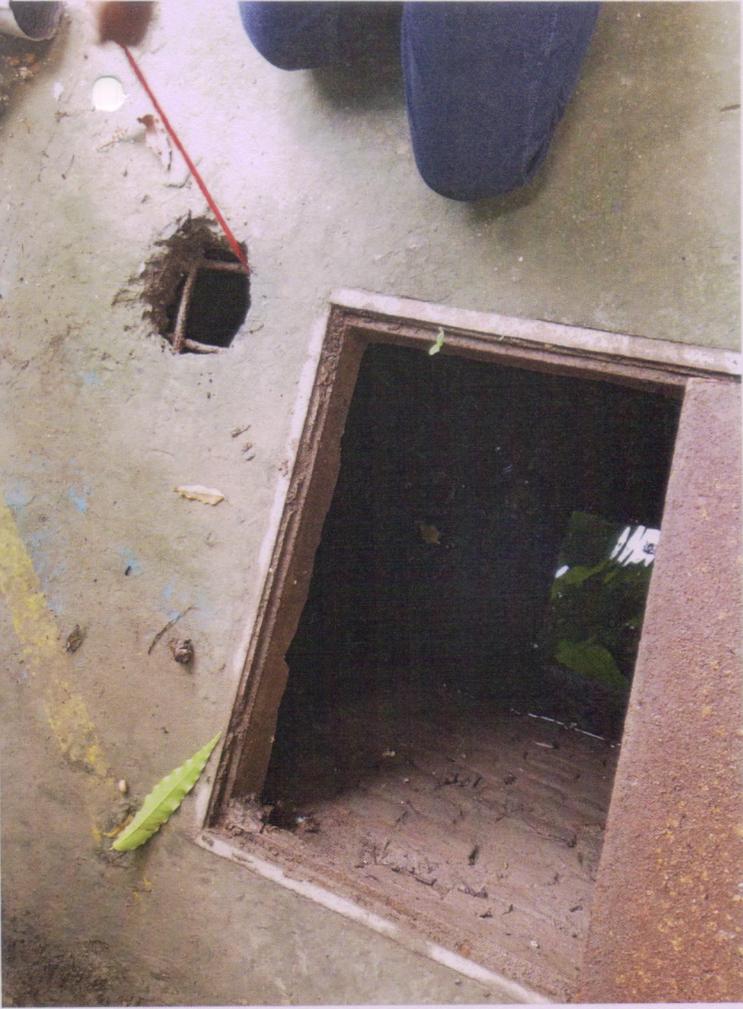

21/5/20



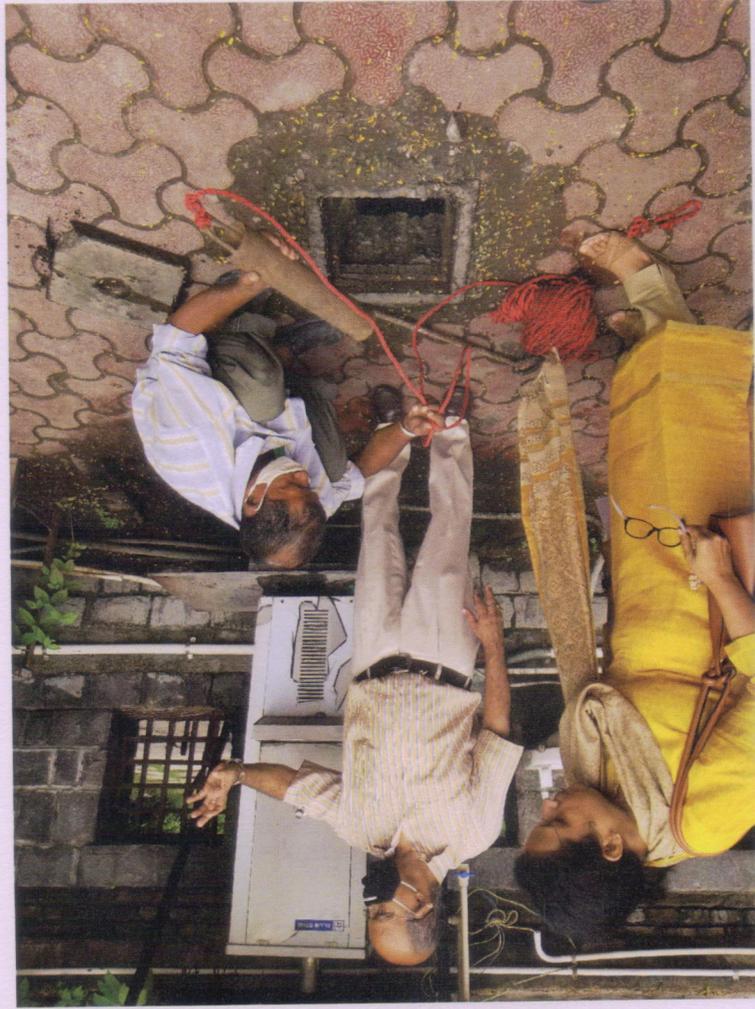


28/4/18









37/50

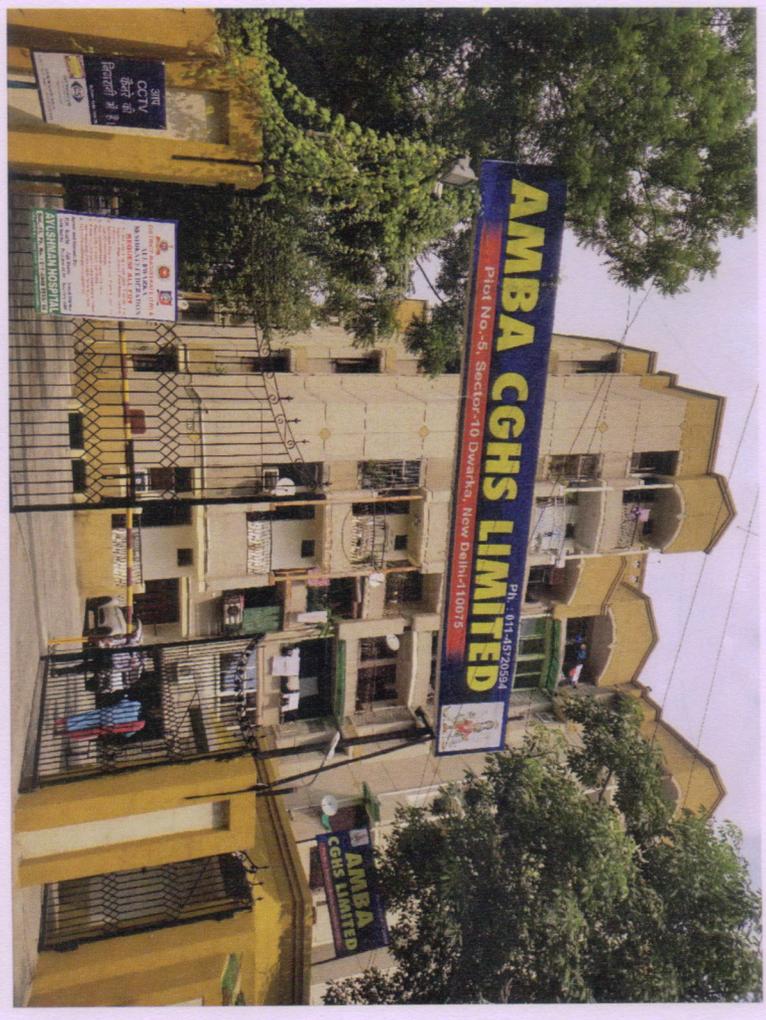
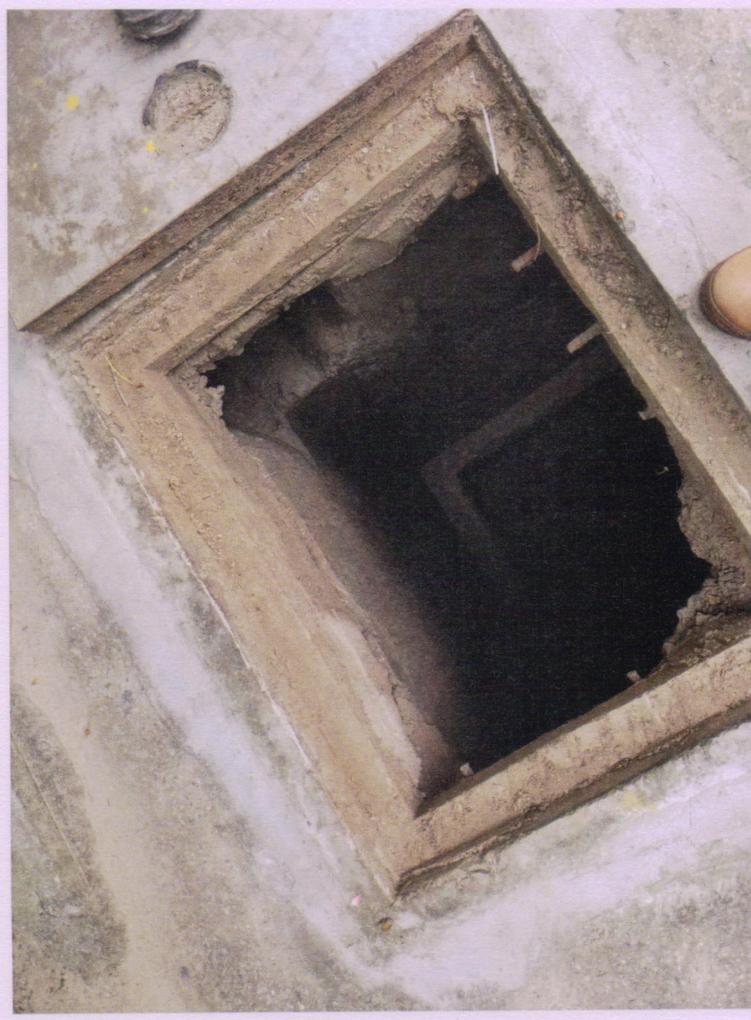
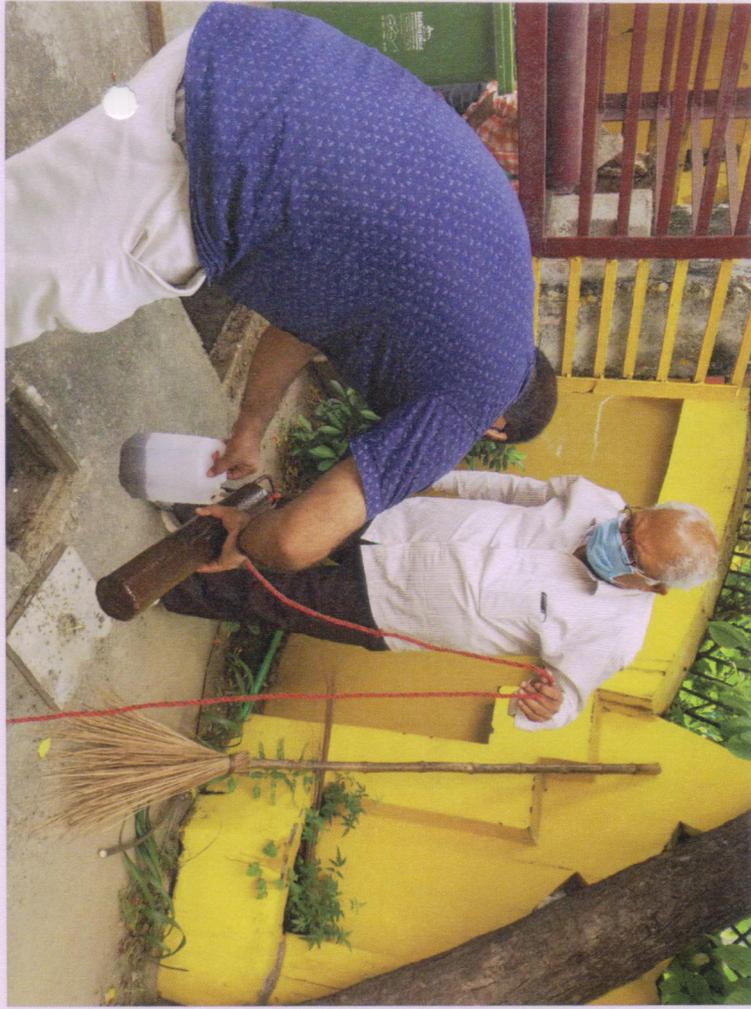


51


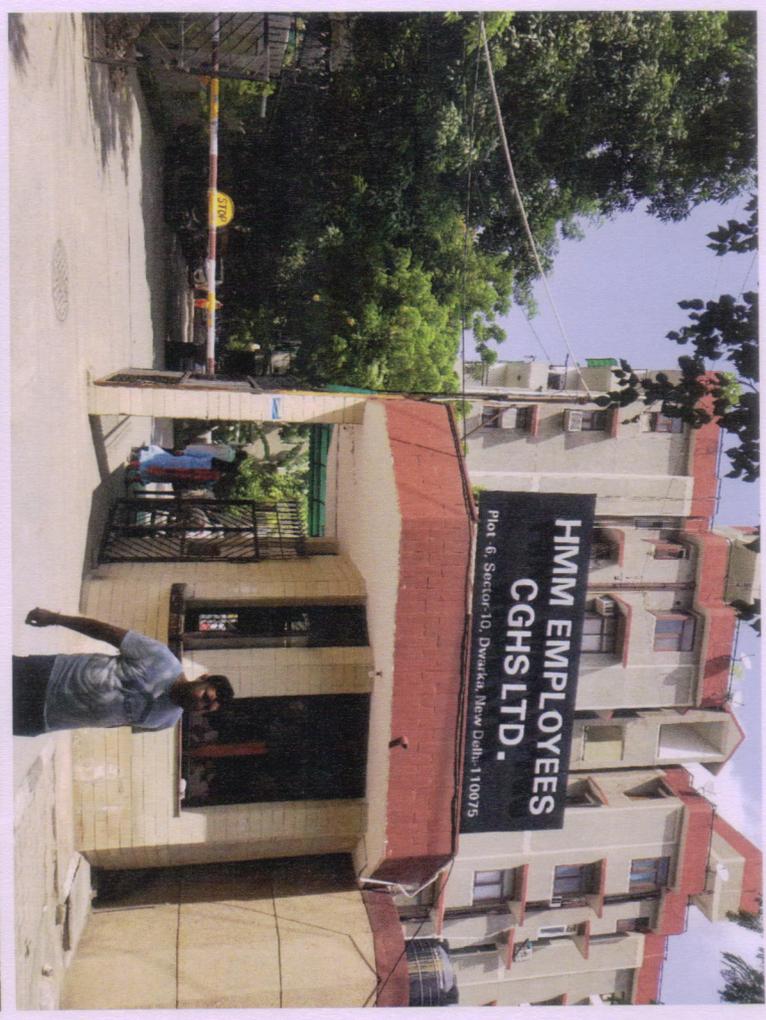
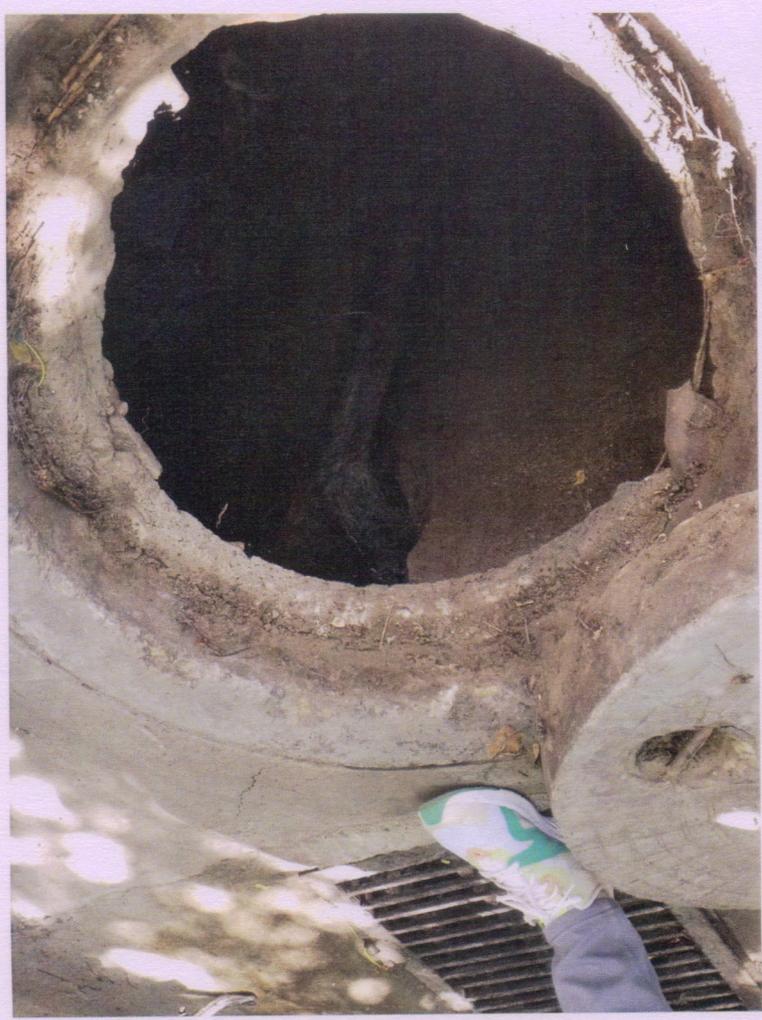



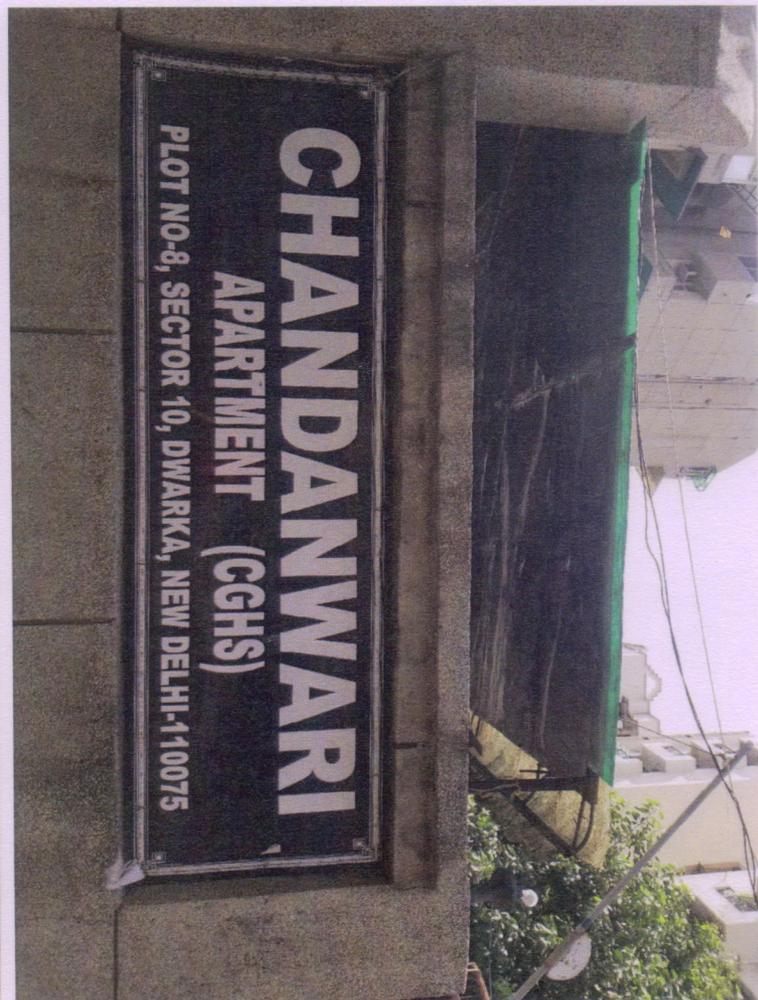
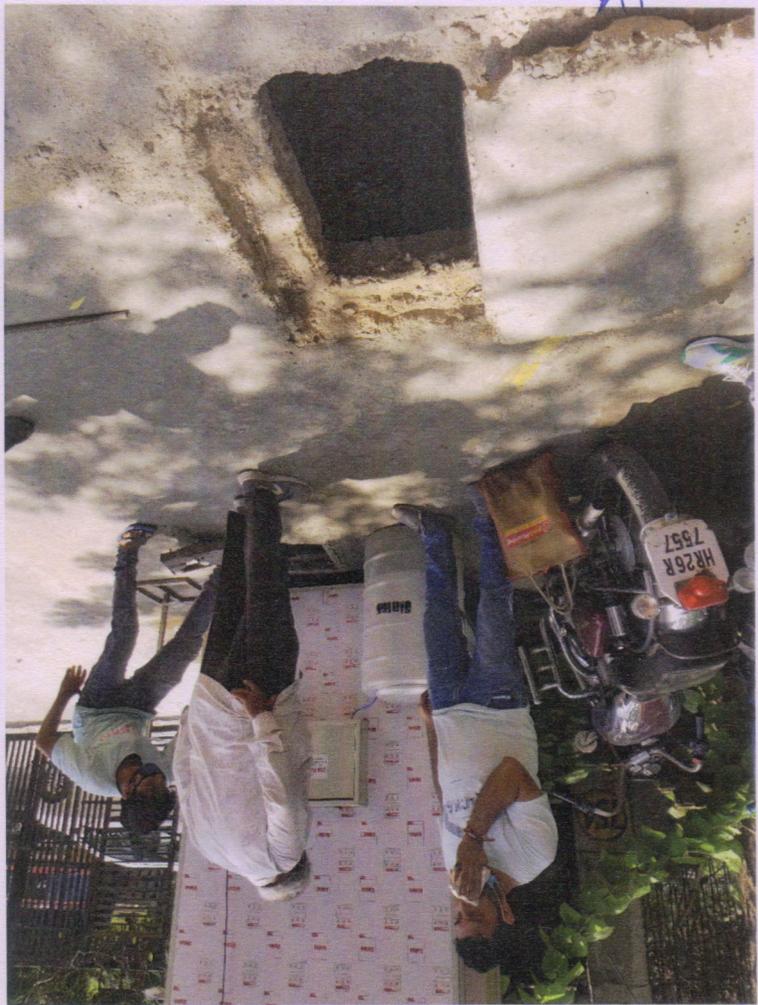


296 53

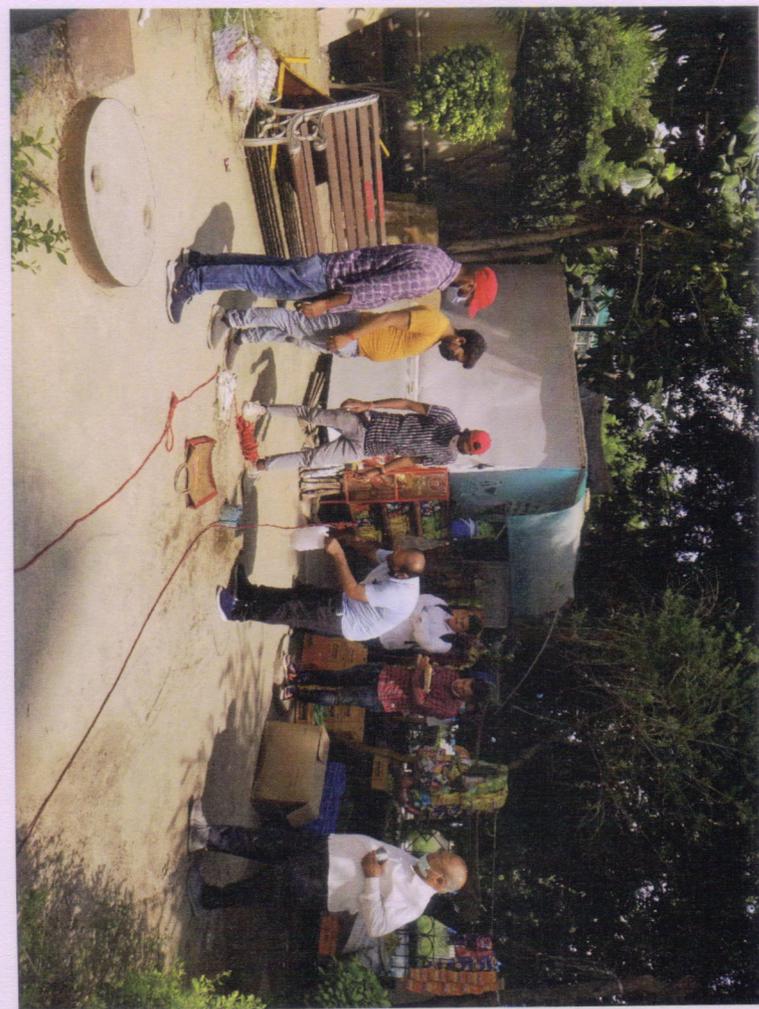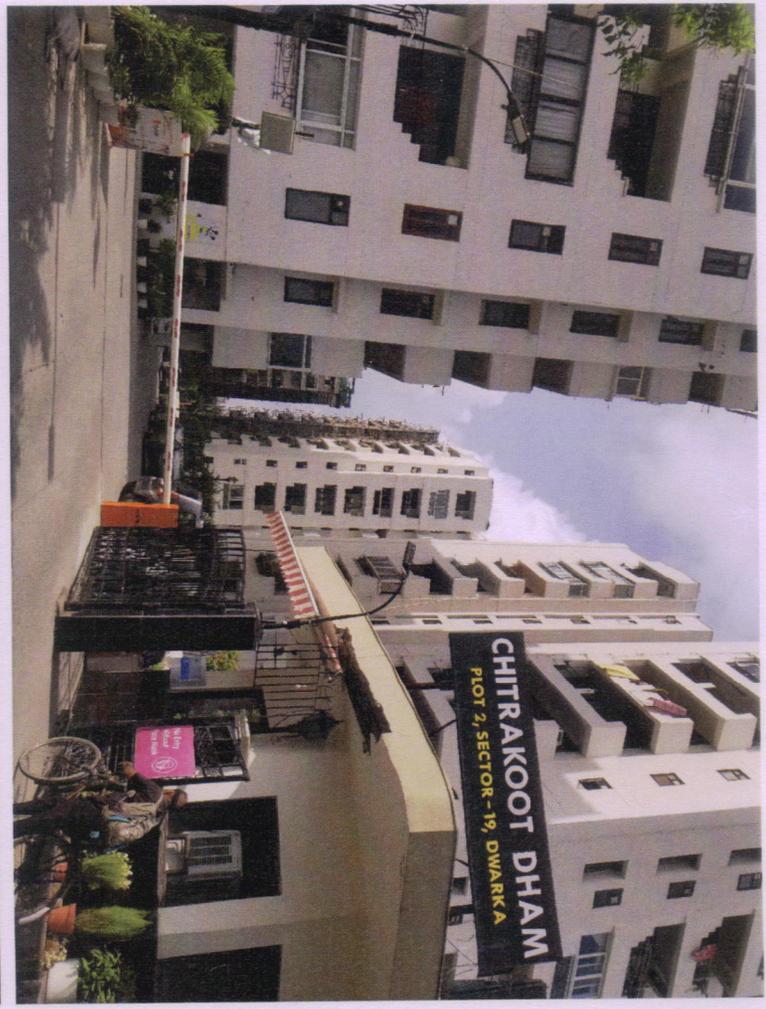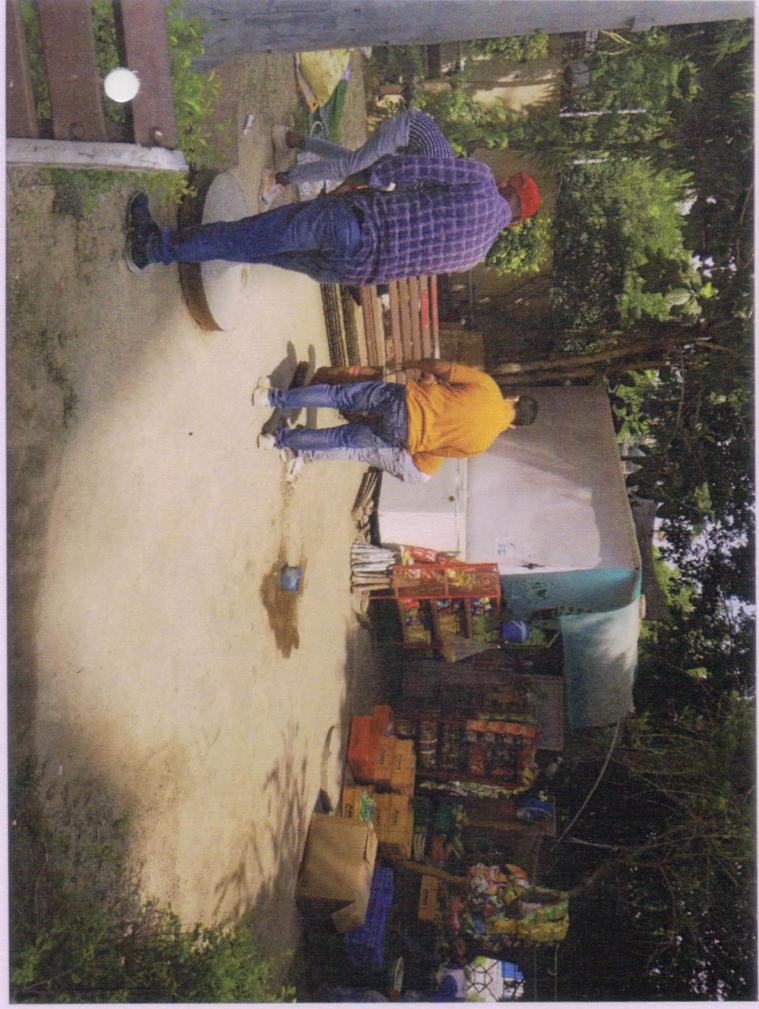




25/5/2024

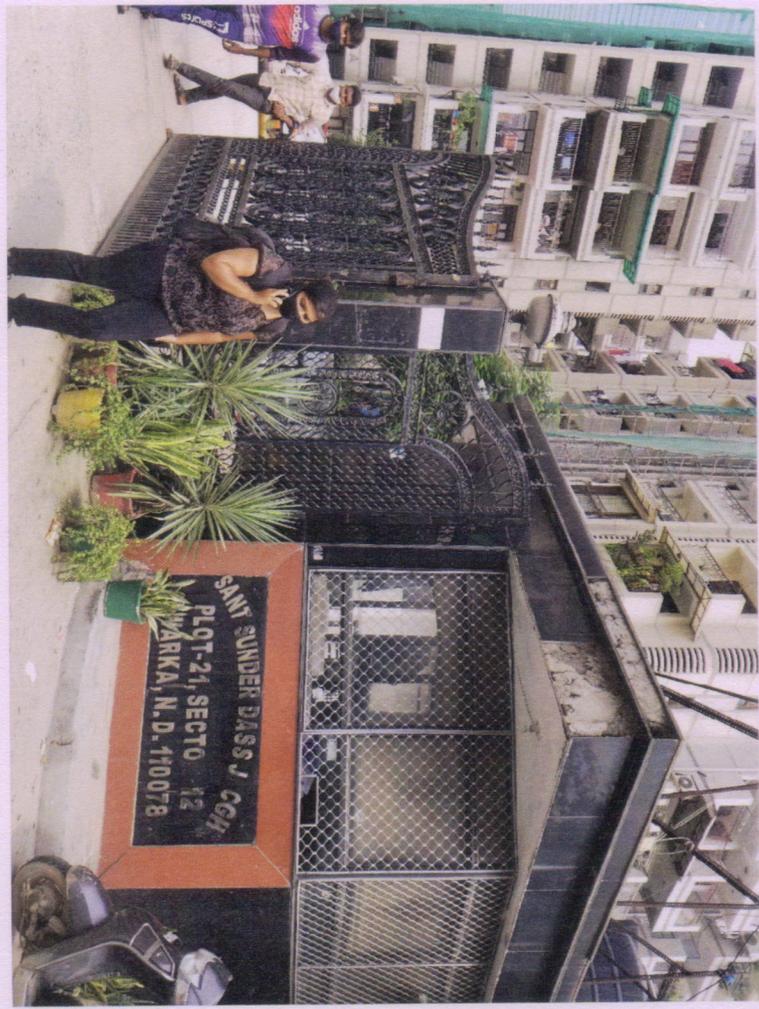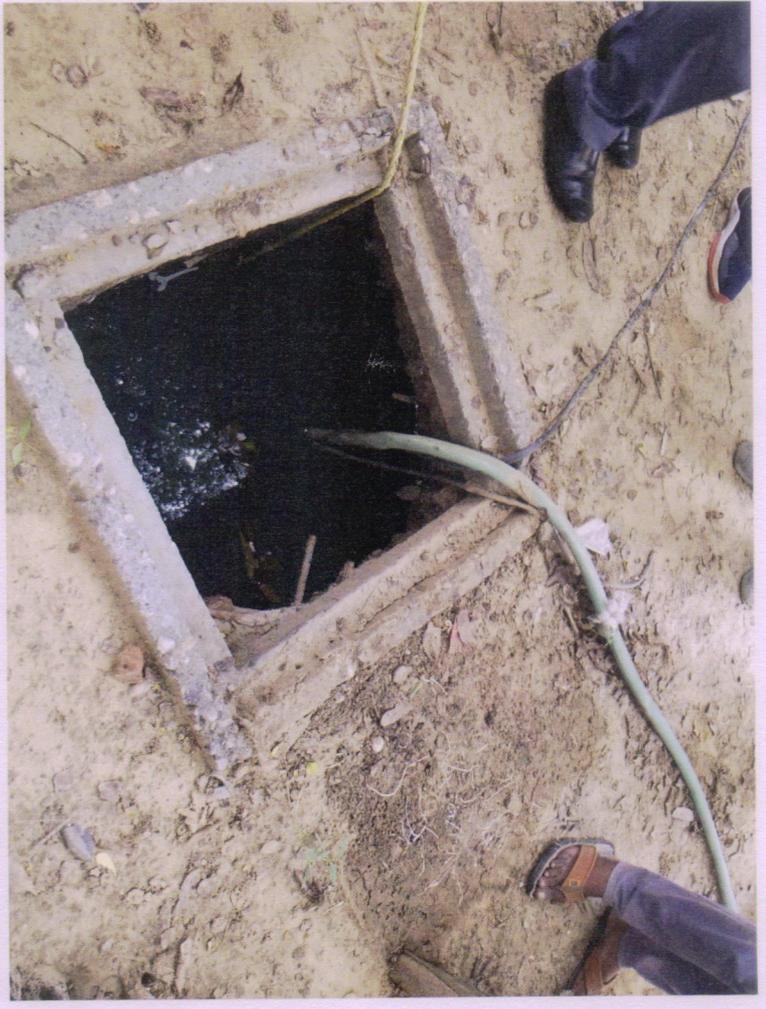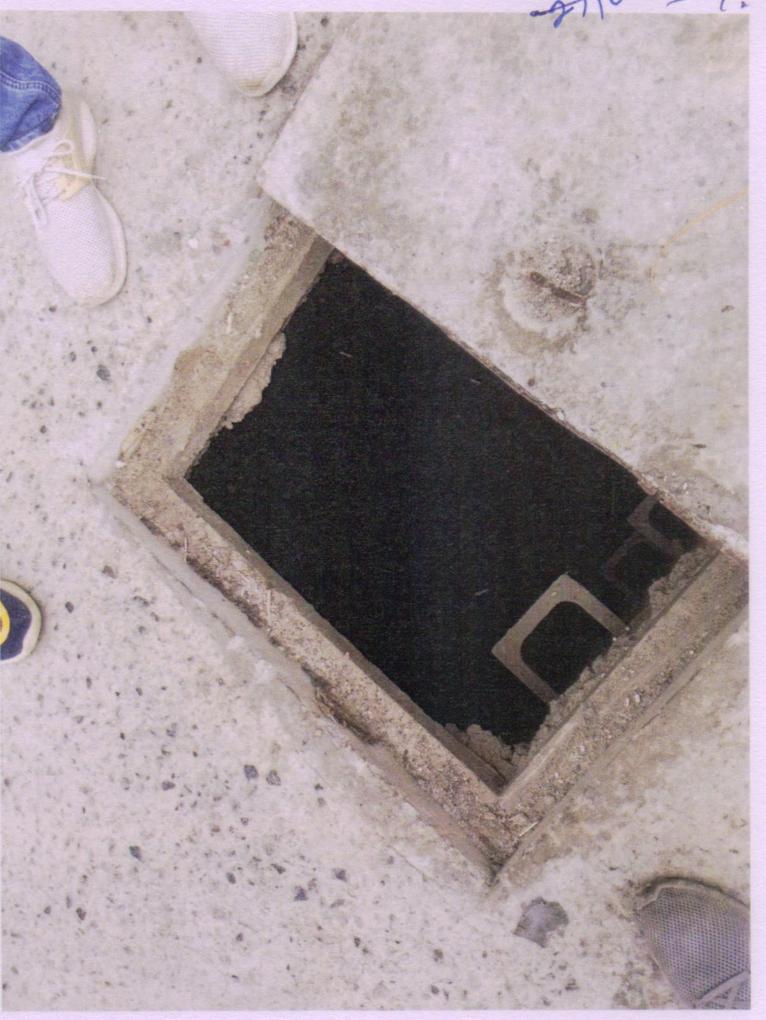


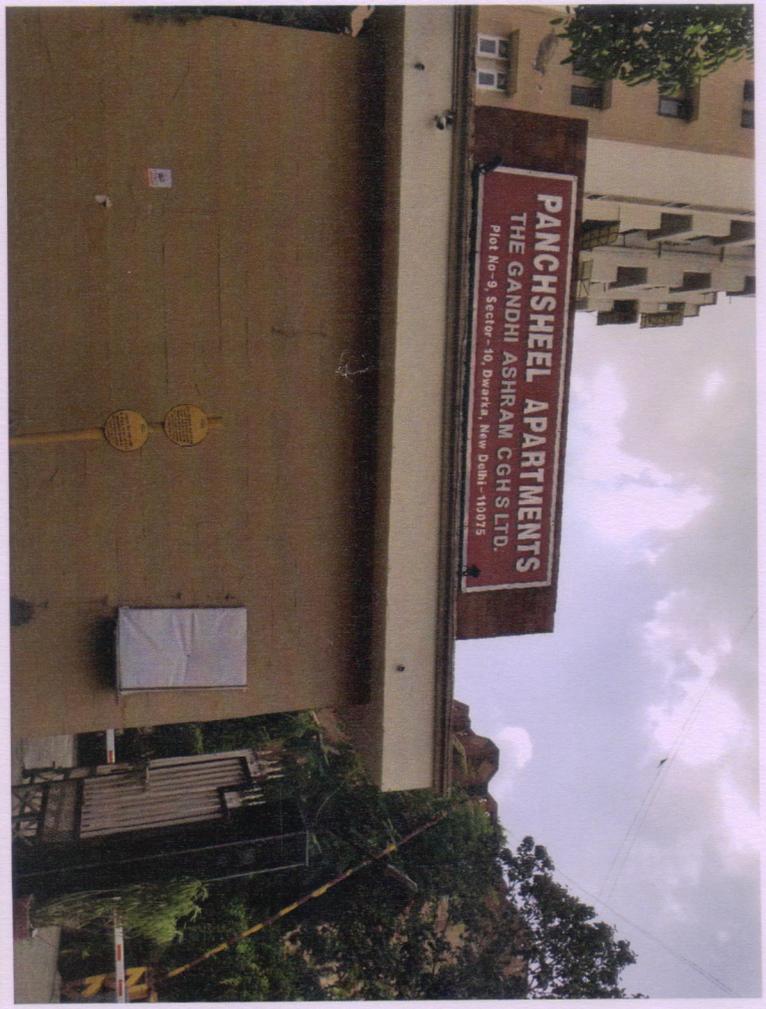
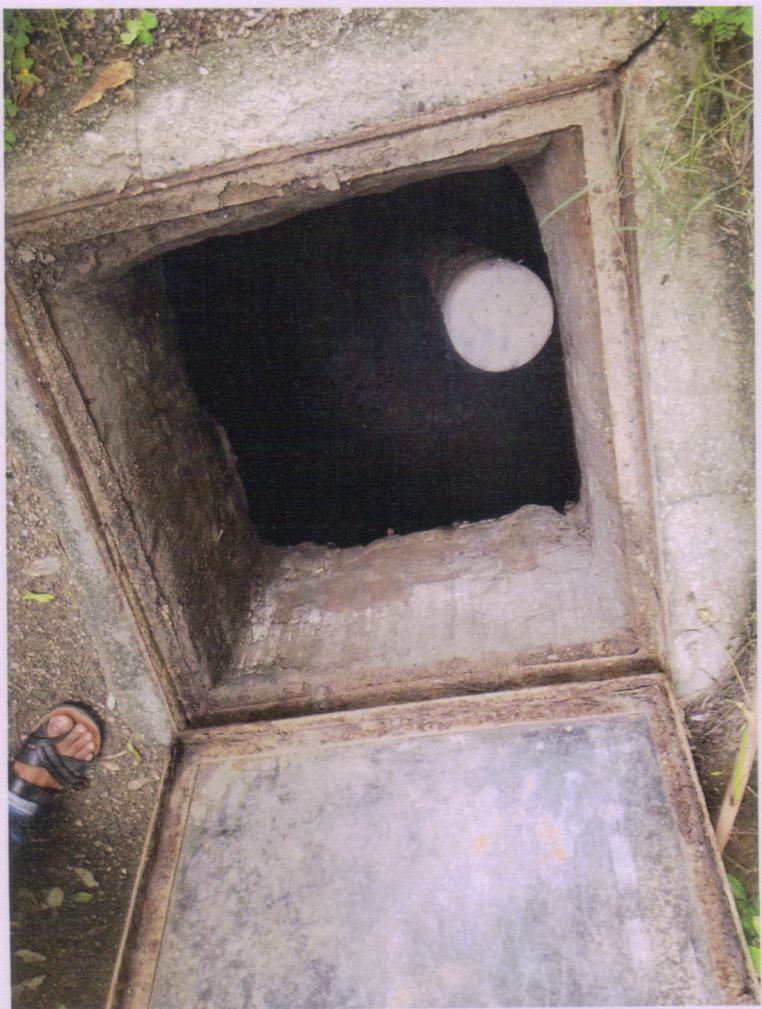
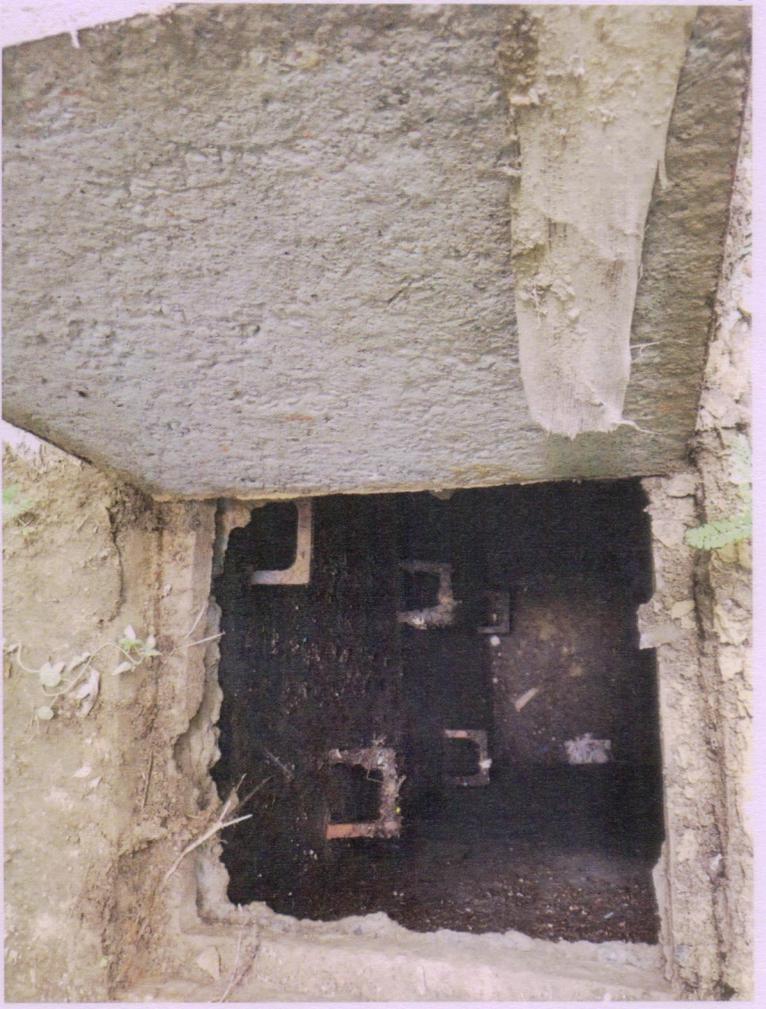


56


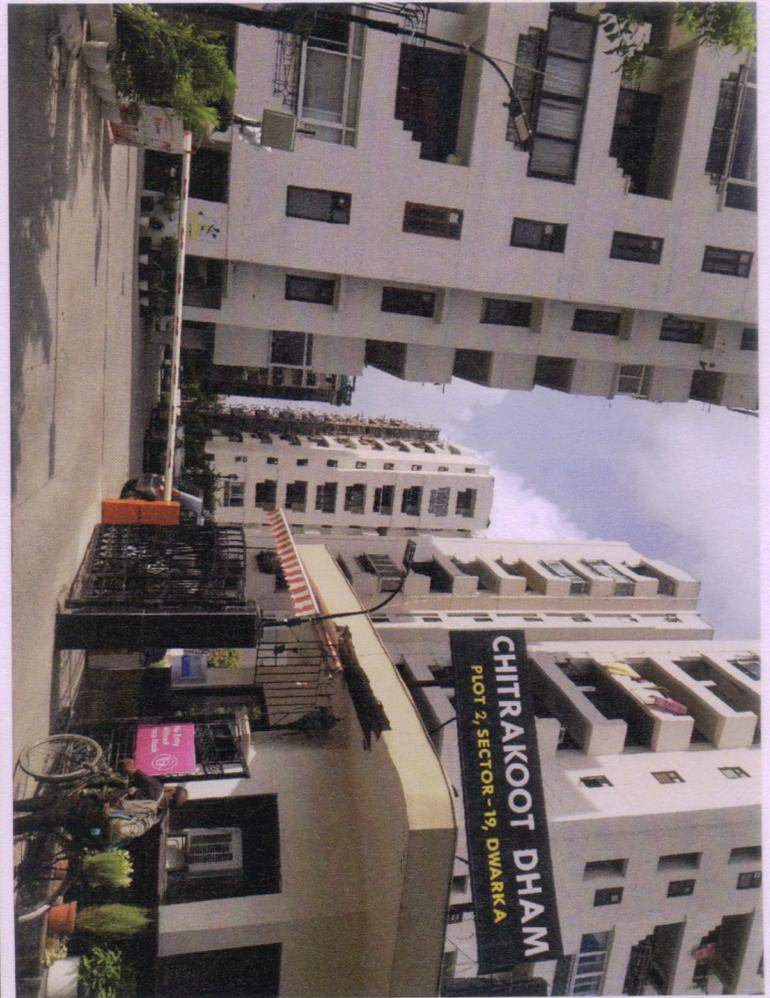


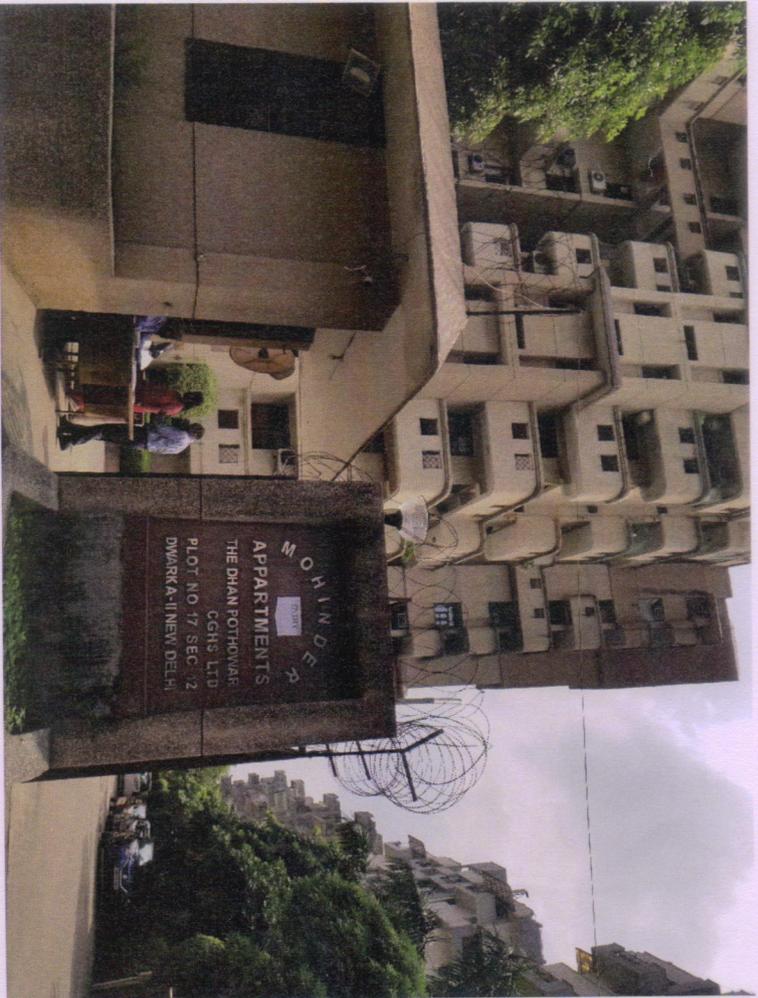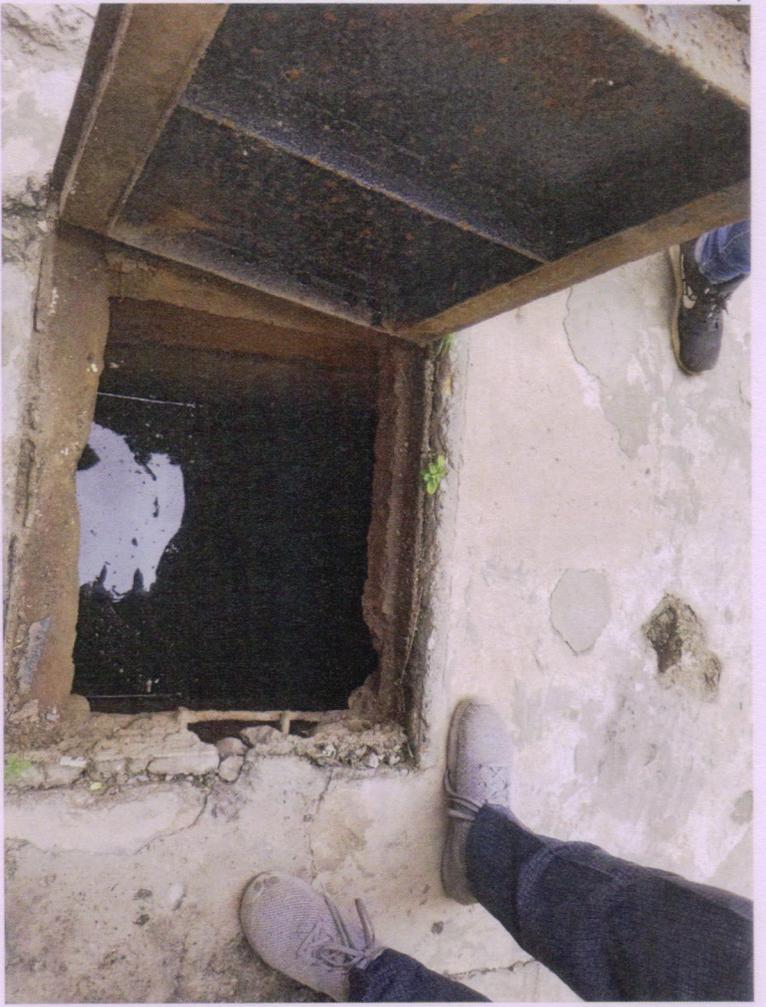

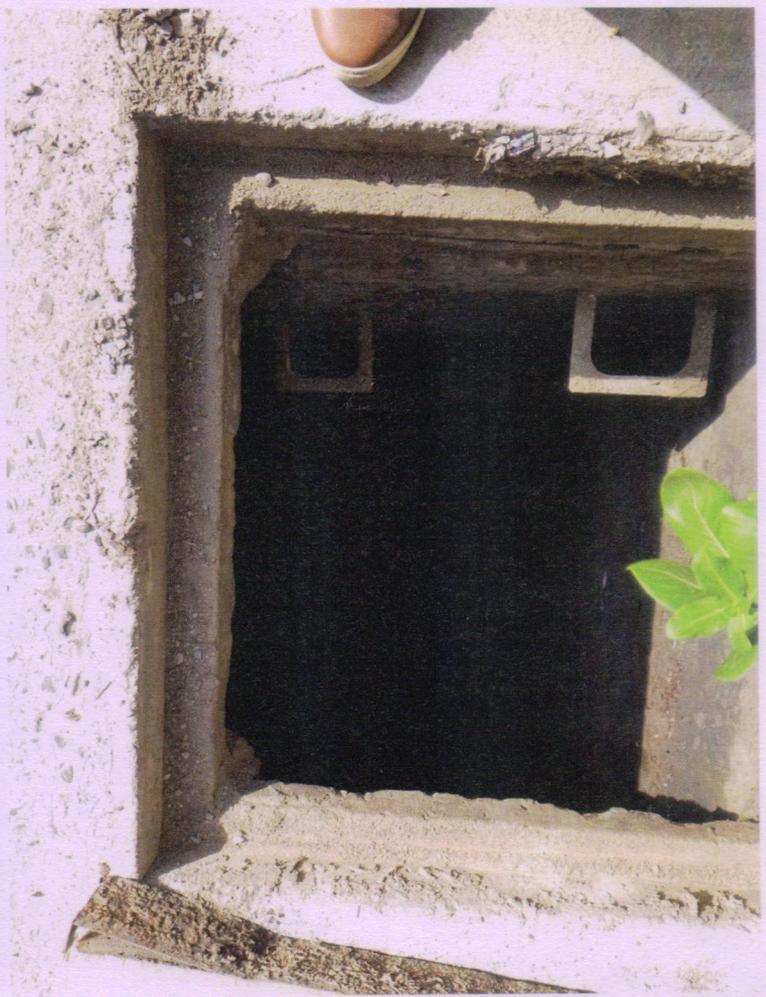


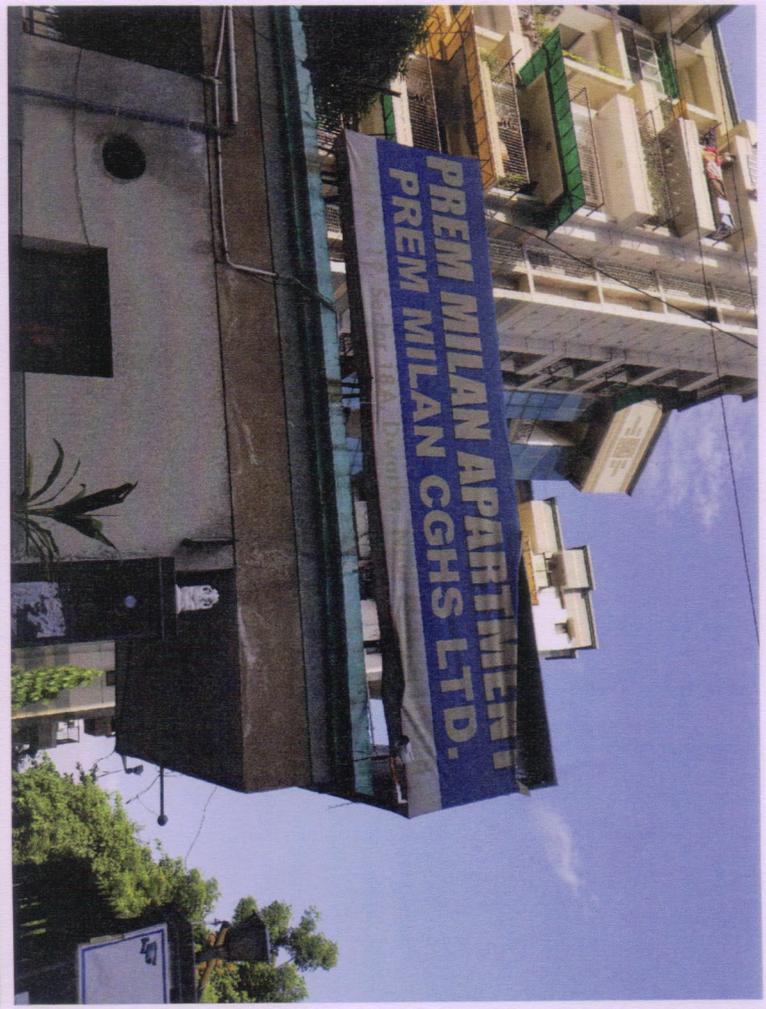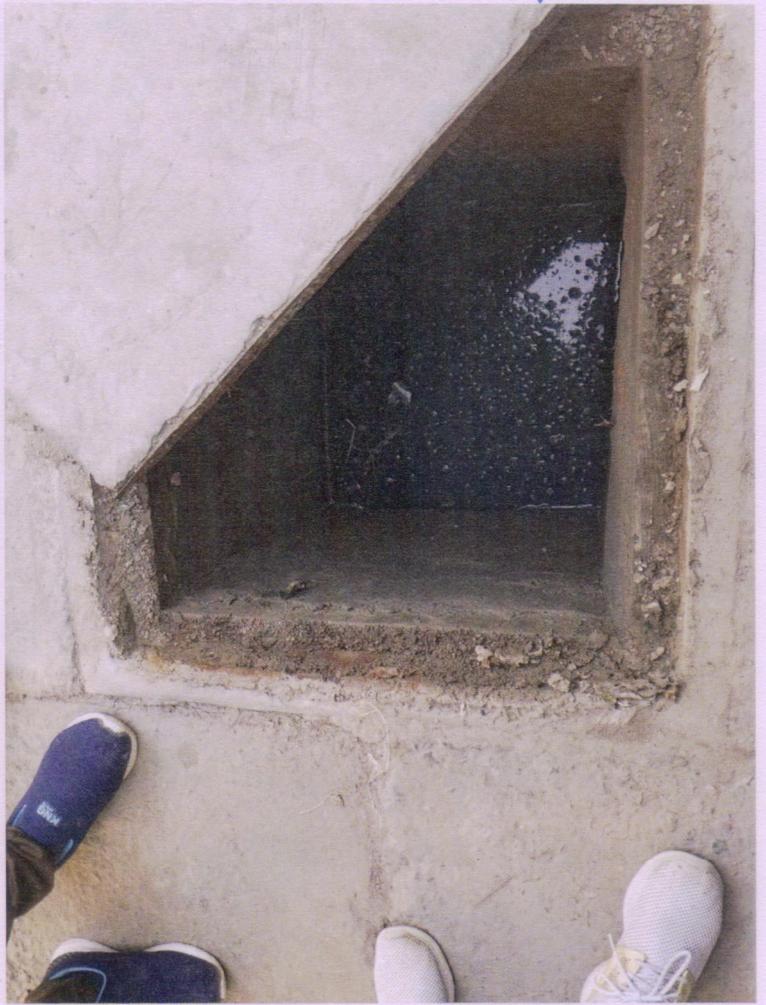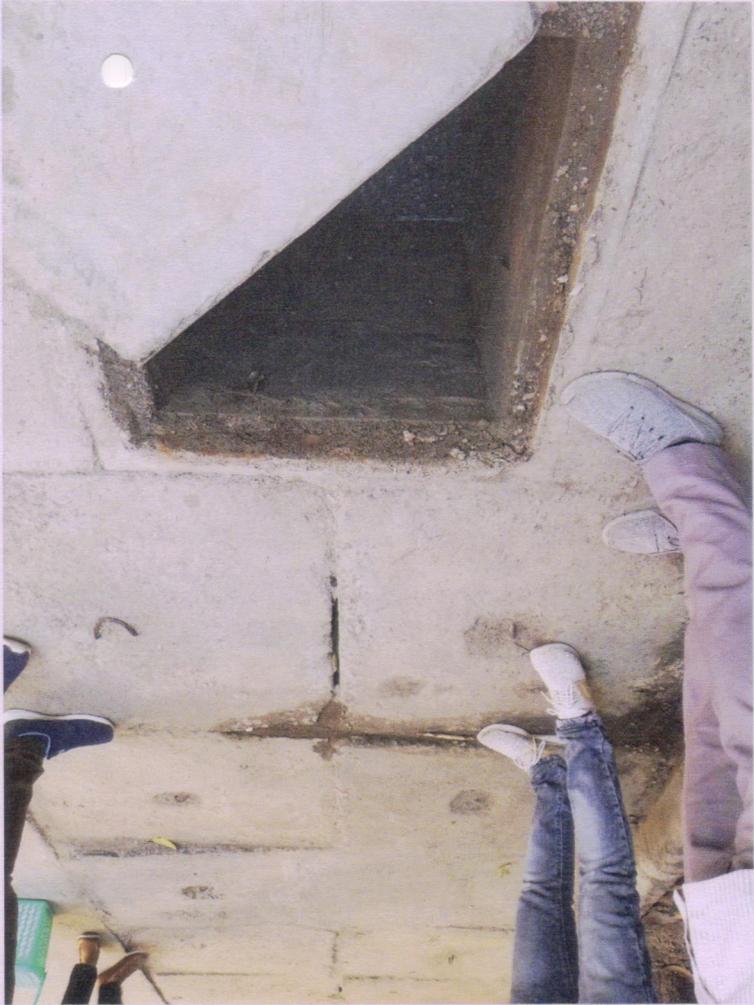


2/1/2 60

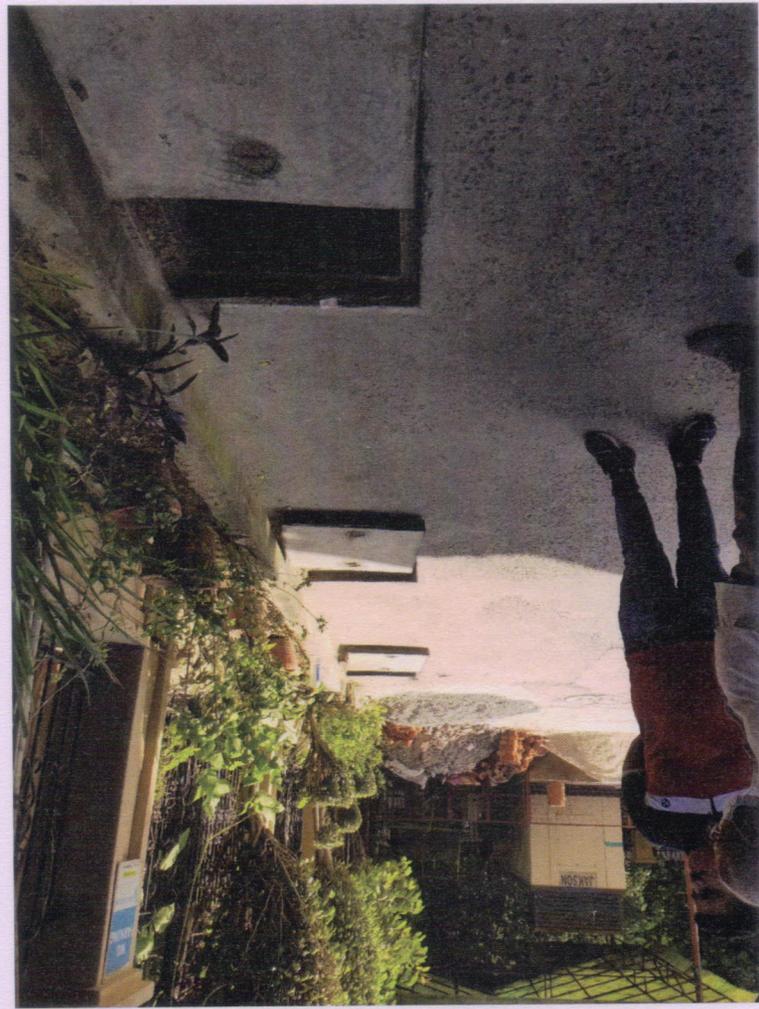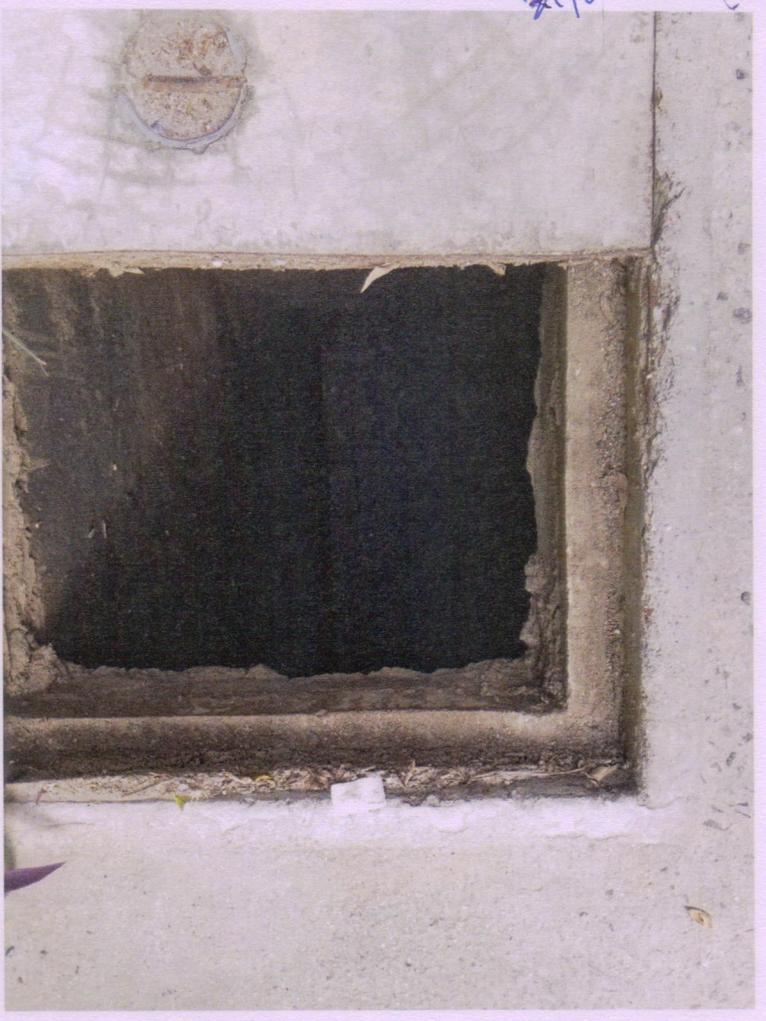




AY 61

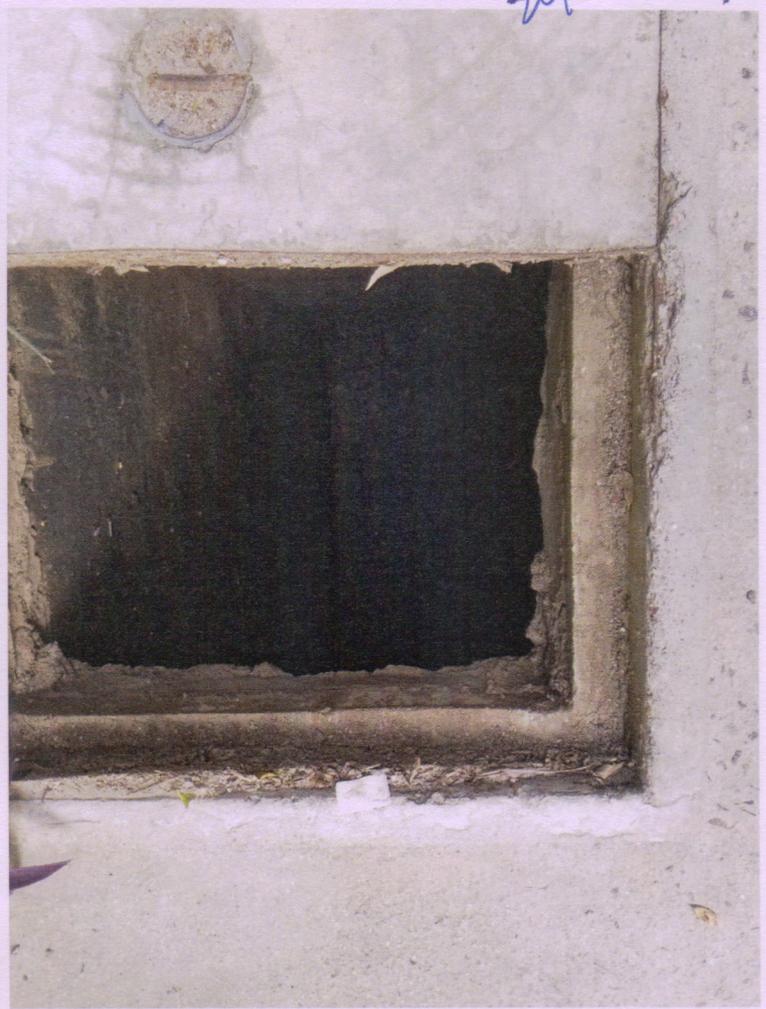




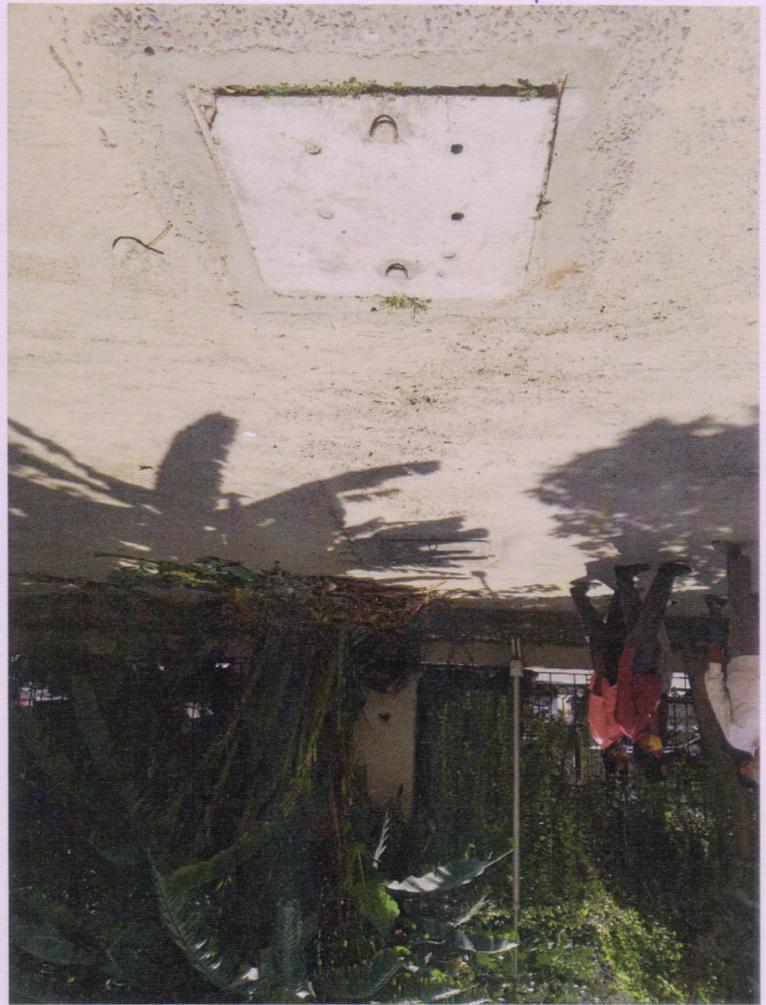


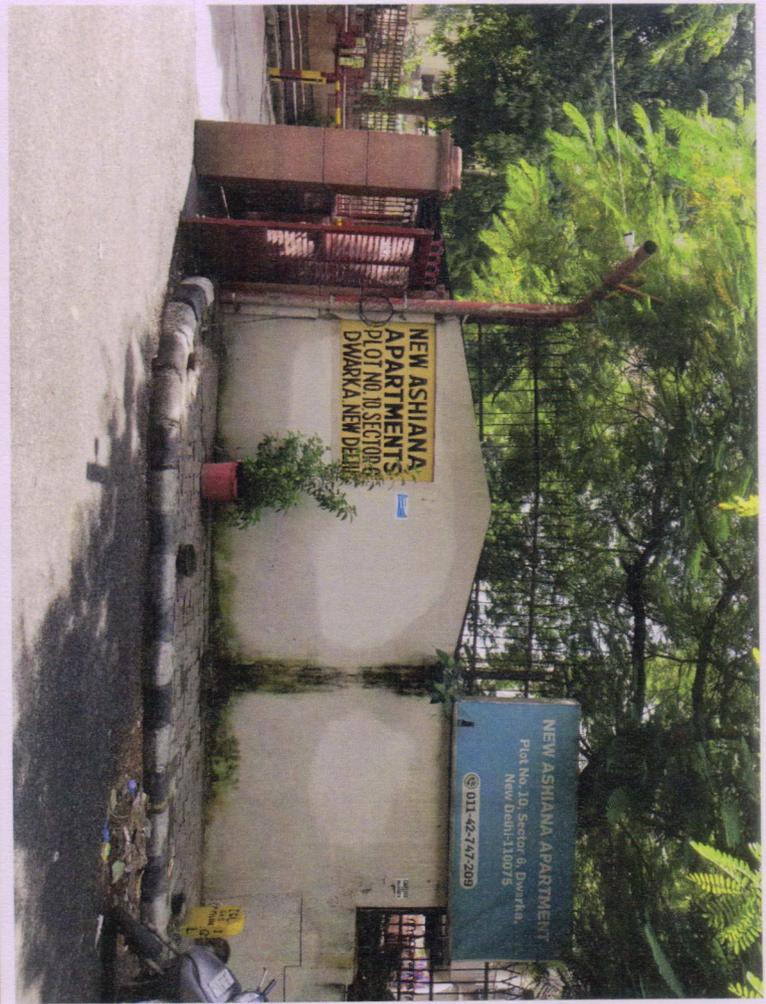

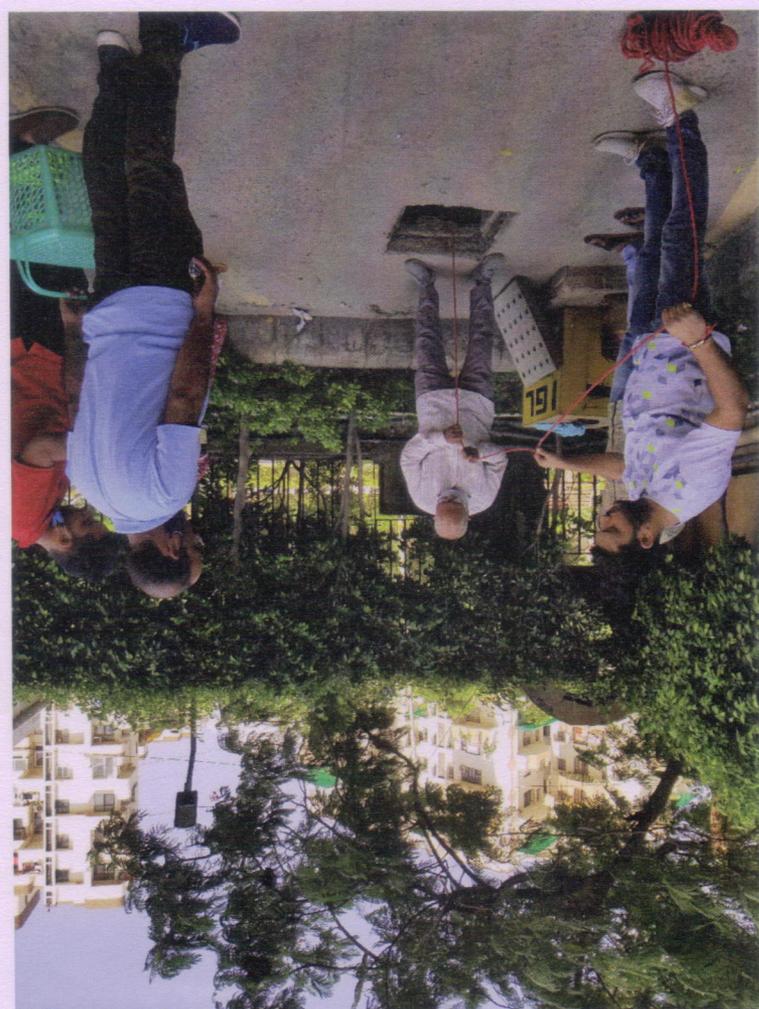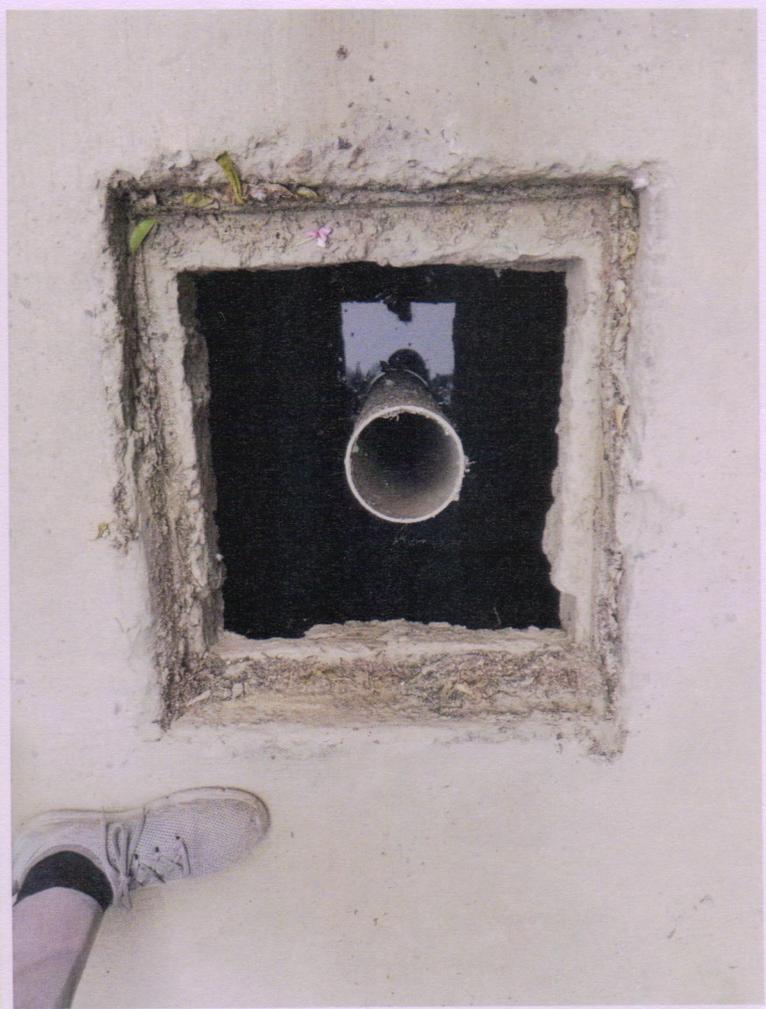



①

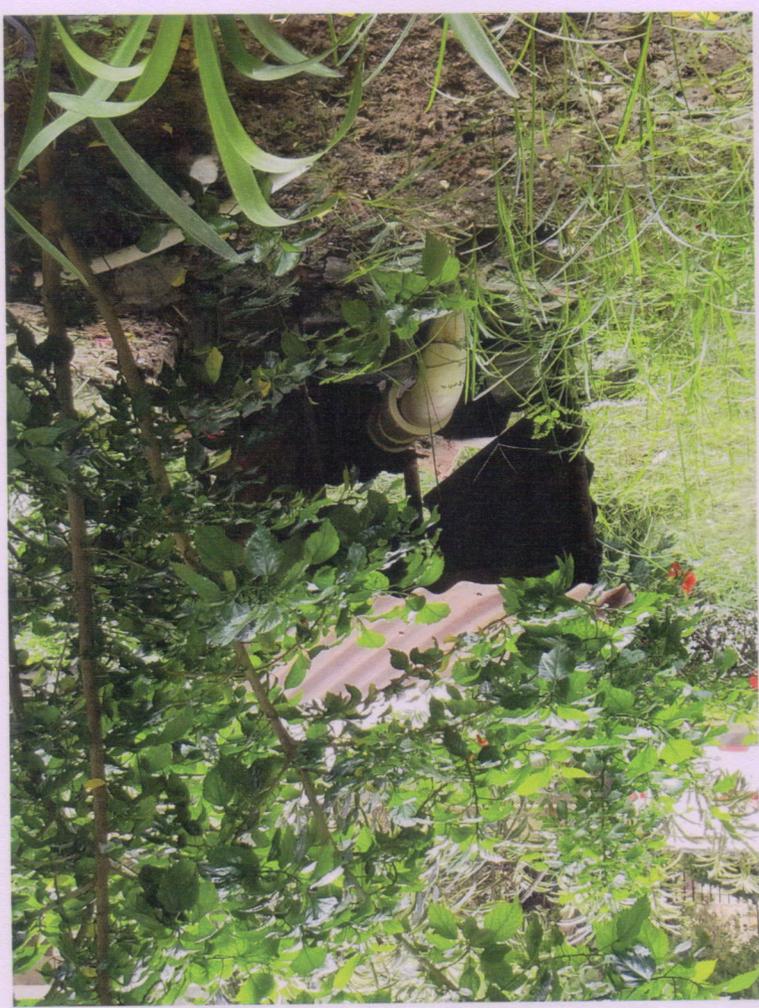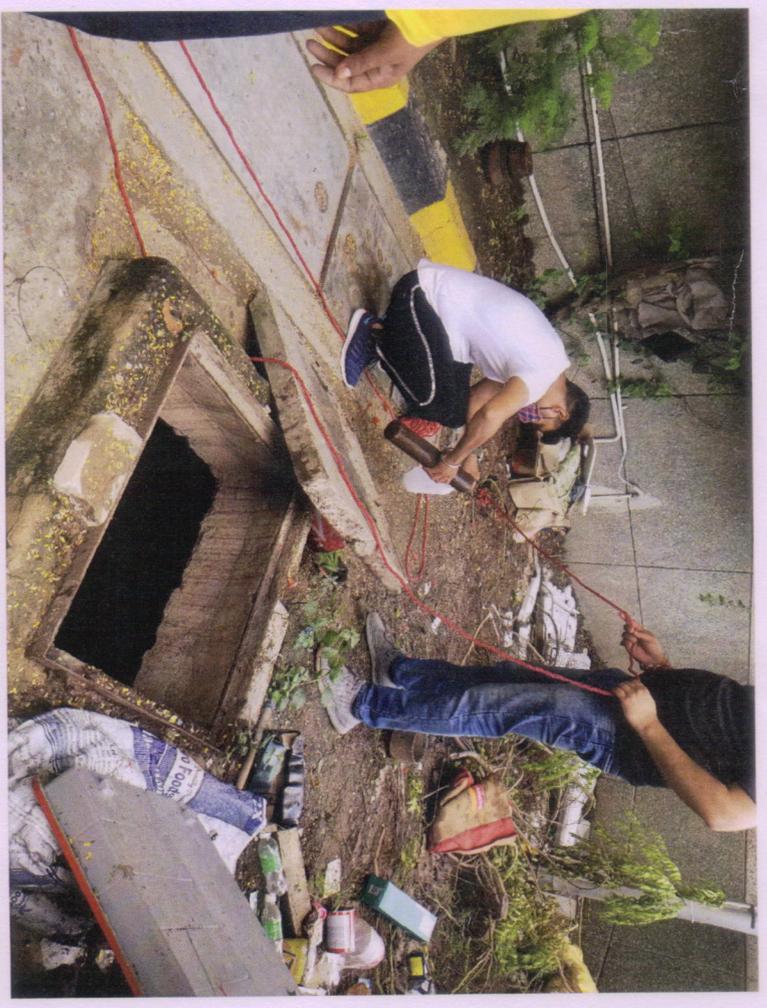

67 10

DELHI JAL BOARD: GOVT. OF NCT DELHI  
OFFICE OF THE EXECUTIVE ENGINEER (RWH)-I  
A-BUILDING, JHANDEWALAN, NEW DELHI

No.DJB/EE(RWH)-I/2021/1581

Dated: 06.10.2021

Sub:- Minutes of the meeting for Rain Water Harvesting and bore wells of all CGHS Societies in Dwarka as per NGT Court orders. (Held on 06.10.21)

Ref:- Hon'ble NGT Court Order dated 07.07.2020 passed in Original Application No. 147/2021 Mahesh Chandra Saxena Versus The Chief Secretary, Govt. of NCT of Delhi & Ors.

Following were present:-

- (Banshri DTQ) mom 6/10/21
1. Sh. Ashutosh Kaushik, DTQC, DJB
  2. Sh. Harish Chander, ACE(RWH), DJB
  3. Sh. Vimal V. Belani, EE(RWH)-I
  4. Ms. Suniti Parashar, Scientist "C" WQM-I Division, CPCB Suniti (CPCB)
  5. Sh. N.K. Joshi, Environmental Engineer, DPCC Joshi (DPCC)
  6. SH. Rakesh Kumar Sharma, AE-I, DJB

Following points were deliberated:

- It was apprised that regarding technical efficacy of RWH Systems, the designs of the same have been adopted either from CGWB or DJB which are satisfactory in technical efficacy. The chances of the contamination are due to mixing of the rain water with the waste water from different sources other than that of roof top rain water.
- Regarding contamination of ground water, it was apprised to the committee on testing of the 38 Nos. water samples. It has been found that very partial contamination from the 27 parameters tested, samples have exceeded the permissible limit in only 03 parameters.
- It was further apprised that to avoid contamination of the ground water, only rain water from roof top area be diverted to the rain water harvesting systems. The water from other sources entering to RWH System should be disconnected with immediate effect.

EE(RWH/GWC)-I

All Concerned

Copy to:-

1. Member (WS)/CNO : for kind information please.
2. CE(WB/Conservation) : -do-
3. ACE(RWH) : -do-
4. Ms. Sakshi Popli, DJB Legal Counsel, 614, Patiala House, New Delhi-110002.
5. AE-I(RWH)
6. O/c

O/c

EE(RWH/GWC)-I  
EE (RWH/GWC)  
DELHI JAL BOARD  
VARUNALAYA BHAWAN  
JHANDEWALAN, N.D.-5

1 68.

**DELHI JAL BOARD: GOVT. OF NCT DELHI  
OFFICE OF THE CHIEF ENGINEER (GW)  
VARUNALAYA PH-I, KAROL BAGH, NEW DELHI**

No.DJB/CE (GW)/2021/1702 .

Dated: 17/11/21

To,

Sh. N.K. Joshi, Environmental Engineer,  
DPCC, 4<sup>th</sup>, 5<sup>th</sup> Floor, ISBT,  
GT Karnal Road, Kashmere Gate,  
New Delhi-110006

**Subject:- Original Application No. 147/2021 in the matter of Sh. Mahesh Chandra Saxena V/s The Chief Secretary, Govt. of National Capital Territory of Delhi and Ors.**

Dear Sir,

As you are aware that the inspections were carried out in Societies of Dwarka in the above said matter. During the Joint Inspections of DJB, DPCC, CPCB teams it was observed that the waste water from balconies of the houses, washing areas and waste water from the paved areas was being sent in the Rain water Harvesting pits.

Since the matter is in regard to rectification of water pollution as per water and air act you are requested to direct the societies of Dwarka to take all necessary remedial actions in the time bound manner with regard to rectification of water pollution.

This may please be taken up on TOP PRIORITY.

*sd/2*  
EE(RWH)-I

Copy to:-

1. Member (WS) : for kind information please.
2. CE(GW) : -do-
3. ACE(C-8) : -do-
- ✓4. AE-I : to pursue
5. O/c

*[Signature]*  
EE(RWH)-I  
EE (RWH/GWC)  
DELHI JAL BOARD  
VARUNALAYA BHAWAN  
JHANDEWALAN, N.D.-5